


Company - CITIZEN SERVICE OIL COMPANY
 Farm - Schropel "B" No. 3

SEC. 25 T. 20 R. 11W
 N. S. / S. /
 990' N and 530' E of S. / cor.

Total Depth. 3369'
 Comm. 11-15-47 Comp. 11-27-47
 Shot or Treated. None
 Contractor. Carbutt-Barbour Drilg. Co.
 Issued. 1-3-48

County. Barton
 KANSAS

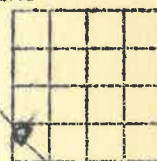

CASING:
 8-5/8" 221' Gal. W/150 Str.

Elevation. _____

Production. Dry hole
 (P & A 11-27-47)

Figures Indicate Bottom of Formations.

collar	9
clay	37
sand	115
shale	190
red bed	460
anhydrite	485
shale & shells	795
lime	825
shale & shells	1075
salt & shale	1250
lime & shale	1350
lime	1515
shale, sand & lime	1600
lime & shale	1660
lime sandy	1685
lime & shale	1850
lime	1915
shale & lime	2705
lime	2955
shale	3066
lime	3325
conglomerate	3341
lime	3369

Total Depth

TOPS:

Lansing	3064
Conglomerate	3309
Arbuckle	3337
Penetration	32

7-7/8" rotary hole.