


WELL LOG BUREAU--KANSAS GEOLOGICAL SOCIETY
508 East Murdock, Wichita, Kansas

Company- E. K. EDMISTON
 Farm- Wolf No. 1

SEC. 1 T₂₀ R_{12W}
 SE NW NW

Total Depth. 3376'
 Comm. 9-1-56 Comp. 9-11-56
 Shot or Treated.
 Contractor. Shelley-Miller Drilling, Inc.
 Issued. 10-20-56

County Barton
 KANSAS

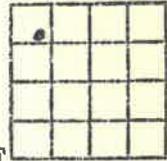

Elevation. 1797' DF

Production. 50 BOPD

CASING:

8 5/8" @156' w/150 sx. cem.
 5 1/2" @3370' w/125 sx. cem.

Figures Indicate Bottom of Formations.

MEASUREMENTS FROM TOP OF ROTARY BUSHING TO BOTTOM OF FORMATION

sand	120
sand & shale	175
Shale	260
red bed	674
Anhydrite	709
Shale & shells	1510
lime & shale	2900
lime	3376 RTD
Total Depth	

TOPS:

Topeka	2708
Heebner	2948
Brown Lime	3068
Lansing	3084
Reworked Arbuckle	3339
Arbuckle	3346

DRILL STEM TESTS:

DST #1, 3087-3150 op. 1 hr. Weak blow throughout test. Rec., 30' mud (oil specks in tool) IFP 0# FFP 0# BHP 0#.
 DST #2, 3347-3358 op. 1 hr., weak blow for 20". Rec. 68' mud w/a few oil specks. IFP 0# FFP 0# BHP 0#.
 DST #3, 3358-3376 Packer failure
 DST #4, 3356-3376 op. 30" (Packers leaked intermittently & washed out in 30". Rec. 31' heavily oil & gas-cut mud, 310' oil & gas-cut mud, 62' oily mud.

NOTE: No bottom hole pressure recorded inasmuch as packers washed out.