

TRILOBITE TESTING INC.

P.O. Box 1733 • Hays, Kansas 67601

Test Ticket

NO. 37349 14425

JUN 21 2010

Well Name & No. Goodman Unit #1-26 Test No. 1 Date 6-18-10
 Company Larson Engineering Inc. Elevation 2463 KB 2456 GL
 Address 562 W state Rd 4 Olmitz KS 67564
 Co. Rep / Geo. Bob Lewellyn Rig H-D #3
 Location: Sec. 26 Twp. 20s Rge. 26W Co. Ness State KS

Interval Tested 4242-4275 Zone Tested Altamont
 Anchor Length 33 Drill Pipe Run 4095 Mud Wt. 9.2
 Top Packer Depth 4237 Drill Collars Run 141 Vis 46
 Bottom Packer Depth 4242 (shale) Wt. Pipe Run - WL 8.0
 Total Depth 4275 Chlorides 2300 ppm System LCM 1

Blow Description IF: No blow
ISI: No blowback
FF: No blow
FSI: No blowback

Rec <u>1</u>	Feet of <u>Mud</u>	%gas	%oil	%water	<u>100</u> mud
Rec	Feet of	%gas	%oil	%water	%mud
Rec	Feet of	%gas	%oil	%water	%mud
Rec	Feet of	%gas	%oil	%water	%mud
Rec	Feet of	%gas	%oil	%water	%mud

Rec Total 1 BHT 115 Gravity - API RW - @ - ° F Chlorides - ppm

(A) Initial Hydrostatic 2045
 (B) First Initial Flow 17
 (C) First Final Flow 17
 (D) Initial Shut-In 21
 (E) Second Initial Flow 17
 (F) Second Final Flow 17
 (G) Final Shut-In 19
 (H) Final Hydrostatic 2026

☐ Test 1225
☐ Jars 250
☐ Safety Joint 75
☒ Circ Sub ANA
☒ Hourly Standby
☐ Mileage 116 252 RT 145
☒ Sampler
☒ Straddle
☐ Shale Packer 250
☒ Extra Packer
☒ Extra Recorder
☒ Day Standby
☒ Accessibility
 Sub Total 1945

T-On Location 13:15
 T-Started 13:53
 T-Open 16:11
 T-Pulled 17:41
 T-Out 20:20
 Comments
☒ Ruined Shale Packer
☒ Ruined Packer
☒ Extra Copies
 Sub Total
 Total


Initial Open 15
 Initial Shut-In 30
 Final Flow 15
 Final Shut-In 30

Approved By

Our Representative

James Winkler

Trilobite Testing Inc. shall not be liable for damaged of any kind of the property or personnel of the one for whom a test is made, or for any loss suffered or sustained, directly or indirectly, through the use of its equipment, or its statements or opinion concerning the results of any test. tools lost or damaged in the hole shall be paid for at cost by the party for whom the test is made.

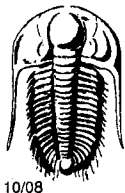

TRILOBITE TESTING INC.

P.O. Box 1733 • Hays, Kansas 67601

Test Ticket

NO. 37350

JUN 23 2010

Well Name & No. Goodman Unit # 1-26 Test No. 2 Date 6-19-10
 Company Larson Engineering, Inc. Elevation 2463 KB 2456 GL
 Address 562 W 3rd State Rd 4 Olmitz, KS 67564
 Co. Rep / Geo. Bob Lewellyn Rig HD#3
 Location: Sec. 26 Twp. 20s Rge. 26w Co. NESS State KS

Interval Tested 4274 - 4390 Zone Tested Pawnee + Fort Scott
 Anchor Length 116 Drill Pipe Run 4123 Mud Wt. 9.2
 Top Packer Depth 4269 Drill Collars Run 141 Vis 49
 Bottom Packer Depth 4274 (shale) Wt. Pipe Run - WL 8.0
 Total Depth 4390 Chlorides 3000 ppm System LCM 1
 Blow Description IF: Blow built to 1/4" in 4 min, Intermittent blow @ 1/4" through open
ISI: Bled off, No blowback
FF: No blow
FSI: No blowback

Rec	Feet of	%gas	%oil	%water	%mud
<u>20</u>	<u>50cm</u>	<u>4</u>	<u>6</u>	<u>-</u>	<u>90</u>
Rec	Feet of	%gas	%oil	%water	%mud
Rec	Feet of	%gas	%oil	%water	%mud
Rec	Feet of	%gas	%oil	%water	%mud
Rec	Feet of	%gas	%oil	%water	%mud

Rec Total 20 BHT 117 Gravity - API RW - @ - °F Chlorides - ppm

(A) Initial Hydrostatic 2082
 (B) First Initial Flow 22
 (C) First Final Flow 29
 (D) Initial Shut-In 125
 (E) Second Initial Flow 31
 (F) Second Final Flow 33
 (G) Final Shut-In 93
 (H) Final Hydrostatic 2048

☐ Test 1225'
☐ Jars 250'
☐ Safety Joint 75'
☒ Circ Sub ANA
☒ Hourly Standby
☐ Mileage 110 RT 145'
☒ Sampler
☒ Straddle
☐ Shale Packer 250'
☒ Extra Packer
☒ Extra Recorder
☒ Day Standby
☒ Accessibility
 Sub Total 1945'


T-On Location 17:15
 T-Started 18:04
 T-Open 21:10
 T-Pulled 23:25
 T-Out 1:55
 Comments
☒ Ruined Shale Packer
☒ Ruined Packer
☒ Extra Copies
 Sub Total 0
 Total 1945'

Initial Open 15
 Initial Shut-In 30
 Final Flow 30
 Final Shut-In 60

Approved By

Our Representative

Trilobite Testing Inc. shall not be liable for damaged of any kind of the property or personnel of the one for whom a test is made, or for any loss suffered or sustained, directly or indirectly, through the use of its equipment, or its statements or opinion concerning the results of any test. tools lost or damaged in the hole shall be paid for at cost by the party for whom the test is made.

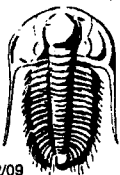

**TRILOBITE
TESTING INC.**

P.O. Box 1733 • Hays, Kansas 67601

12/09

Test Ticket

NO. 38326

JUN 23 2010

Well Name & No. Goodman Unit #1-26 Test No. 3 Date 6-20-10
 Company Larson Engineering, Inc Elevation 2463 KB 2456 GL
 Address 562 W State Rd 4 Olmitz, KS 67564
 Co. Rep / Geo. Bob Lewellyn Rig HD #3
 Location: Sec. 26 Twp. 20s Rge. 26w Co. NESS State KS

Interval Tested 4382-4438 Zone Tested Cherokee Sand
 Anchor Length 56 Drill Pipe Run 4218 Mud Wt. 9.3
 Top Packer Depth 4377 Drill Collars Run 141 Vis 49
 Bottom Packer Depth 4382 (shale) Wt. Pipe Run - WL 10.0
 Total Depth 4438 Chlorides 3200 ppm System LCM trace
 Blow Description IF: 1/4" blow @ open, built to 3/4"
ISI: Bled off, No blowback
FF: No blow
FSI: No blowback

Rec	Feet of	%gas	%oil	%water	%mud
<u>30</u>	<u>600m</u>	<u>9</u>	<u>13</u>	<u>-</u>	<u>78</u>
Rec	Feet of <u>30' GIP</u>	%gas	%oil	%water	%mud
Rec	Feet of	%gas	%oil	%water	%mud
Rec	Feet of	%gas	%oil	%water	%mud
Rec	Feet of	%gas	%oil	%water	%mud

Rec Total 30' Fluid 30' GIP BHT 117 Gravity - API RW - @ - °F Chlorides - ppm

(A) Initial Hydrostatic	<u>2127</u>	☐ Test	<u>1225</u>	T-On Location	<u>13:30</u>
(B) First Initial Flow	<u>22</u>	☐ Jars	<u>250</u>	T-Started	<u>14:15</u>
(C) First Final Flow	<u>27</u>	☐ Safety Joint	<u>75</u>	T-Open	<u>17:06</u>
(D) Initial Shut-In	<u>99</u>	☒ Circ Sub	<u>NA</u>	T-Pulled	<u>19:21</u>
(E) Second Initial Flow	<u>31</u>	☒ Hourly Standby		T-Out	<u>21:30</u>
(F) Second Final Flow	<u>37</u>	☐ Mileage	<u>116 RT 145</u>	Comments	
(G) Final Shut-In	<u>68</u>	☒ Sampler			
(H) Final Hydrostatic	<u>2098</u>	☒ Straddle			

Initial Open 15
 Initial Shut-In 30
 Final Flow 30
 Final Shut-In 60

☐ Shale Packer 250
☒ Extra Packer
☒ Extra Recorder
☒ Day Standby
☒ Accessibility
 Sub Total 1945

☒ Ruined Shale Packer
☒ Ruined Packer
☒ Extra Copies
 Sub Total 0
 Total 1945

Approved By

Our Representative

TriLOBITE Testing Inc. shall not be liable for damaged of any kind of the property or personnel of the one for whom a test is made, or for any loss suffered or sustained, directly or indirectly, through the use of its equipment, or its statements or opinion concerning the results of any test, tools lost or damaged in the hole shall be paid for at cost by the party for whom the test is made.