



200

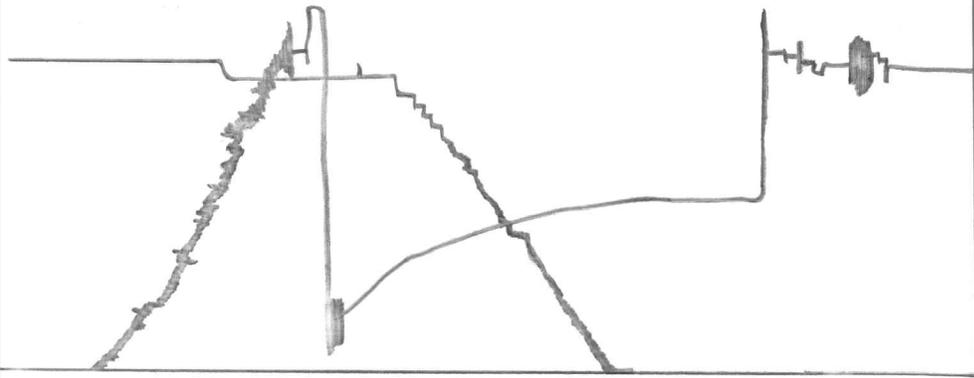

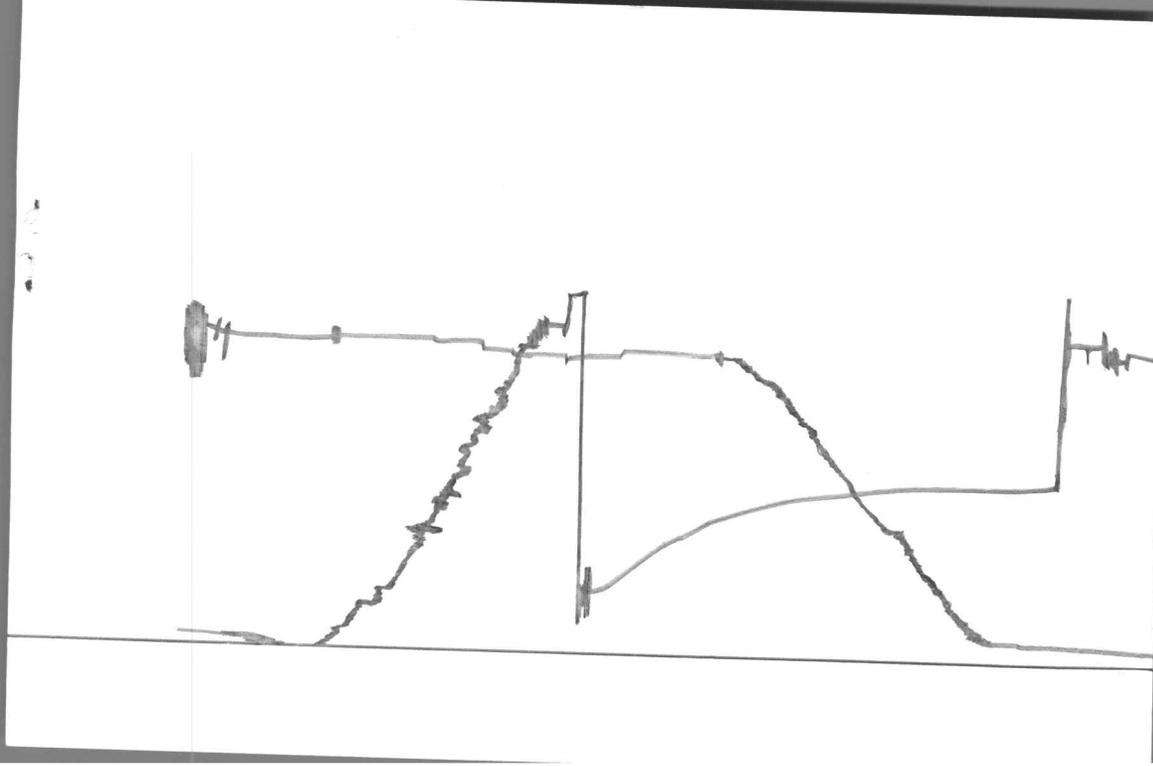

BEE FORMATION TESTING CO.

P. O. BOX 491

GREAT BEND, KANSAS

N^o 1921DATE 12-12-56CUSTOMER'S
ORDER NO. _____NAME OF COMPANY HILTON Drldg. Co.ADDRESS TO MAIL INVOICE Great Bend, Ks.ADDRESS TO MAIL PRESSURE CHARTS SameLEASE Strobel WELL NO. 2 COUNTY Stafford STATE Ks.TESTER William M. Blake APPROVED StephensDRILL STEM TEST NO. 2 SUCCESSFUL NO. 2 MIS-RUN NO. _____ FORMATION TESTED ViolaSIZE HOLE 7 7/8 TOOL JT. 4 1/2 F, H.RUBBER SIZE 6 3/4 - 2 7/8 - 30 TEST TOOL SIZE 4 5/8PACKER SET AT 3745 ANCHOR SIZE 4 1/2TOTAL DEPTH WELL 3754 LENGTH ANCHOR 9'PRESSURE RECORDER CAP. 3500 - 3500 DRILL PIPE RUN: DRY yes WITH FLUID _____

RESULTS:

PACKER SET 9:07 P.M. TOOL OPEN 9:12 P.M. TOOL OPEN 90 MIN. HRS.BLOW Strong decreasing Steady To FairBy end of Test. Gas To Surface in 24 MIN.RECOVERY Recovered 36.23 feet of gassy oilSHUT IN PRESSURE TIME 20 MIN. MUD WT. 10.3 VIS. 41 WATER LOSS 10.BHP 1250 IFP 200 FFP 1100 HYDROSTATIC HEAD 2040EXTRA EQUIPMENT Jars & Safety Joints S.R. Bowen NO. 183 SIZE _____

OPERATOR TIME _____ TOOL RENTAL TIME _____

BEE FORMATION TESTING CO.

SHALL NOT BE LIABLE FOR DAMAGE OF ANY KIND TO THE PROPERTY OR PERSONNEL OF THE PARTY FOR WHOM A TEST IS MADE, OR FROM ANY LOSS SUFFERED OR SUSTAINED, DIRECTLY OR INDIRECTLY, THROUGH OR IN THE COURSE OF THE USE OF ITS EQUIPMENT, ALL OF WHICH LOSS OR DAMAGE IS ASSUMED BY THE CUSTOMER. TOOLS LOST OR DAMAGED IN THE HOLE SHALL BE PAID FOR AT THE COST OF THE PARTY FOR WHOM TEST IS MADE.