


WELL LOG BUREAU - KANSAS GEOLOGICAL SOCIETY.
412 Union National Bank Bldg, Wichita, Kansas.

CARL HIPPLE OIL CO.
Martindell No. 2

SEC. 18 T. 23 R. 3W.
CNL SE $\frac{1}{4}$

Total Depth. 3369
Comm. 6-24-39 Comp. 7-29-39
Shot or treated. 2000 gal.
Contractor. W.W.W. Drlg. Co.
Issued. 8-19-39

County Harvey.

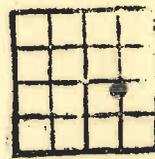

CASING.

13" 278'6
7" 3271'

Elevation.

Production. Pot. 1140 B.

Figures Indicate Bottom of Formations.

soil	5	brokon shale and limo	2737
sand clay	70	limo hard	2808
rotten shale	140	limo	2812
sand	160	shalo	2840
red bed	170	shalo hard and limo	2865
broken sand shells	190	limo hard	2890
shale	225	shalo hard	2902
red bed	255	K.C. limo	2925
broken shale and shell	285	limo	2930
shale	320	shalo	2938
shale and shells	360	limo hard	2940
red rock	375	brokon sdy limo	2951
shale	425	limo hard	2955
sand	445	broken limo	2966
red rock	485	shalo	2984
broken shale	525	broken limo and shalo	3002
shale and shall	565	limo	3015
limo	590	broken limo and shalo	3048
broken shale and limo	628	shalo	3060
shalo and limo	890	limo hard	3070
limo	925	shale	3108
broken limo	962	shale and limo broaks	3158
sand	995	shale and limo shells	3190
shalo	1003	shalo	3197
sand	1030	limo shells and shalo	3218
broken limo and shalo	1139	shale	3237
shale hard	1240	shale Various colors	
broken shale and limo		top chat	3250
shells	1350	chat and shalo	3262
shalo	1617	shalo	3271
limo	1647	chat cable tools	3288 $1\frac{1}{2}$ M.G.
shalo and limo shells	1837	chat	3295
limo	1852	limo	3300
shalo	1865	chat some limo	3312 trace oil
limo	1875	chat and limo	3325
limo hard	1925	sdv limo	3331
limo grey	1987	sdv limo sh oil	3336
shalo	2015	chat wh & brown	3346
limo	2023	chat wh & brown	3352 Gas and oil
broken shale	2068	chat Oil	3369 increased.
broken limo and shalo	2158	Total Depth.	
shalo	2178		
limo	2233		
limo	2240		
shalo	2255		
limo	2289		
limo grey	2328		
broken limo and shalo	2353		
shalo	2427		
sand	2472		
shalo hard	2497		
limo	2505		
shalo	2528		
flint limo	2537		
shalo hard	2571		
shalo and limo	2660		