


★★

State KANSAS Field Sequoia 10
 Company CHAMPLIN Refining Co. County Finney
 Farm GARDEN CITY "C" No. 6
 Sec. 16 Twp. 23 S Range 34 W

Spot NE SE SE

Contractor Hortman

Remarks

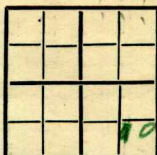

Comm. 10-19-56 Comp. 12-13-56

Elev. DF 2954 GL 2952 KB 2956 TD 5030 PB

Pay 4632-35, 4644-49, 4657-79

I.P. st. at 4630 ^{TR water} Press.

Casing Record: 13 3/8 7"

20" 10 3/4 5 1/2" 4790/960

16" 8 5/8 427/300

Loc.	Sample	Log
<u>061 17</u>	Heeb 3775	Lan 3819
<u>061 21</u>	tor 3789	BKC 4282
061 22 45	Lan 3821	Marm 4299
<u>061 51</u>	BKC 4282	cher 4427
061 52 80	Marm 4300	Mor 4630
<u>061 7</u>	cher 4428	sd 4632-36
<u>DST 4572-4658 pk failed</u>	Morsh 4626	" 46 94-96
<u>unloaded 90' fluid, rec 326</u>	" sd 4631-38	" 4657-69
<u>gassy mud No Press.</u>	" 4662-67	4671-79
Prep DST 4569-4658	st gen 4679	st gen 4679
<u>144</u>	st lo. 4826	st lo 4824
<u>DST 4569-4658 op 2 hrs</u>		st gen 5021
<u>pk failed in 30', rec 1535'</u>		
<u>sl. gcm No Press.</u>		
<u>DST 4552-4658, failed</u>		
<u>rec 630' mud.</u>		
<u>DST 4624-58 op 2 hrs, 9d p/b 15" rec 3274 gas</u>		
<u>+ 90' oil cut mud + 180' mud cut oil + 460' gas o</u>		
<u>IFB 120-225 BHP 1070/20</u>		
<u>DST 4663-80 op 2 hrs, white, rec 8' sh ocm No P.</u>		
<u>DST 4663-80 op 2 hrs, rec 70' ocm, + 270' gms</u>		
<u>FP 80-170, BHP 890/20</u>		

612485
DST 4915-67 op 2 hrs rec 35 in, FP 20-80
BHP 680/20

Prep 0

NOV 21

RTD 5030, ran log, ran 5 1/2 @ 9790/960

NOV 21

RUC T LO to 9706, PT/12/4632-35
20/4644-49, 88/4657-79, A/500 m. frac/21000
SD/21000 flow load.

DEC 5

ran T:R, P.O.P.

DEC 12

Pump test 33 BOPD (6% B.S.)

DEC 19

W.O.T,
5148 hrs, st. pot. 4880PD (6.30.5°)+TR water

AMARILLO TOPS

2956 KB

Winfield 2554 (-402)

Heebner 3775 (-819)

Lansing 3818 (-862)

Morrow 4630 (-1674)

"S-2" "A" Sd 4632 (-1676) T 4', o' por, G 45 BOPD / tr SW

"S-2" Sd 4657 (-1701) T 12', 0' por, Oil

Miss 4679 (-1723)

TD 5030 (-2070)

sd 4644-49

3 1/4
5 1/2
2 1/2
30