


WELL LOG BUREAU - KANSAS GEOLOGICAL SOCIETY.
412 Union National Bank Bldg, Wichita, Kansas.

STANOLIND OIL AND GAS CO.
W.C. Volker No. 7

23-24-11W
SEC. 23 T. 24 R. 11W.
CSL N¹/₂ NE
1650' NSL 1320' EWL

Total Depth. 3807 P.B. 3806
Comm. 10-9-38 Comp. 11-3-38
Shot or Treated. 10 qts 3801- 3805
Contractor.
Issued. 1-28-39

County Stafford.

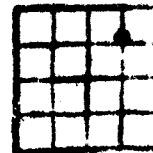

CASING. Rotary 3800
Cable 3807

Elevation.

13" 253'10" 7" 3798'

Production. Pot. 1909 B.

Figures Indicate Bottom of Formations.

red bod and sand	143
red bod	258
sand and red bod	520
anhydrito	560
shells and shalo	1025
salt and shalo	1205
shells and shalo	1700
broken limo	2394
limo and shalo	2465
broken limo	2505
shalo	2590
broken limo	2859
broken limo and shalo	2991
limo	3027
broken limo	3258
limo and shalo	3328
broken limo and shalo	3382
broken limo	3410
<u>Top Lansing 3395</u>	
limo	3430
broken limo	3520
limo	3584
broken limo	3617
limo	3634
broken limo	3702
shalo	3744
broken limo	3774
shalo	3798
sand	3800
<u>Top Misonor sand 3798</u>	
Cable tools	
Core No. 1 0/5' Rec 3800-3805	
sand coarso sat.	
core No. 2 1/5 Rec. 3805-3810	
sand and limo	
SLC 3810 equals 3807	
<u>Top Viola 3806</u>	
limo	3807
P.B. 3806	
Total Depth	

Viola 3806-3807

Shoebbed on two hour test 10.50. 57.75 bbls of oil 600' off bottom 11-2-38