


26-24-13W

Total Depth. 4118
Comm. 3-26-38 Comp. 5-8-38
Shot or Treated. 2000 gal.
Contractor. Parker Drlg. Co.
Issued. 5-21-38

County Stafford.

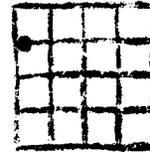

CASING. Rotary with Cable tool completion.

103/4" 465'
7" 4114'

Elevation.

Production. Pot. 747 B.

Figures Indicate Bottom of Formations.

cellar	10	brown limo	2700
surface soil	40	shale	2730
sand	125	shale and shells	2770
rod bed and sand	360	limo	2800
rod bed	480	broken limo & shale	2835
shale and shells	510	limo hard grey	2860
rod bed & sand	750	shale blk	2875
anhydrite	775	limo	2961
shale	915	broken limo & shale	2985
rod and grey shale	1025	limo hard grey	3000
anhydrite shells	1075	shale	3010
shale grey	1195	broken limo	3045
shale grey & shells	1295	shale	3061
salt and shale	1450	limo strks of shale	3082
shale and limo	1485	limo hard	3088
shale	1500	limo	3170
limo	1515	broken limo	3195
shale	1575	limo grey	3217
shale and shells	1635	limo	3240
limo	1645	limo soft	3262
shale	1685	limo	3466
broken anhydrite	1835	shale & limo shells	3510
broken limo and shale	1875	shale and anhydrite shells	3574
broken limo	1890	shale and shells	3586
sand and limo	1905	limo	3796
shale and limo	1925	broken limo & shale	3802
sand and limo	1950	limo	3816
shale	1955	shale	3860
limo	1970	cherty limo and shale	3893
shale	2000	shale	3934
limo	2030	conglomerate	3949
shale	2045	cherty limo Viola	4043
broken limo and shale	2090	shale	4048
sand and limo brkn	2108	limo	4066
limo	2160	Simpson	4115
shale	2180	Core No. 1 1' Rec.	4117
shale and limo	2220	limo	4118
limo	2240	Total Depth.	
shale blk	2280	shale	2475
shale	2295	limo brown	2560
broken limo & shale	2390	broken limo & shale	2575
limo	2415	sdv limo	2593
shale	2420	broken limo & shale	2612
limo	2430	limo	2625
shale	2437	shale	2660
limo	2460	limo and shale	2691