



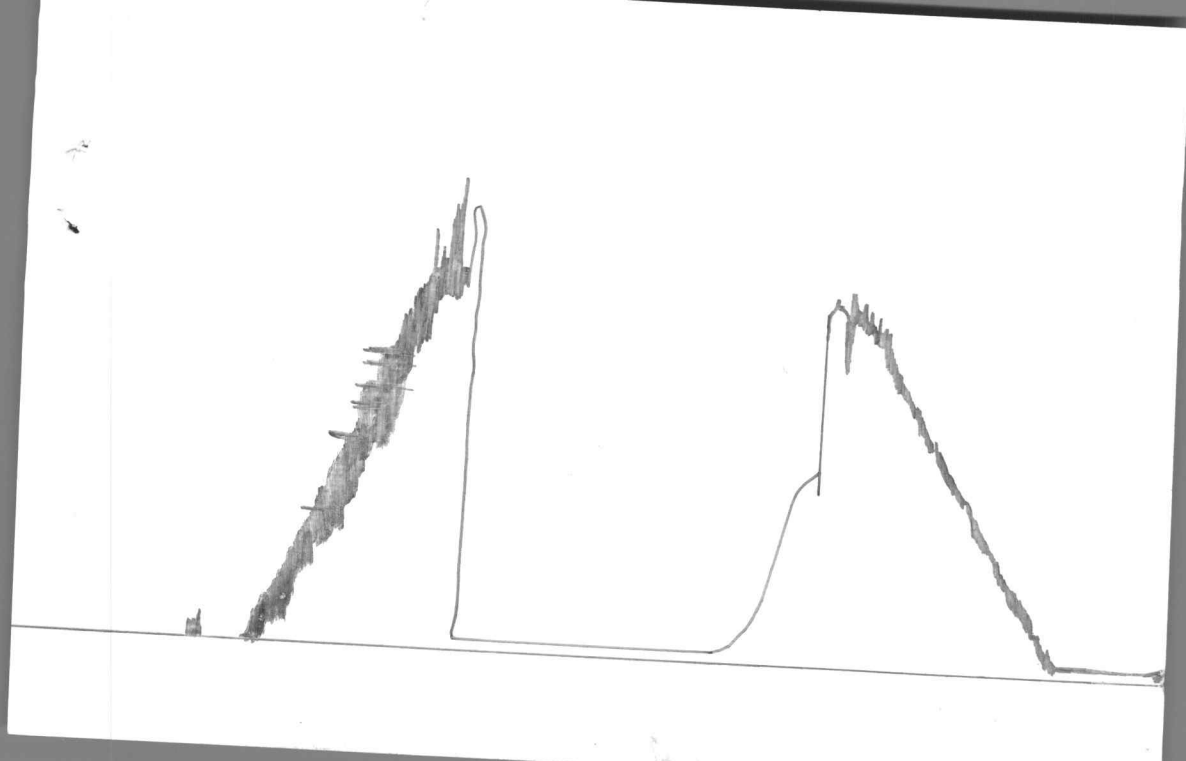

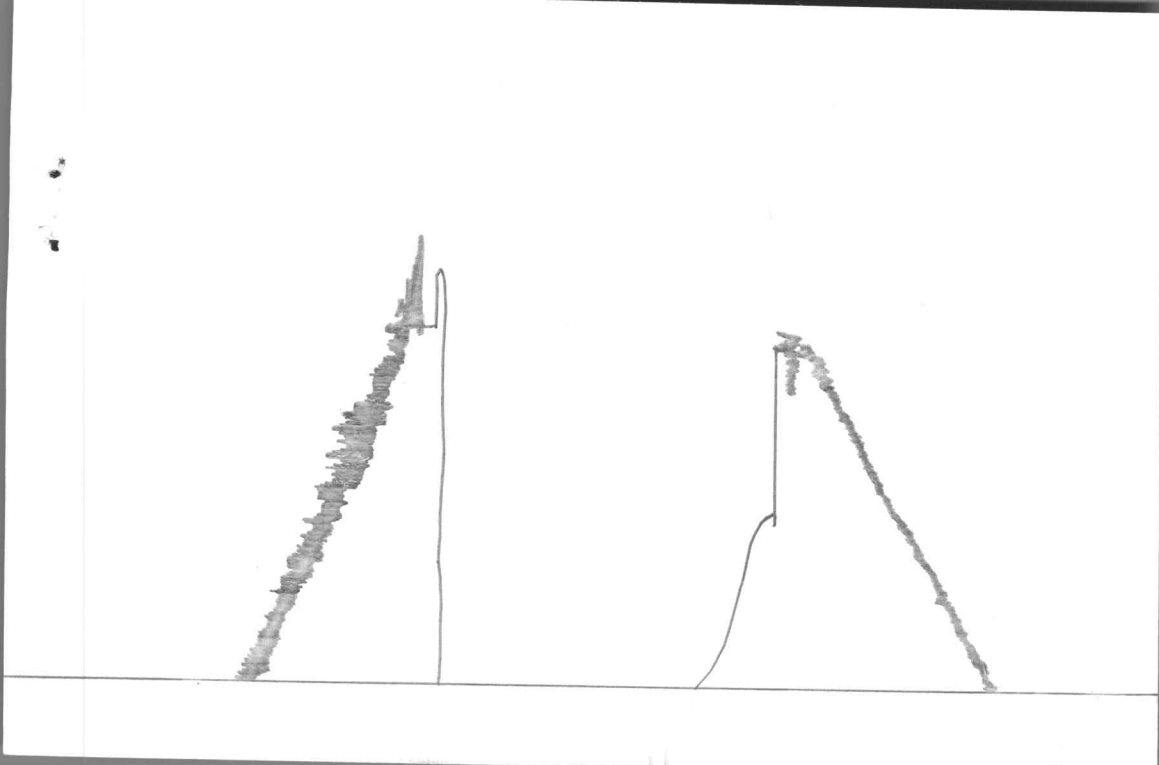

BEE FORMATION TESTING CO., INC.

TEST TICKET

DATE Feb 17-1957.

P. O. BOX 491

GREAT BEND, KANSAS

N^o 1993CUSTOMER'S
ORDER NO. _____NAME OF COMPANY Hnschutz Drlg Co.ADDRESS TO MAIL INVOICE 709 Union National Bank BldgADDRESS TO MAIL PRESSURE CHARTS Wichita-LEASE Russell WELL NO. 1 COUNTY Stafford- STATE Ks.TESTER Jim. Heathcock.APPROVED Ralph W. RuwweDRILL STEM TEST NO. 2 SUCCESSFUL NO. _____ MIS-RUN NO. _____ FORMATION TESTED Miss.SIZE HOLE 7 7/8 TOOL JT. 4 1/2 F.H.RUBBER SIZE 6 3/4 x 30 x 2 7/8 TEST TOOL SIZE 4 5/8PACKER SET AT 4036. ANCHOR SIZE 5 1/2TOTAL DEPTH WELL 4058 LENGTH ANCHOR 22 ft.PRESSURE RECORDER CAP. 3500 - 3500 DRILL PIPE RUN: DRY all WITH FLUID

RESULTS:

PACKER SET 10:45 A.M. TOOL OPEN 10:52 A.M. TOOL OPEN 1 HRS.BLOW Strong Blow-Through-out Test-RECOVERY 2220' Gas in D.P. 170' Heavily Gas Cut & Slightly oil-cut mud.SHUT IN PRESSURE TIME 20 min. MUD WT. 10 1/2 # VIS. 40 sec WATER LOSS 15 8BHP 1225 IFP 0 FFP 0 HYDROSTATIC HEAD 2300'EXTRA EQUIPMENT None Run JARS _____ NO. _____ SIZE _____

OPERATOR TIME _____ TOOL RENTAL TIME _____

BEE FORMATION TESTING CO., INC.

SHALL NOT BE LIABLE FOR DAMAGE OF ANY KIND TO THE PROPERTY OR PERSONNEL OF THE PARTY FOR WHOM A TEST IS MADE, OR FROM ANY LOSS SUFFERED OR SUSTAINED, DIRECTLY OR INDIRECTLY, THROUGH OR IN THE COURSE OF THE USE OF ITS EQUIPMENT, ALL OF WHICH LOSS OR DAMAGE IS ASSUMED BY THE CUSTOMER. TOOLS LOST OR DAMAGED IN THE HOLE SHALL BE PAID FOR AT THE COST OF THE PARTY FOR WHOM TEST IS MADE.