

WELL LOG BUREAU - KANSAS GEOLOGICAL SOCIETY.
412 Union National Bank Bldg, Wichita, Kansas.

*Plotted
4-24-37
W.F. Smith*


L.A. FARRIS & JNO. F. DUWE.
Hays No. 1.

SEC. 4 T. 26 R. 12W
SEc SW

Total Depth. 4326
Comm. 10-10-37 Comp. 11-11-37
Shot or Treated.
Contractor.
Issued. 11-20-37

County Pratt.

NOV 20 1937

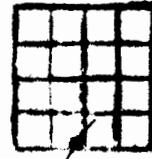

CASING.

12 $\frac{1}{2}$ " surface pipe 286

Elevation.

Production. DRY.

Figures Indicate Bottom of Formations.

surface pipe	286	limo	3609
red rock	548 (sand surface to	shale and limo	3648
red rock	670 232)	shale and limo shells	3656
lime	735	limo K.C.	3955
shale	812	lime and shalo	3970
red rock	865	lime	4025
shale and shells	1028	shalo	4030
broken lime and shale	1300	limo	4036
lime shells and shale	1401	shale	4056
lime	1426	chat	4086
shale blue	1440	limo and shalo	4110
lime	1470	limo	4132
shale	1482	chat	4165
lime	1535	limo	4216
shale	1565	sdv shalo	4248
lime broken	1590	sdv limo	4265
shale shells	1625	shale and limo shells	4296
lime hard	1650	limo	4326
shale	1670	Total Depth.	
lime and shale breaks	1692		
lime	1895	CORES	
lime broken	1965	4216 to 4228 11'6" Recovery	
lime	2045	sdv green shale.	
shale	2077		
lime	2090	4296 to 4310 13'6" Recovery	
sdv shale	2125	siliceous limo no saturatiou	
lime broken	2148		
lime	2175		
lime broken	2193		
lime	2485		
lime broken	2594		
shale	2620		
shale and limo	2635		
shale	2655		
lime	2664		
lime shells and shale	2695		
lime	2800		
lime and shalo	2875		
lime	3100		
lime broken	3120		
lime	3312		
lime hard	3336		
lime broken	3380		
lime	3483		
lime hard	3516		
shale blk	3528		
lime broken	3557		
limo hard	3583		