


WELL LOG BUREAU - KANSAS GEOLOGICAL SOCIETY.
412 Union National Bank Bldg, Wichita, Kansas.

SHELL PETRO. CORP.
Mary Whipple No. 9

SEC. 15 T. 26 R. 9W
SW SW NE
330' fr SL 330' fr WL NE $\frac{1}{4}$

Total Depth. 4142
Comm. 5-26-37 Comp. 6-23-37
Shot or Treated.
Contractor. Olson Drilling Co.
Issued. 7-17-37

County Reno.

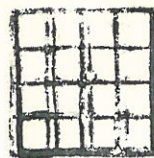

CASING.

103/4" 347' 7" 4138'

Elevation.

Production. Pot. 2209 B.

Figures Indicate Bottom of Formations.

sand and clay	170	lime	3731
red sand rock	196	broken lime	3756
red rock	347	3756 equals 3754 SLC	
red rock and shale	395	lime	3784
shale and shells	780	shale and lime	3808
shale	823	lime	3843
salt	894	shale	3882
salt and shale	1129	chat	3918
shale	1168	chat	3926
lime	1178	limo hard	3935
shale and shells	1285	limo	3945
lime and shale	1343	shalo	3964
lime and shale	1613	lime and shalo	4001
shale	1695	shalo	4106
broken lime	1822	shalo	4131
shale and lime	1914	lime hard	4134
lime and shale	2211	broken lime	4135
lime and shale	2494	4135 equals 4133 SLC Derrick floor.	
broken lime	2530	cored 4135-4138 Roc. 4 $\frac{1}{4}$ '	
lime and shale	2863	Rec 4' lime grey brown 4137	
lime	2894	Rec $\frac{1}{2}$ ' shale brownish grey 4137 $\frac{1}{2}$	
shale	2953	no Roc. conglomerate hard	
broken lime sdy	3025	chert sand & lime	4138
lime hard	3043	cored 4138-4139 $\frac{1}{2}$ Roc 1 $\frac{1}{2}$ '	
lime	3078	Rec $\frac{1}{4}$ ' Congl. sand chert and	
broken lime	3142	lime	4138 $\frac{1}{2}$
lime	3250	Roc 1' dolomite brown 4139 $\frac{1}{2}$	
broken lime	3329	Rec $\frac{1}{4}$ ' chert & dolomite 4139 $\frac{1}{2}$	
lime	3393	dolomite	4140
lime soft odor of oil	3400	cored 4140-4141 No roc.	
lime	3423	No. roc. dolomite & chert 4141	
lime soft	3428	cored 4141-4142 No roc.	
lime hard	3460	No. roc. dolomite and	
lime soft	3470	chert	4142
lime	3516		
lime soft odor of oil	3522	Total Depth.	
lime	3556		
lime hard	3562		
lime soft odor of oil	3580		
lime med hard	3596		
lime	3604		