


BARBARA OIL CO.
Thompson No. 1-D.

SEC. 9 T. 33 R. 13W.
CS $\frac{1}{2}$ SW

L.M.

Total Depth. 4741
Comm. 2-1-40 Comp. 3-18-40
Shot or Treated.
Contractor. Springrose Drlg. Co.
Issued. 7-6-40

County Barber.

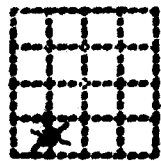

CASING.

10" 325' 7" 4690'

Elevation.

Production. 51,000,000 Gas.

Figures Indicate Bottom of Formations.

shale	330	sticky shale	3655
rod rock gyp and shells	960	shale limo	
rod rock shale and gyp	1185	shelly	3680
rod shale and gyp	1275	limo shells and shale	3730
shale brown and limo	1420	shale limo and shells	3770
shale blue	1550	limo & shale	3780
salt and shale	1720	shale	3870
shale and gyp	1950	sticky shale	3965
shale and limo	1985	mixed shale	3975
shale and gyp	1995	limo & shale	4025
gyp	2010	limo	4035
gyp & shale sticky	2070	sdv limo	4070
limo and shale	2115	limo	4090
gyp and sticky shale	2150	shells&shale	4100
gyp and shale	2220	shale	4120
shale and limo	2270	shale hard	4130
gyp and shale	2350	slate	4145
limo	2380	shale	4156
sticky shale and limo	2395	coring broken sand	4174
sticky shale and gyp	2425	shale hard	4185
limo and shale	2460	limo	4191 (coring K.C. lime 4191)
limo	2550	coring limo	4192
limo and shale	2592	limo hard	4200
sticky shale	2620	limo	4380
shale and limo	2660	sdv limo	4400
limo shells and shale	2700	shale hard	4410
limo and shale	2760	limo	4485
limo	2860	shale and limo	4545
sand soft	2865	limo	4558
limo and shale	2925	broken limo	4560
broken limo	2990	shale hd blk	4565
limo and shale	3030	broken limo	4580
limo	3050	lime hard	4595
sdv limo	3110	broken limo	4602
shale and limo	3125	limo	4615
lime and shale	3145	shale	4623
limo	3165	lime and shale	4670
lime and shale	3210	shale and	
sticky blue shale	3225	charry shells	4680
sticky shale	3290	chatty limo	4690
shale and limo	3315	chat	4741
shale and limo sticky	3335		
broken limo	3350		
lime hard	3370		
limo	3390		
broken limo	3405		
limo	3445		
sdv limo	3465		
limo	3590		
lime and shale	3595		
lime	3635		

Total Depth.