

API# 15-153-20, 149
 KANSAS GEOLOGICAL SOCIETY
ROTARY DRILLING LOG

150' S 77W 50.
28-3-364


COMPANY: Pickrell Drilling Company
 705 Fourth National Bank Building
 Wichita, Kansas 67202

APP 4 Rotary Drilling Commenced 2/23/73

Rotary Drilling Completed 3/4/73

LOCATION: Hubbard "A" No. 1, 150' South NW SW Sec. 28-3S-36W,
 Rawlins County, Kansas

CONTRACTOR: **PICKRELL DRILLING COMPANY**
 Wichita, Kansas

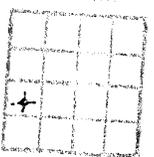

CASING RECORD: Run 9 Jts. 8-5/8" surface casing set at 361' KB. Cemented w/200 sacks. Completed 5:45 P.M. Circulated.

D & A. Plugged down 1:00 P.M. March 5, 1973.

LOG

E 3299 KB

(Figures indicate bottom of formation — measurements from top of rotary bushing.)

170	Clay, Chalky Lime	C.F.S.
250	Sand	<u>4205</u>
2480	Shale	4220
2920	Shale & Sand	4250
3074	Shale	4305
3115	Anhydrite	4360
3438	Shale w/Lime Streaks	4408
3595	Shale & Lime	4430
3750	Lime & Shale	4450
3995	Shale & Lime	4470
4165	Lime & Shale	4490
4205	Lime	4520
4305	Lime & Shale	
4520	Lime, RTD	

LOG TOPS	DEPTH	
SC	3074	
TOP	Not Called	<u>Slope Tests</u>
HEEB	4138	2000
LANS	4191	2500
KC	4341	3000
STARK	4403	3500
BKC	4468	4000
MARM	4487	4500
RTD	4520	
LTD	4521	



The undersigned, C. W. Sebitts, Attorney-in-Fact for PICKRELL DRILLING COMPANY, certifies in behalf of said Company, that the above is a true and correct log of the formation encountered in drilling well as reflected by the Daily Drilling Reports.

PICKRELL DRILLING COMPANY