

TRILOBITE TESTING INC.

P.O. Box 1733 • Hays, Kansas 67601

Test Ticket

APR 26 2011

NO. 042552 15691

Well Name & No. Schoen Trust 2-22 Test No. 1 Date 4-24-11
 Company Blue Ridge Elevation 2591 KB 2586 GL
 Address PO Box 1913 Enid, OK 73702
 Co. Rep / Geo. Tosh Antin Rig LD
 Location: Sec. 22 Twp. 6 Rge. 25 Co. Graham State OK

Interval Tested 3698-3739 Zone Tested LKC "A-B"
 Anchor Length 41 Drill Pipe Run 3682 Mud Wt. 9.0
 Top Packer Depth 3693 Drill Collars Run — Vis 46
 Bottom Packer Depth 3698 Wt. Pipe Run — WL 8.0
 Total Depth 3739 Chlorides 1600 ppm System LCM

Blow Description IFP - weak blow throughout 1-2"
ISI - no blow back
FFP - no blow 5 min - 1/4"
FSI - no blow back

Rec	Feet of	%gas	%oil	%water	%mud
<u>35</u>	<u>mud</u>			<u>100</u>	
Rec	Feet of	%gas	%oil	%water	%mud
Rec	Feet of	%gas	%oil	%water	%mud
Rec	Feet of	%gas	%oil	%water	%mud
Rec	Feet of	%gas	%oil	%water	%mud

Rec Total 35 BHT 106 Gravity — API RW — @ — °F Chlorides — ppm

(A) Initial Hydrostatic	<u>1824</u>	☒ Test <u>1125"</u>	T-On Location <u>0423</u>
(B) First Initial Flow	<u>14</u>	☐ Jars	T-Started <u>0443</u>
(C) First Final Flow	<u>24</u>	☐ Safety Joint	T-Open <u>0616</u>
(D) Initial Shut-In	<u>1155</u>	☐ Circ Sub	T-Pulled <u>0831</u>
(E) Second Initial Flow	<u>24</u>	☐ Hourly Standby	T-Out <u>0958</u>
(F) Second Final Flow	<u>31</u>	☒ Mileage <u>172 RT 215"</u>	Comments
(G) Final Shut-In	<u>1149</u>	☐ Sampler	
(H) Final Hydrostatic	<u>1805</u>	☐ Straddle	


Initial Open 30
 Initial Shut-In 30
 Final Flow 30
 Final Shut-In 45

☐ Ruined Shale Packer
☐ Ruined Packer
☐ Extra Copies
 Sub Total 8
 Total 1340"
 MP/DST Disc't

Sub Total 1340

Approved By _____ Our Representative Brian Fairbank

Trilobite Testing Inc. shall not be liable for damaged of any kind of the property or personnel of the one for whom a test is made, or for any loss suffered or sustained, directly or indirectly, through the use of its equipment, or its statements or opinion concerning the results of any test, tools lost or damaged in the hole shall be paid for at cost by the party for whom the test is made.

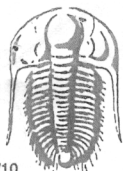

TRILOBITE TESTING INC.

P.O. Box 1733 • Hays, Kansas 67601

Test Ticket

NO. 042553

APR 26 2011

Well Name & No. Schoen Trust 2-22 Test No. 2 Date 4-24-11
 Company Blue Ridge Elevation 2591 KB 2586 GL
 Address _____
 Co. Rep / Geo. Josh Austin Rig LD
 Location: Sec. 22 Twp. 6 Rge. 25 Co. Graham State KS

Interval Tested 3739-3775 Zone Tested ~~3775~~ LKC
 Anchor Length 36 Drill Pipe Run 3744 Mud Wt. 9.3
 Top Packer Depth 3734 Drill Collars Run — Vis SG
 Bottom Packer Depth 3739 Wt. Pipe Run — WL 8.8
 Total Depth 3775 Chlorides 1000 ppm System LCM _____
 Blow Description IFP- weak flow throughout 4"-2 1/2"
ISI- no blow back
FFP- weak flow throughout sur- 1"
FSI- no blow back

Rec	Feet of	%gas	%oil	%water	%mud
<u>25</u>	<u>OCM</u>		<u>10</u>		<u>90</u>
Rec	Feet of	%gas	%oil	%water	%mud
Rec	Feet of	%gas	%oil	%water	%mud
Rec	Feet of	%gas	%oil	%water	%mud
Rec	Feet of	%gas	%oil	%water	%mud

Rec Total 25 BHT 104 Gravity _____ API RW _____ @ _____ °F Chlorides _____ ppm

(A) Initial Hydrostatic	<u>1854</u>	☒ Test <u>125"</u>	T-On Location	<u>1644</u>
(B) First Initial Flow	<u>16</u>	☐ Jars	T-Started	<u>1729</u>
(C) First Final Flow	<u>20</u>	☐ Safety Joint	T-Open	<u>1921</u>
(D) Initial Shut-In	<u>1024</u>	☐ Circ Sub	T-Pulled	<u>2121</u>
(E) Second Initial Flow	<u>23</u>	☐ Hourly Standby	T-Out	<u>2252</u>
(F) Second Final Flow	<u>25</u>	☒ Mileage <u>172RT 215"</u>	Comments	<u>5' f.11 on bottom</u>
(G) Final Shut-In	<u>936</u>	☐ Sampler		
(H) Final Hydrostatic	<u>1840</u>	☐ Straddle	☐ Ruined Shale Packer	

Initial Open 30
 Initial Shut-In 30
 Final Flow 30
 Final Shut-In 30


☐ Shale Packer
☐ Extra Packer
☐ Extra Recorder
☐ Day Standby
☐ Accessibility
 Sub Total 1340

☐ Ruined Packer
☐ Extra Copies
 Sub Total 0
 Total 1340
 MP/DST Disc't _____

Approved By _____

Our Representative

Brian Farbank

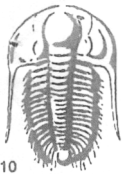

TRILOBITE TESTING INC.

P.O. Box 1733 • Hays, Kansas 67601

Test Ticket

NO. 042554

APR 26 2011

Well Name & No. Schoen Trwt 2-22 Test No. 3 Date 4-25-11
 Company Blue Ridge Elevation 2591 KB 2586 GL
 Address _____
 Co. Rep / Geo. Josh Austin Rig LD
 Location: Sec. 22 Twp. 6 Rge. 25 Co. Graham State K

Interval Tested 3800-3895 Zone Tested WIC "H-R"
 Anchor Length 95 Drill Pipe Run 3809 Mud Wt. 9.5
 Top Packer Depth 3795 Drill Collars Run — Vis 50
 Bottom Packer Depth 3800 Wt. Pipe Run — WL 8.8
 Total Depth 3895 Chlorides 1000 ppm System LCM

Blow Description IFP - weak to Good blow 34" - 7"
ISI - no blow back
FFP - BOB 37 min
FSI - no blow back

Rec	Feet of	%gas	%oil	%water	%mud
<u>150</u>	<u>GIP</u>				
<u>15</u>	<u>HOCM</u>		<u>30</u>	<u>70</u>	
<u>95</u>	<u>HOCM</u>		<u>45</u>	<u>55</u>	
<u>15</u>	<u>GMO</u>	<u>50</u>	<u>25</u>	<u>25</u>	

Rec Total 125 BHT 108 Gravity _____ API RW _____ @ _____ °F Chlorides _____ ppm
 (A) Initial Hydrostatic 1932 ☒ Test 1125 T-On Location 1241
 (B) First Initial Flow 50 ☐ Jars _____ T-Started 1352
 (C) First Final Flow 73 ☐ Safety Joint _____ T-Open 1628
 (D) Initial Shut-In 1318 ☐ Circ Sub _____ T-Pulled 1913
 (E) Second Initial Flow 78 ☐ Hourly Standby _____ T-Out 2105
 (F) Second Final Flow 99 ☒ Mileage MART 215 Comments 10' fill on bottle
 (G) Final Shut-In 1315 ☐ Sampler _____
 (H) Final Hydrostatic 1914 ☐ Straddle _____

Initial Open 30 ☐ Shale Packer _____
 Initial Shut-In 30 ☐ Extra Packer _____
 Final Flow 45 ☐ Extra Recorder _____
 Final Shut-In 60 ☐ Day Standby _____
☐ Accessibility _____
 Sub Total 1340 Sub Total _____
☐ Ruined Shale Packer _____
☐ Ruined Packer _____
☐ Extra Copies _____
 Sub Total 0 Sub Total _____
 Total 1340 Total _____
 MP/DST Disc't _____

Approved By _____ Our Representative Brian Fairbank

Trilobite Testing Inc. shall not be liable for damaged of any kind of the property or personnel of the one for whom a test is made, or for any loss suffered or sustained, directly or indirectly, through the use of its equipment, or its statements or opinion concerning the results of any test, tools lost or damaged in the hole shall be paid for at cost by the party for whom the test is made.