

TRILOBITE TESTING INC.

P.O. Box 1733 • Hays, Kansas 67601

Test Ticket

NO. 042896 15852

Well Name & No. Schoeller Rippe 6-1 Test No. 2 Date 6-5-11
 Company Bunker Enterprises, LLC Elevation 21404 KB 21039 GL
 Address 216 S. Marshall St. Glen Elder, KS 67446
 Co. Rep / Geo. Mark Torr Rig WW #6
 Location: Sec. 6 Twp. 75 Rge. 19W Co. Rooks State KS

Interval Tested 3617-3630 Zone Tested Arbuckle
 Anchor Length 13' Drill Pipe Run 3500 Mud Wt. 9.1
 Top Packer Depth 3612 Drill Collars Run 124 Vis 5/
 Bottom Packer Depth 3617 Wt. Pipe Run 0 WL 6.8
 Total Depth 3630 Chlorides 1400 ppm System LCM 2#

Blow Description IF - Weak dying blow. Died @ 15 minutes.
~~FF - No Return.~~
FF - No blow.
~~FST - No Return.~~


Rec	Feet of	%gas	%oil	%water	%mud
<u>2</u>	<u>MCO</u>		<u>70</u>		<u>30</u>
<u>6</u>	<u>SOCM</u>		<u>10</u>		<u>90</u>
Rec	Feet of	%gas	%oil	%water	%mud
Rec	Feet of	%gas	%oil	%water	%mud
Rec	Feet of	%gas	%oil	%water	%mud

Rec Total 8 BHT 109 Gravity N/A API RW @ _____ ° F Chlorides _____ ppm
 Test 1125 T-On Location 1600
 Jars T-Started 1650
 Safety Joint T-Open 1825
 Circ Sub T-Pulled 1925
 Hourly Standby T-Out 2100
 Mileage 60X2 120RT 1100 Comments BHT-1637
 Sampler
 Straddle Ruined Shale Packer
 Shale Packer Ruined Packer
 Extra Packer Extra Copies
 Extra Recorder
 Day Standby
 Accessibility

Initial Open 15 Sub Total 8
 Initial Shut-In 15 Total 1293
 Final Flow 15
 Final Shut-In 15 MP/DST Disc't

Approved By _____ Our Representative D. Rash

Trilobite Testing Inc. shall not be liable for damaged of any kind of the property or personnel of the one for whom a test is made, or for any loss suffered or sustained, directly or indirectly, through the use of its equipment, or its statements or opinion concerning the results of any test, tools lost or damaged in the hole shall be paid for at cost by the party for whom the test is made.

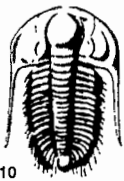

TRILOBITE TESTING INC.

P.O. Box 1733 • Hays, Kansas 67601

Test Ticket

NO. 042895

4/10

Well Name & No. Schoeller Rifle 6-1 Test No. 2 Date 6-6-11
 Company Bunker Enterprises, LLC Elevation 2144 KB 2139 GL
 Address 216 S. Marshall St. Glen Elder, KS 67446
 Co. Rep / Geo. Mark Torr Rig WW #6
 Location: Sec. 6 Twp. 7S Rge. 19W Co. Rooks State KS

Interval Tested 3629-3651 Zone Tested Aubuckle
 Anchor Length 22' Drill Pipe Run 3497 Mud Wt. 9.1
 Top Packer Depth 3624 Drill Collars Run 124 Vis 51
 Bottom Packer Depth 3629 Wt. Pipe Run 0 WL 6.8
 Total Depth 3651 Chlorides 1400 ppm System LCM 2#

Blow Description IF - Very weak building blow. Built to 2 inches.
ISI - No Return.
FF - Weak surface blow. Died @ 17 minutes.
FSE - No Return.

Rec	Feet of	%gas	%oil	%water	%mud
<u>5</u>	<u>M/W/O</u>	<u>2</u>	<u>18</u>	<u>80</u>	<u></u>
<u>60</u>	<u>W/M/O</u>	<u>2</u>	<u>48</u>	<u>50</u>	<u></u>

Rec Total 65 BHT 111 Gravity NIA API RW 348 @ 81 °F Chlorides 17,000 ppm

(A) Initial Hydrostatic 1937 Test 1125' T-On Location 0245
 (B) First Initial Flow 15 Jars T-Started 0330
 (C) First Final Flow 43 Safety Joint T-Open 0455
 (D) Initial Shut-In 733 Circ Sub T-Pulled 0655
 (E) Second Initial Flow 48 Hourly Standby T-Out 0830
 (F) Second Final Flow 65 Mileage 60X2 120RT 168' Comments BHT-0307
 (G) Final Shut-In 651 Sampler
 (H) Final Hydrostatic 1766 Straddle Ruined Shale Packer
 Shale Packer Ruined Packer

Initial Open 30 Extra Packer Extra Copies
 Initial Shut-In 30 Extra Recorder Sub Total 0
 Final Flow 30 Day Standby Total 1293'
 Final Shut-In 30 Accessibility MP/DST Disc't
 Sub Total 1293'

Approved By _____ Our Representative D. Rash

Trilobite Testing Inc. shall not be liable for damaged of any kind of the property or personnel of the one for whom a test is made, or for any loss suffered or sustained, directly or indirectly, through the use of its equipment, or its statements or opinion concerning the results of any test, tools lost or damaged in the hole shall be paid for at cost by the party for whom the test is made.