

**TRILOBITE
TESTING INC.**

P.O. Box 1733 • Hays, Kansas 67601

NOV 02 2010

Test Ticket

NO. 040320 14967

Well Name & No. Ganoung B-1 Test No. 1 Date 10-29-10
Company Gore Elevation 2113 KB 2105 GL
Address 202 S St. Francis PO Box 2757 Wichita, KS 67202
Co. Rep / Geo. Don Ryder Rig Maverick 108
Location: Sec. 32 Twp. 9 Rge. 17 Co. Rock State Ks

Interval Tested 3268 - 3400 Zone Tested LKC
Anchor Length 132 Drill Pipe Run 3270 Mud Wt. 8.8
Top Packer Depth 3263 Drill Collars Run — Vis 52
Bottom Packer Depth 3268 Wt. Pipe Run — WL 8.0
Total Depth 3400 Chlorides 1500 ppm System LCM —

Blow Description IFP- BOB 5 min
ISI- no blow back
FFP- BOB 7 min
FST- no blow back

Rec	Feet of	%gas	%oil	%water	%mud
<u>190</u>	<u>SGOC MW</u>	<u>45</u>	<u>5</u>	<u>30</u>	<u>20</u>
<u>30</u>	<u>Jrl mud</u>	<u>—</u>	<u>—</u>	<u>—</u>	<u>100</u>
<u>185</u>	<u>SGOC MW</u>	<u>30</u>	<u>5</u>	<u>25</u>	<u>40</u>
<u>125</u>	<u>SGOC MW</u>	<u>35</u>	<u>5</u>	<u>50</u>	<u>10</u>
<u>60</u>	<u>MW</u>	<u>—</u>	<u>—</u>	<u>95</u>	<u>5</u>

Rec Total 590 BHT 102 Gravity — API RW .087 @ 56 °F Chlorides 2500 ppm

(A) Initial Hydrostatic 1617
(B) First Initial Flow 44
(C) First Final Flow 209
(D) Initial Shut-In 679
(E) Second Initial Flow 188
(F) Second Final Flow 288
(G) Final Shut-In 672
(H) Final Hydrostatic 1555

☒ Test 1125
☐ Jars —
☒ Safety Joint 75
☐ Circ Sub —
☐ Hourly Standby —
☒ Mileage 61 RT 74.25
☐ Sampler —
☐ Straddle —
☐ Shale Packer —
☐ Extra Packer —
☐ Extra Recorder —
☐ Day Standby —
☐ Accessibility —
Sub Total 1276.25

T-On Location 0135
T-Started 0222
T-Open 0425
T-Pulled 0710
T-Out 0929


Comments —
☐ Ruined Shale Packer —
☐ Ruined Packer —
☐ Extra Copies —
Sub Total 0
Total 1276.25
MP/DST Disc't —

Initial Open 30
Initial Shut-In 45
Final Flow 30
Final Shut-In 60

Approved By —

Our Representative Brian Farbak

TriLOBITE Testing Inc. shall not be liable for damaged of any kind of the property or personnel of the one for whom a test is made, or for any loss suffered or sustained, directly or indirectly, through the use of its equipment, or its statements or opinion concerning the results of any test, tools lost or damaged in the hole shall be paid for at cost by the party for whom the test is made.

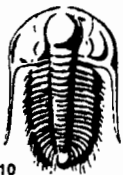

TRILOBITE TESTING INC.

P.O. Box 1733 • Hays, Kansas 67601

Test Ticket

NO. 040321

NOV 01 2010

Well Name & No. Ganong B-1 Test No. 2 Date 10-30-0
 Company Gore Elevation 2113 KB 2105 GL
 Address _____
 Co. Rep / Geo. Don Rider Rig Maverick 108
 Location: Sec. 32 Twp. 9 Rge. 17 Co. Rooks State Kc

Interval Tested 3426-3510 Zone Tested BKC
 Anchor Length 84 Drill Pipe Run 3431 Mud Wt. 9.2
 Top Packer Depth 3421 Drill Collars Run — Vis 58
 Bottom Packer Depth 3426 Wt. Pipe Run — WL 8.8
 Total Depth 3510 Chlorides 5000 ppm System LCM —

Blow Description ITP- weak blow throughout 1/4" - 3/4"
ISI- no blow back
FFP- no blow 22 min- sur blow
FST- no blow back

Rec	Feet of	%gas	TSTM	%oil	%water	%mud
1	Free oil					
4	130CM		2		98	

Rec Total 5 BHT 99 Gravity TSTM API RW — @ — °F Chlorides — ppm

(A) Initial Hydrostatic	<u>1752</u>	☒ Test	<u>1125</u>	T-On Location	<u>0053</u>
(B) First Initial Flow	<u>64</u>	☐ Jars		T-Started	<u>0136</u>
(C) First Final Flow	<u>64</u>	☒ Safety Joint	<u>75</u>	T-Open	<u>0318</u>
(D) Initial Shut-In	<u>268</u>	☐ Circ Sub		T-Pulled	<u>0618</u>
(E) Second Initial Flow	<u>62</u>	☐ Hourly Standby		T-Out	<u>0818</u>
(F) Second Final Flow	<u>55</u>	☒ Mileage	<u>2 122 RT 152</u>	Comments	<u>lead tool</u>
(G) Final Shut-In	<u>241</u>	☐ Sampler			
(H) Final Hydrostatic	<u>1648</u>	☐ Straddle		☐ Ruined Shale Packer	

Initial Open 45
 Initial Shut-In 45
 Final Flow 30
 Final Shut-In 60

☐ Shale Packer
☐ Extra Packer
☐ Extra Recorder
☐ Day Standby
☐ Accessibility
 Sub Total 1352 50

☐ Ruined Packer
☐ Extra Copies
 Sub Total 8
 Total 1352 50
 MP/DST Disc't _____

Approved By _____

Our Representative

Brian Farber

Trilobite Testing Inc. shall not be liable for damaged of any kind of the property or personnel of the one for whom a test is made, or for any loss suffered or sustained, directly or indirectly, through the use of its equipment, or its statements or opinion concerning the results of any test, tools lost or damaged in the hole shall be paid for at cost by the party for whom the test is made.