

STATE OF KANSAS
STATE CORPORATION COMMISSION
200 Colorado Derby Building
Wichita, Kansas 67202

WELL PLUGGING RECORD
K.A.R.-82-3-117

API NUMBER 15-039-20,853 *0000*

LEASE NAME Chambers

WELL NUMBER 7

SPOT LOCATION Approx. NE/4 NW/4 SW/4

SEC. 29 TWP. 1S RGE. 26W (E666/W)

COUNTY Decatur

Date Well Completed 5/11/89

Plugging Commenced 5/11/89

Plugging Completed 5/11/89

LEASE OPERATOR Adeco Inc. & Chambers

ADDRESS 310 East Ash, Oberlin, Ks. 67749

PHONE # (913) 475-3468 OPERATORS LICENSE NO. 8981

Character of Well D & A
(Oil, Gas, D&A, SMD, Input, Water Supply Well)

Did you notify the KCC/KDHE Joint District Office prior to plugging this well? Yes

Which KCC/KDHE Joint Office did you notify? Hays, Ks. - David Wann

Is ACO-1 filed? If not, is well log attached?

Producing formation Depth to top bottom T.D. 3,778'

Show depth and thickness of all water, oil and gas formations.

OIL, GAS OR WATER RECORDS CASING RECORD

Formation	Content	From	To	Size	Put In	Pulled out
				8 5/8"	237.57'	-0-

Describe in detail the manner in which the well was plugged, indicating where the mud fluid was placed and the method or methods used in introducing it into the hole. If cement or other plugs were used state, the character of same and depth placed, from feet to feet each set.


1st Plug @ 2020' w/25 sx cement; 2nd Plug @ 1360' w/100 sx cement. 2 ax Floseal;
3rd Plug @ 290' w/40 sx cement; Bridge Plug @ 40' - 0 w/10 sx cement;
15 sx cement in rat-hole
190 sx 60/40 Pozmix, 6% Gel

(If additional description is necessary, use BACK of this form.)

Name of Plugging Contractor Red Tiger Drilling Company License No. 5302
Address 1720 KSB Building, Wichita, Kansas 67202

STATE OF KANSAS COUNTY OF DECATUR, ss.

LESTER L. CHAMBERS (employee of operator) or (operator) of above-described well, being first duly sworn on oath, says: That I have knowledge of the facts, stated and matters herein contained and the log of the above-described well, the same are true and correct. GR Heav'nly God.

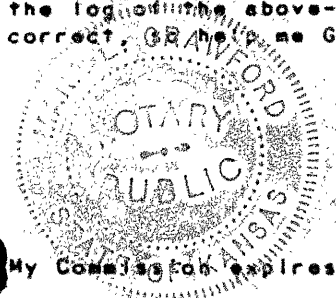

RECEIVED
STATE CORPORATION COMMISSION
JUN 20 1989
6-20-1989
CONSERVATION DIVISION
Wichita, Kansas

(Signature) Lester L. Chambers

(Address) 310 East Ash Oberlin Ks 67749

SUBSCRIBED AND SWORN TO before me this 23 day of June, 1989

Mara S. Crawford
Notary Public

My Commission expires: 10/27/91

RESULTS I WOULD SUGGEST PLUGGING THE #7 CHAMBERS.

DRILL STEM TESTS & CORES

DST #1 3354-3377 = 23' ANCHOR (POLLNOW ZONE) RAN BY HALLIBURTON SERVICES, GARY BRYANT, TESTER 1ST & 2ND OPEN - NO BLOW; RECOVERED 10' DRILLING MUD; IHP = 1738, IFP = 25-31, ISIP = 38, FFP = 31-33, FSIP = 38, FHP = 1735, TEMP = 95°F

DST #2 3354-3388 = 34' ANCHOR, 390' TAIL PIPE FOR STRADDLE TEST (B ZONE) MIS RUN

DST #3 3350-3428 = 78' ANCHOR, 350' TAIL PIPE FOR STRADDLE TEST (B & C ZONES) RECOVERED: 20' DRILLING MUD
 IHP = 1754 psi; IFP = 8-17 psi; ISIP = 214 psi; FFP = 17-18 psi
 FSIP = 127 psi; FHP = 1746 psi

EXPLANATION OF SYMBOLS

HYDROCARBON SHOWS

- Poor oil stain
- Good to excellent oil stain
- Dead oil
- ∩ Faint cut fluorescence
- ∩ Strong cut fluorescence
- ∩ Poor stain, faint cut fluorescence
- ◇ Hydrocarbon odor
- ↑ Gas indications

LITHOLOGIC SYMBOLS

- | | | | |
|--|-------------|--|--------------|
| | Limy shale | | Siltstone |
| | Limestone | | Dolomite |
| | Chalk | | Gypsum |
| | Anhydrite | | No sample |
| | Bentonite | | Granite wash |
| | Sandstone | | |
| | Sandy shale | | |
| | Shale | | |

PENETRATION RATE min/ft DEPTH STRIP LOG DESCRIPTION OR ENGINEERING DATA

0 5 10

200