

4-061145

15-167-06232-00-00

3-27

TO: STATE CORPORATION COMMISSION
CONSERVATION DIVISION - PLUGGING
130 SOUTH MARKET, SUITE 2078
WICHITA, KANSAS 67202

API Number: ~~15-167-06-06-52~~ (~~15-167-761-51~~)
SE SE SW /4 SEC. 27, 12 S, 14 W
330 feet from S section line
2970 feet from E section line

Operator license# 0000

Lease: Claussen Well # 4

Operator: State Of Kansas Fee Fund

County: Russell

Address: 2301 E. 13th Street
Hays, Kansas 67601
Control Number 980045-001

Well total depth 2968 feet
Conductor Pipe: 0 inch @ 0 feet
Surface pipe 8 5/8 Inch @ Unknown feet

Aband. oil well , Gas well , Input well , SWD , D & A

Plugging contractor: L&M Well Service License# -

Address: Russell, Kansas 67665

Company to plug at: Hour: 5:30 P.M. Day: 27 Month: March Year: 1998

Plugging proposal received from: District #4 Staff

Company: Kansas Corporation Commission Phone: 785-628-1200

Were: Order 300 sxs 60/40 pozmix - 10% gel - and hulls.
Determined bridge at 407' to be top of 3 joints of tubing attached to a squeeze packer inadvertently cemented in. Squeeze cementing requires the perforations or open hole to be isolated with a packer. Cement was found on top of a blue packer which pointed to a cement squeeze resulting in a small amount of cement getting on top of packer and locking it in the hole. Well was also determined to be a cable tool hole. Squeeze packer set below Cedar Hill Sand.

Plugging Proposal Received by: Herb Deines

Plugging operations attended by agent? All[], Part[X], None[]

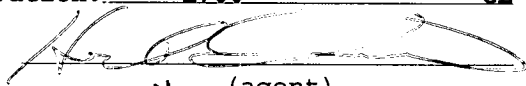
Completed: Hour: 8:00 P.M., Day: 27, Month: March, Year: 1998

Actual plugging report: Reportedly had 798' of 10 3/4" surface pipe but was found to be pulled leaving a wide cavity around production casing at surface. Perforated casing at top of fish and ran tubing. Pumped 90 sxs cement with cement to surface in casing. Pulled tubing and tied onto production casing. Pumped 110 sxs cement followed by 100 sxs cement with hulls. Max. P.S.I. 650#. S.I.P. 300#. Annular side dug out to pipe hanger. Filled annulus with 7 yards of Redi-Mix. Cut off casing and leveled site.

Remarks: Allied Cementing - Cheyenne Tank - L&M Well Service.

Condition of casing(in hole): GOOD BAD
Bottom plug(in place): YES , CALC , NO
Plugged through TUBING , CASING
Anhy.plug: YES NO
Dakota plug: YES , NO
Elevation: 1760 GL

I did[X] / did not[] observe the plugging.


DH (agent)
Form CP-2/3