


Veeder Supply & Dev'l. Co.

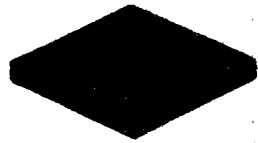

Cherryvale, Kansas

Drilled for Veeder Supply & Development Co. et al Farm McCullough No. 3 Depth 3540'
 Contractor Veeder Supply & Development Co. Pipe w/12" csg w/100 sacks; 1443' 8 1/8" csg.
w/475 sacks; 3540' 5 1/2" csg. w/125 sacks
 Location NW 1/4 NW Sec. 35 Twp. 10 Range 17N
 Commenced 7-8-45 Completed 7-28-45 County Rooks State Kansas

Surface soil and lime	0	40	40	Elevation: 2115 W
Broken lime	40	80	40	
Blue shale	80	270	190	
Shale and shells	270	551	281	
Blue shale	551	563	12	
Sand	563	590	27	
Sticky blue shale and red bed	590	670	80	
Sand	670	815	145	- <i>Asakota</i>
Pyrite and sand lime	815	844	29	
Pyrite	844	882	38	
Sand and pyrite	882	902	20	
Blue shale, red bed, shells	902	1093	191	
Gray sticky shale	1093	1200	107	
Red bed, soft	1200	1225	25	
Red bed and shale	1225	1250	25	
Shale and red rock	1250	1305	55	
Red bed, soft	1305	1400	95	
Chalk, white, soft	1400	1415	15	
Anhydrite	1415	1429	14	
Red bed and shale	1429	1460	31	
Shale and shells	1460	1545	85	
Shale and lime	1545	1915	370	
Shale and shells	1915	2080	165	
Salt	2080	2130	50	
Lime and shale	2130	2165	35	
Shale	2165	2340	175	
Lime and shale	2340	2355	15	
Lime	2355	2464	109	
Lime and shale	2464	2480	16	
Shale and shells	2480	2500	20	
Lime and shale	2500	2570	70	
Shale and shells	2570	2615	45	
Lime, broken	2615	2660	45	
Shale, shells	2660	2710	50	
Lime, shale	2710	2935	225	
Lime, broken	2935	3055	120	
Lime, shale	3055	3095	40	
Lime	3095	3500	405	
T. D.	3500	3540	40	

JUN 20 1958