



Well Doonan A2 SWD

Field Lake Barton

Location:

AP1 #

SEC 28 TWP 18S RGE 13W

Permanent Datum	Ground Level	Elevation	1831
Log Measured From	K.B 8' AGL		

Elevation

Drilling Measured From A

— 100 —

1000

/a/	3550
-----	------

--	--

--

do	
----	--

mm	
----	--

[illegible]

--

Whole Record

[illegible]

Size

55
0/00

Comments

Hoisington, 5 south to NE 60th rd., 1 east to NE 10th rd., 1/2 North, West into


Thank You for Using Gemini Wireline LLC.
785-625-1182



Main Pass

```
Database File      h\ddoonana#2cbl.db
Dataset Pathname  pass4
Presentation Format cblsec
Dataset Creation  Mon Jul 09 17:08:32 2018
Charted by        Depth in Feet scaled 1:240
```

0	GR (GAPI)	150	18	CCL	-2	200	VDL (usec)	1200
150	GR (GAPI)	300	0	AMP3 (mV)	100			
450	TT3 (usec)	250						

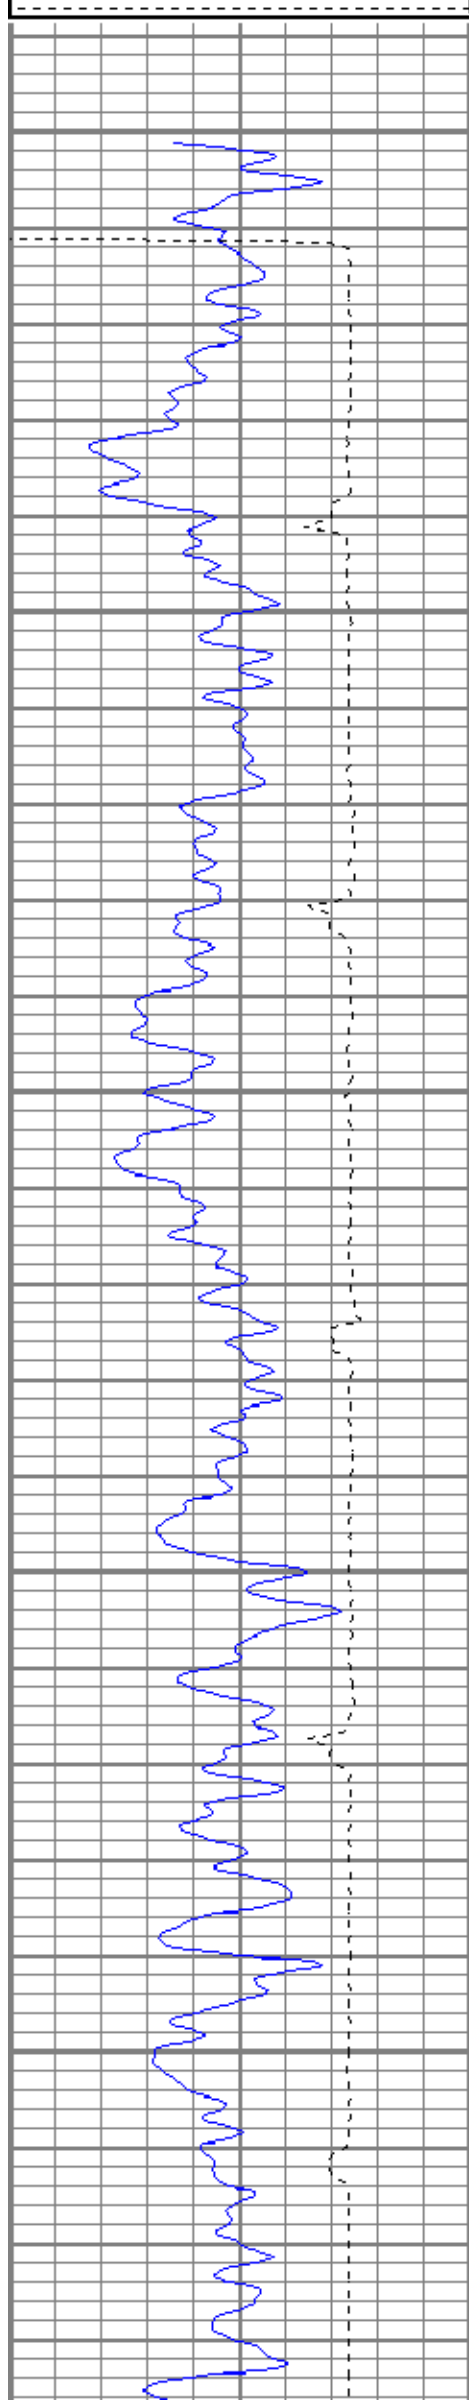



0


50

100

150

200

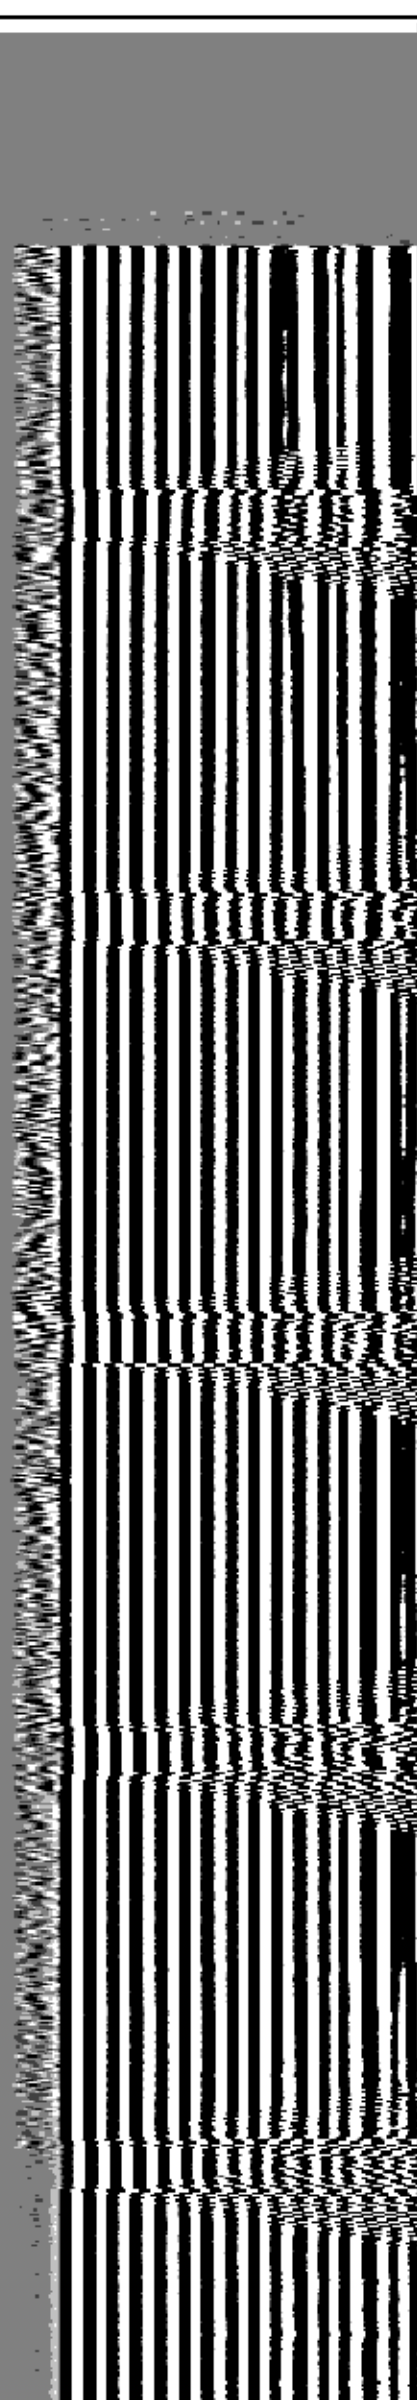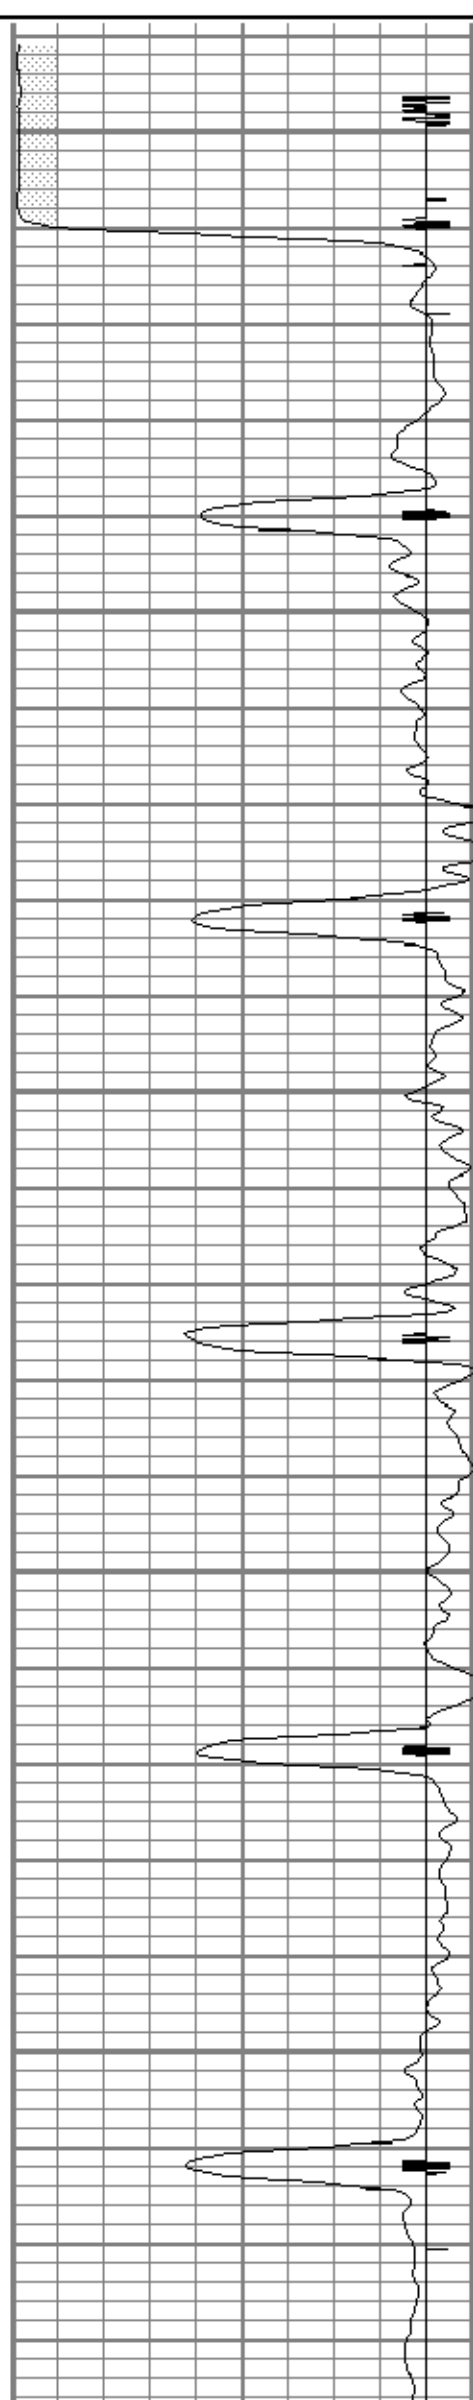

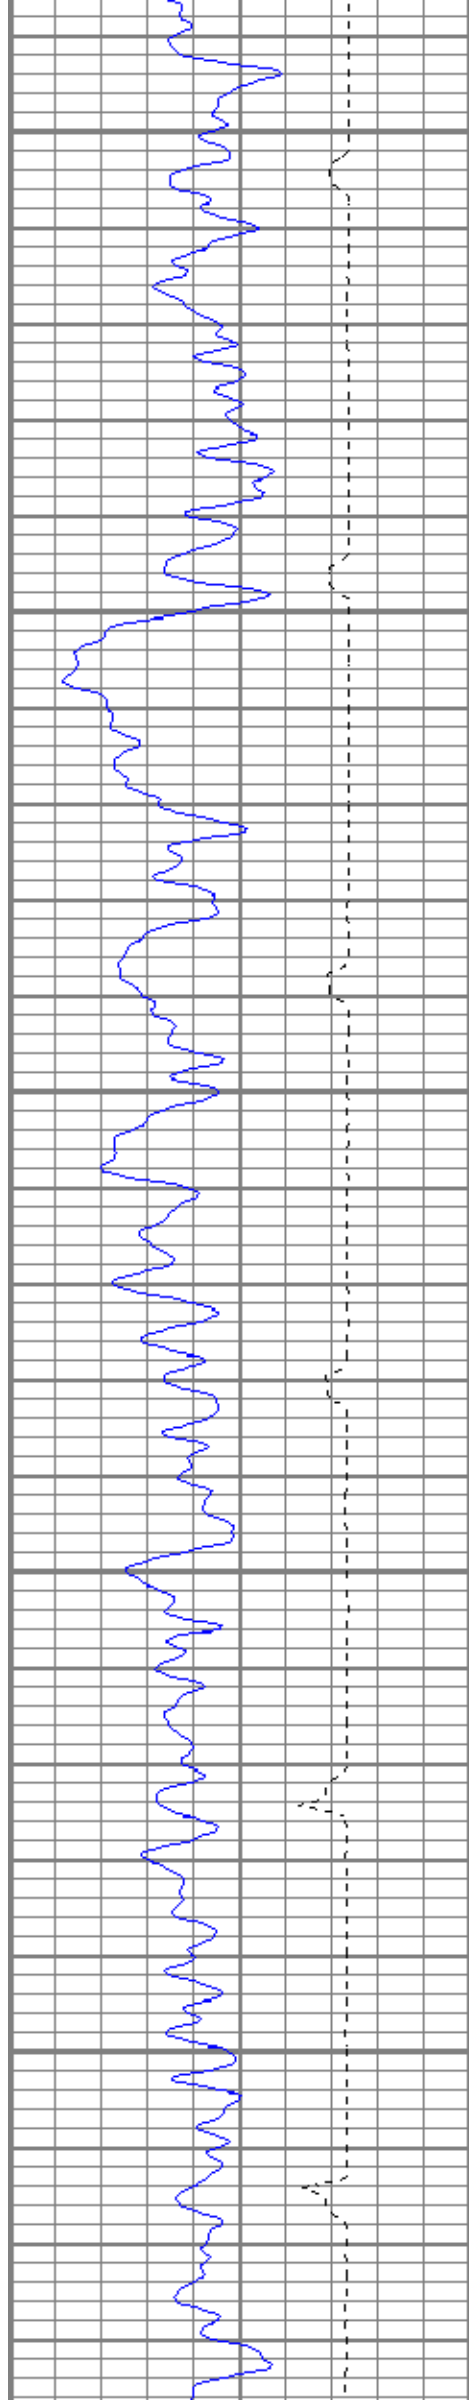



250


300

350

400

450

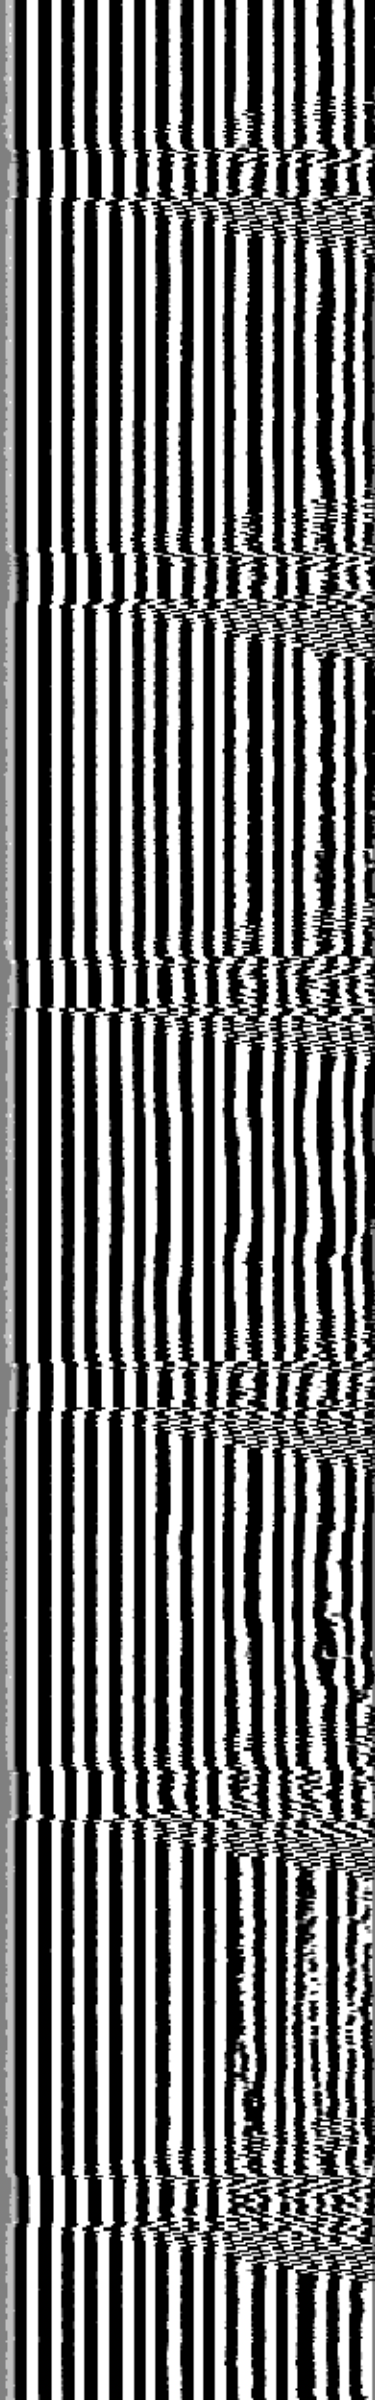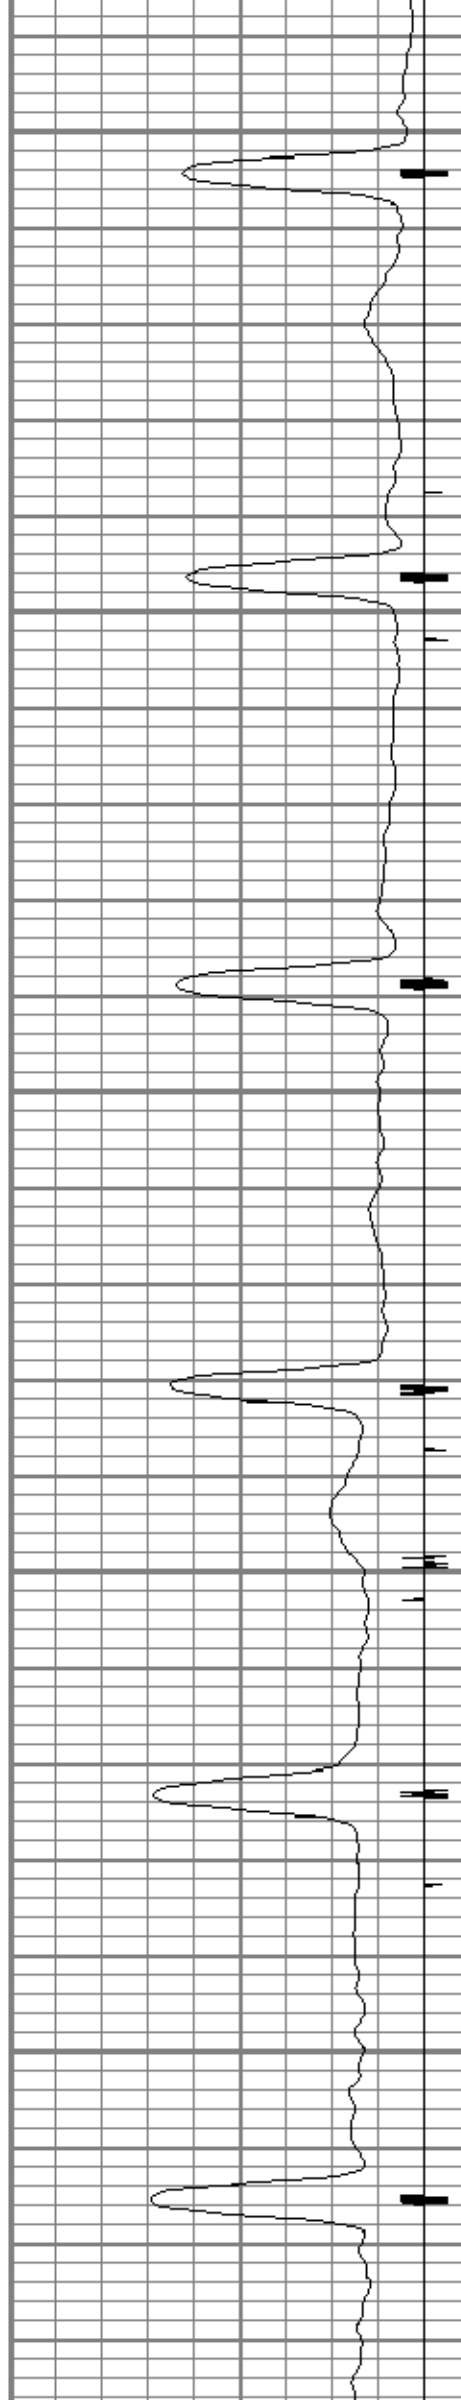

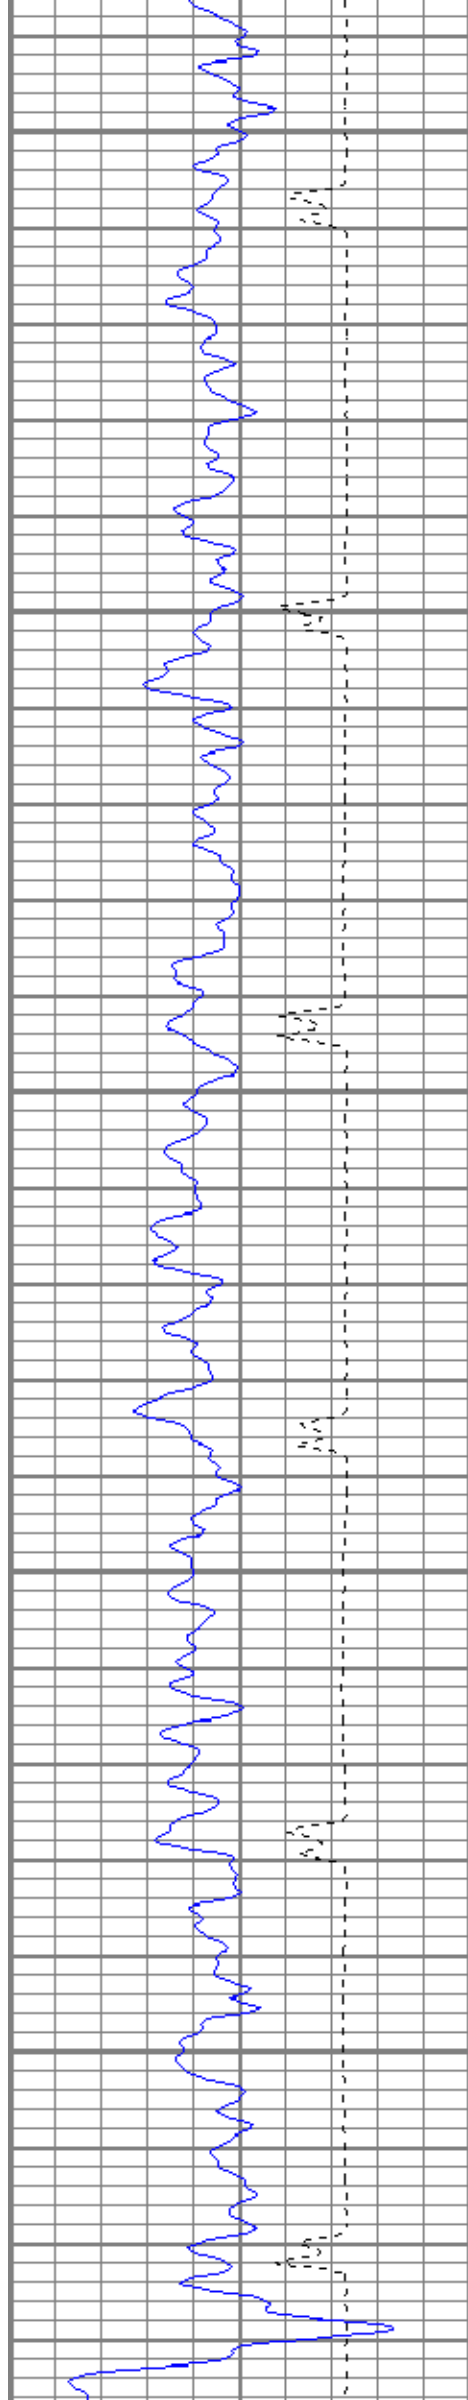



500


550

600

650

700

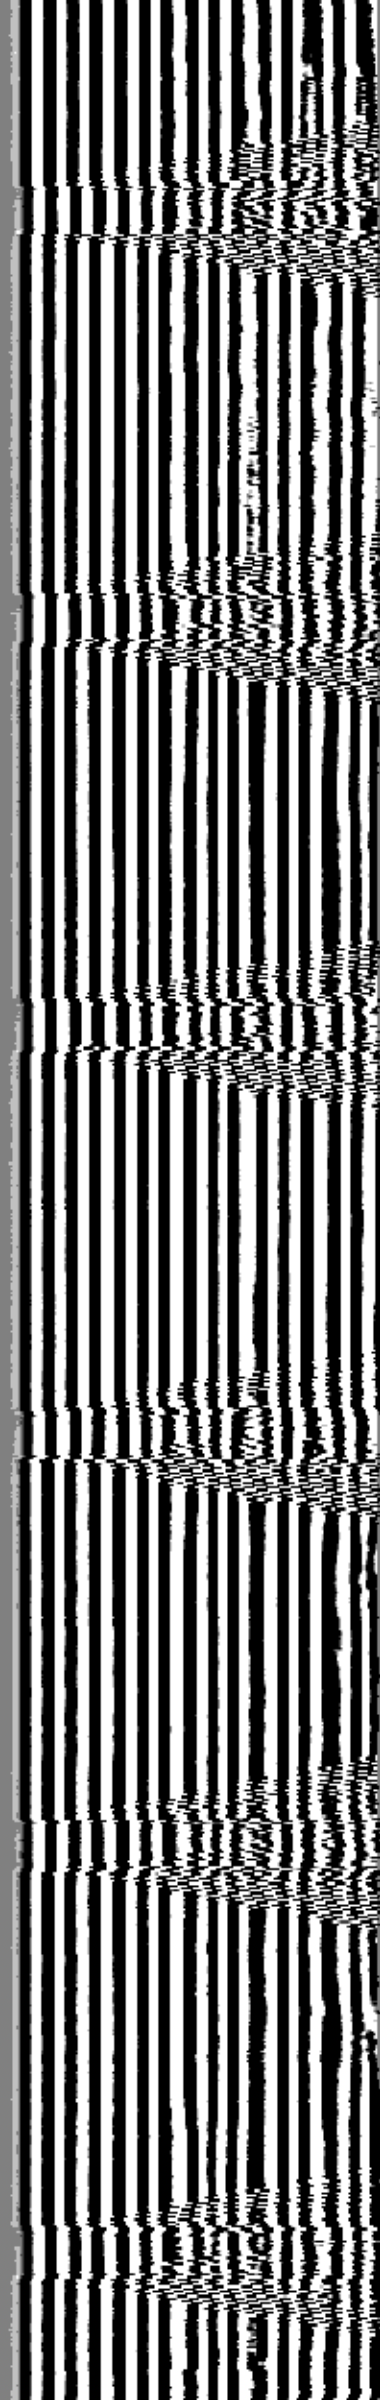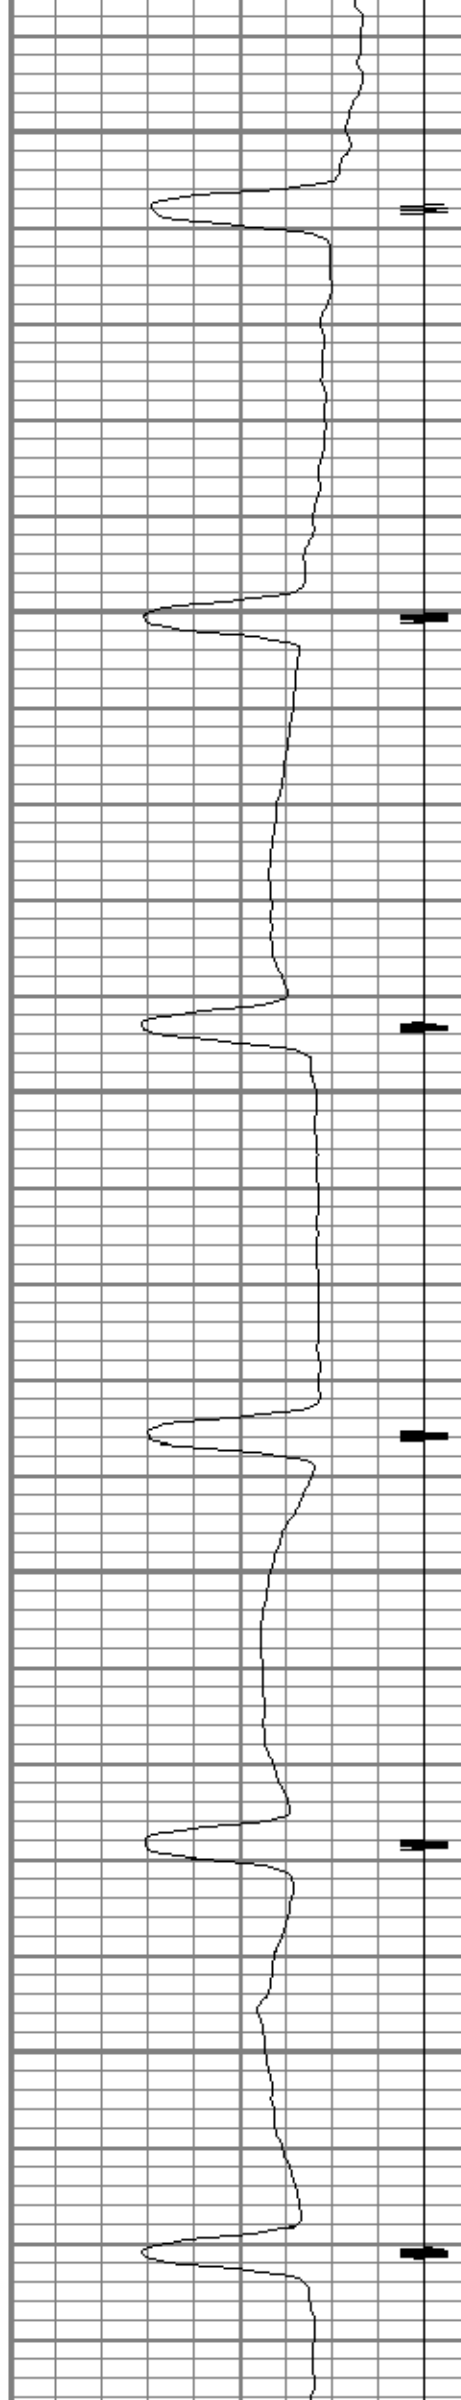

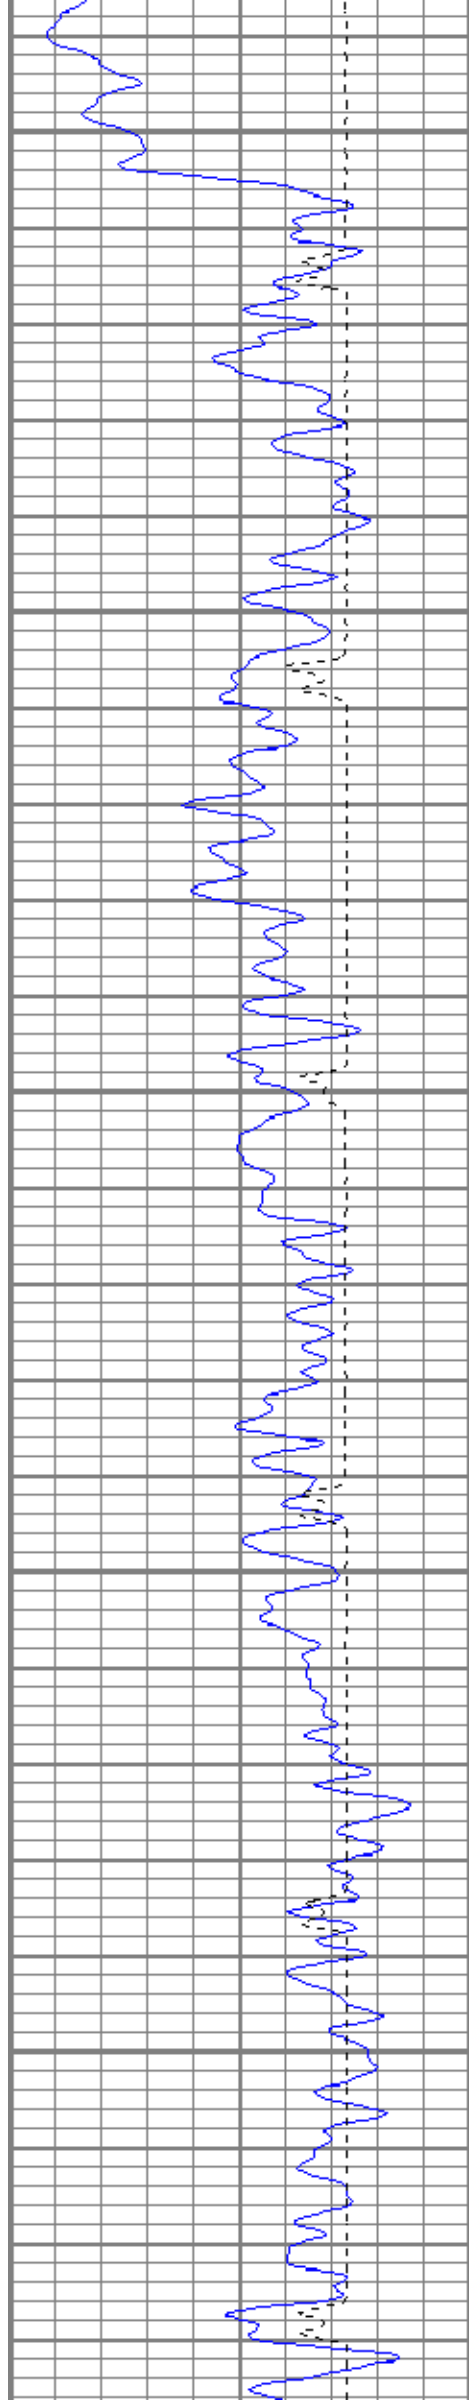



750


800

850

900

950

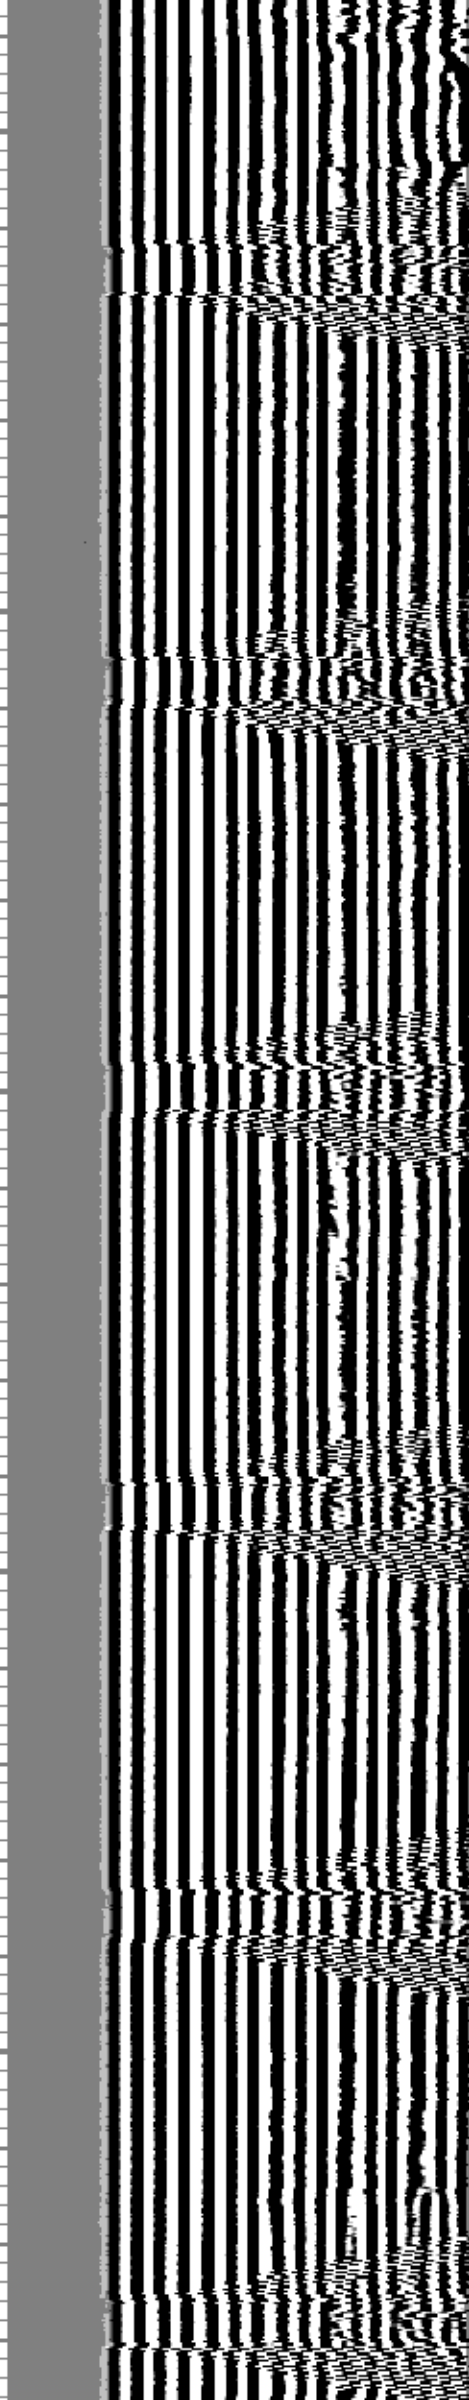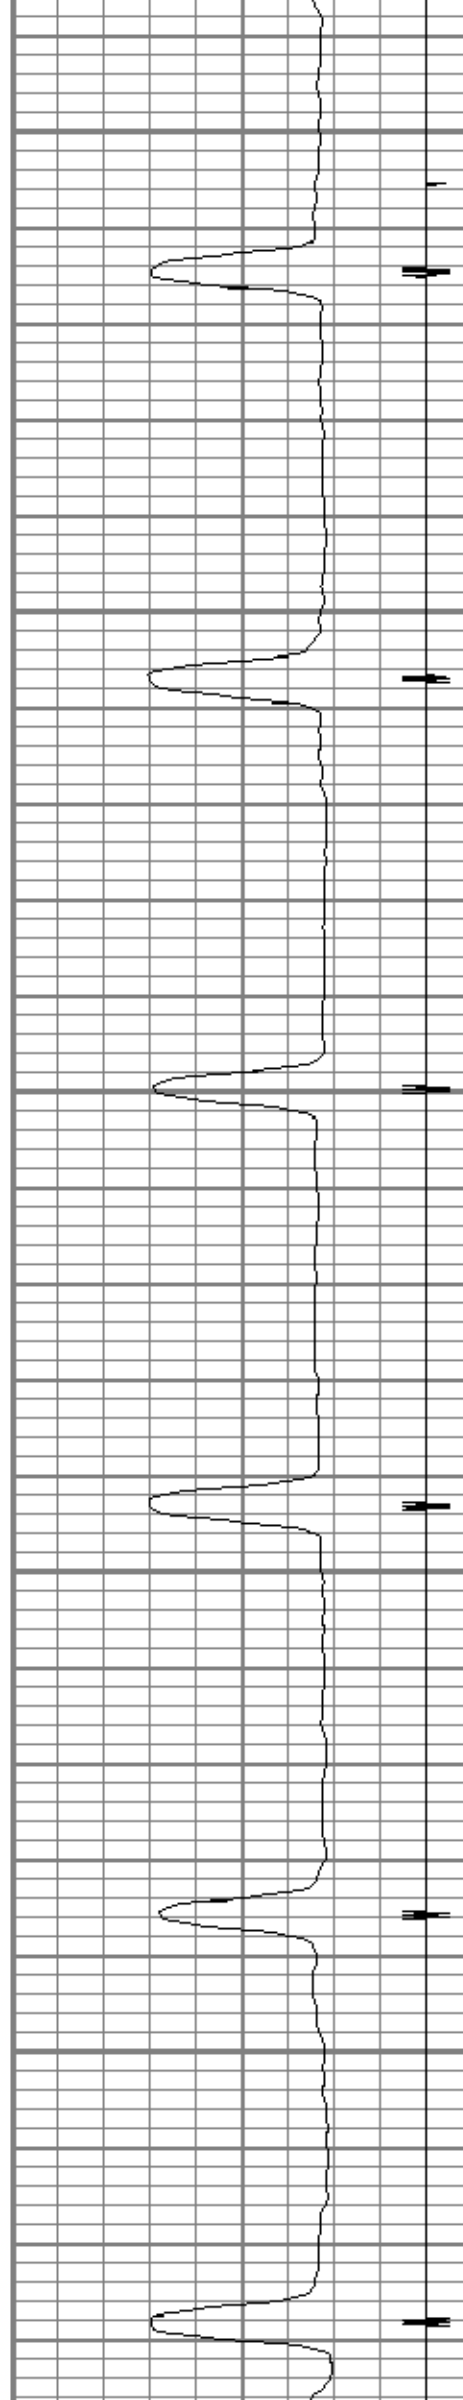

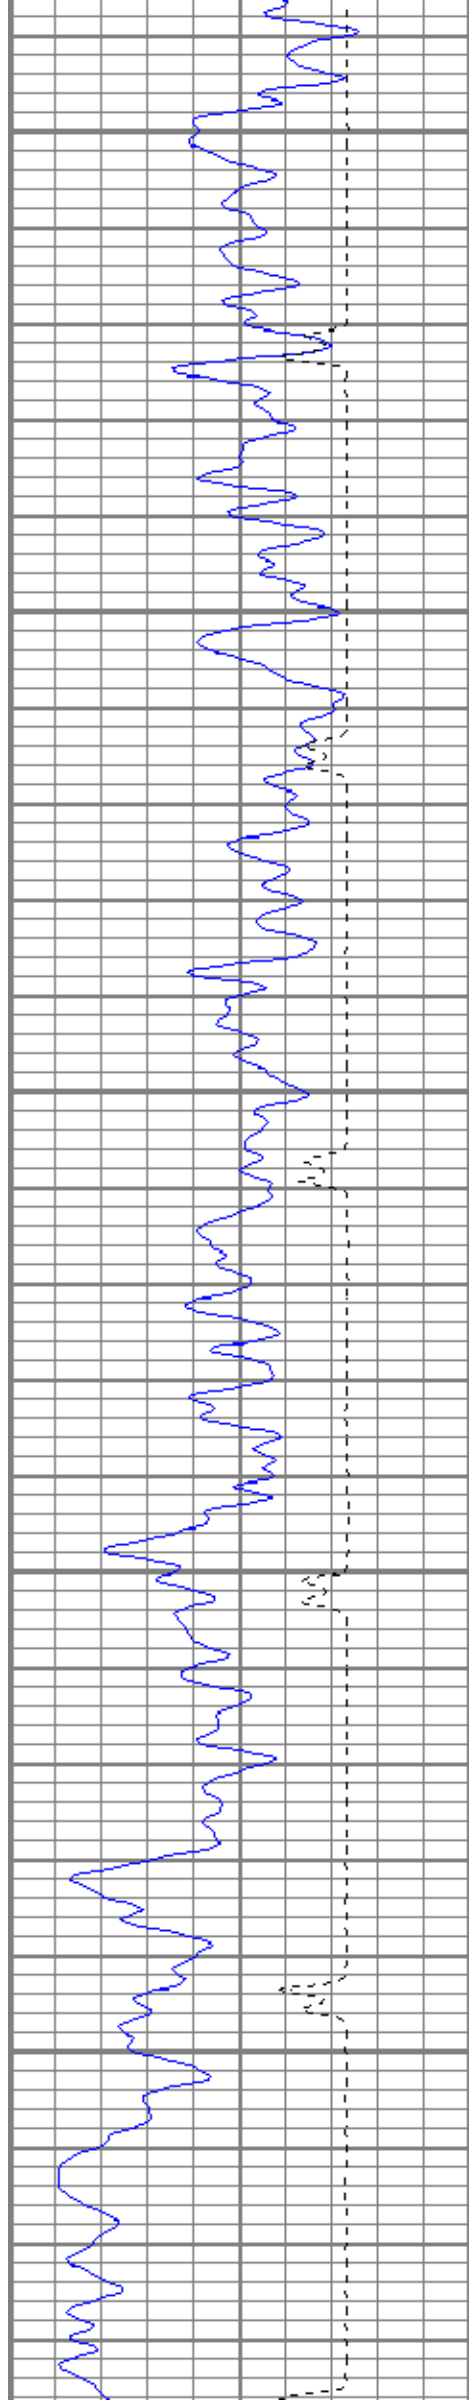



1000


1050

1100

1150

1200

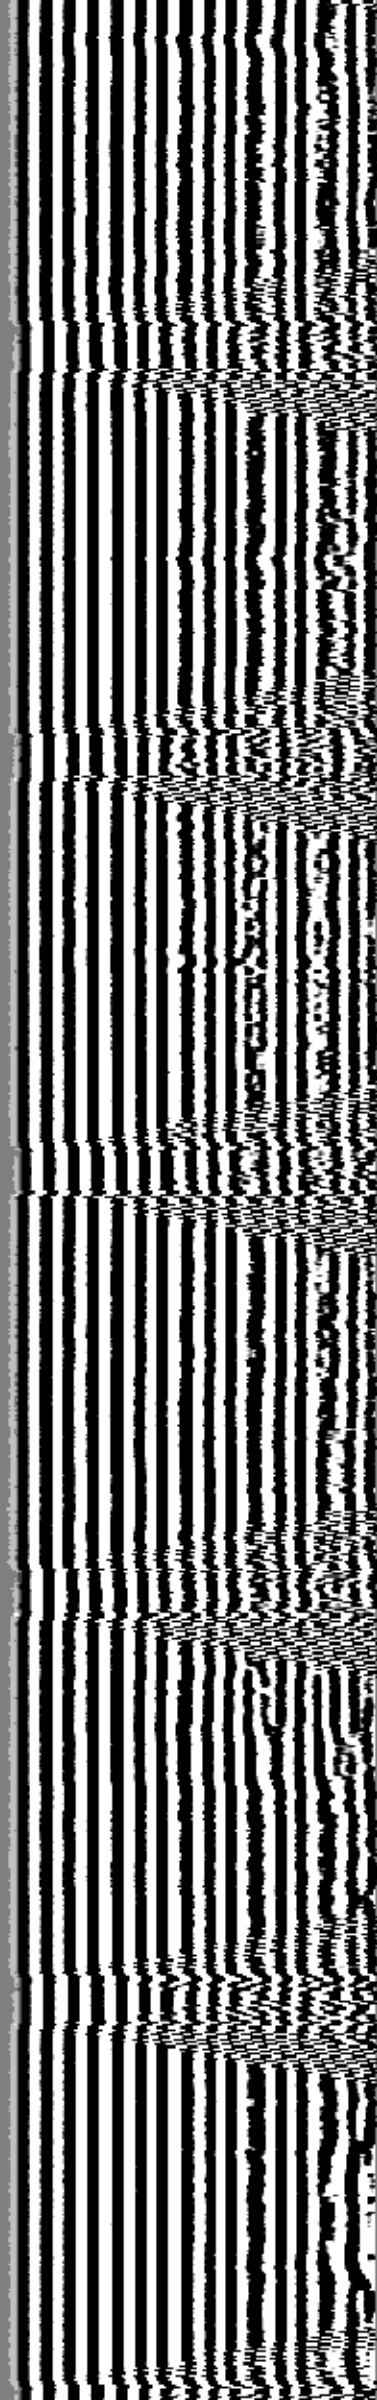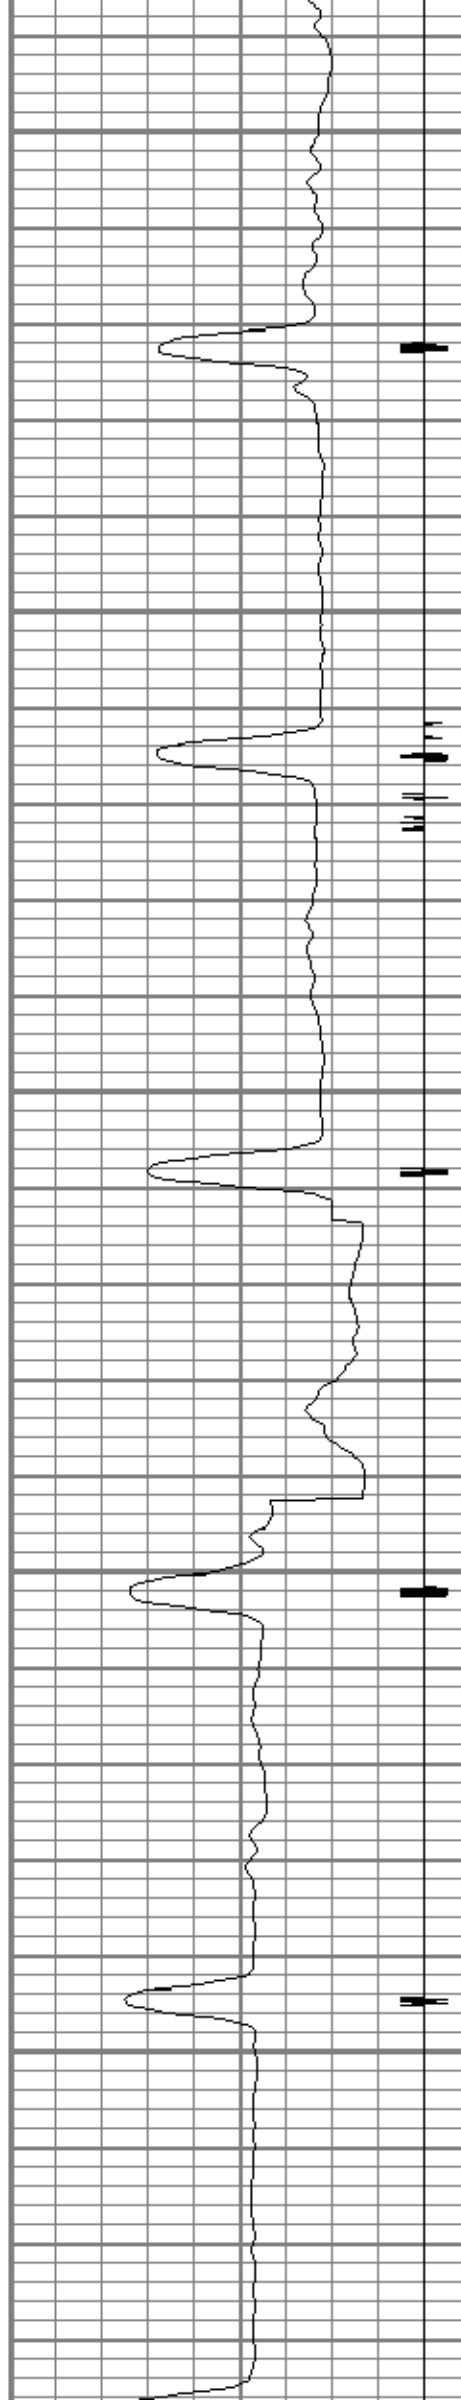

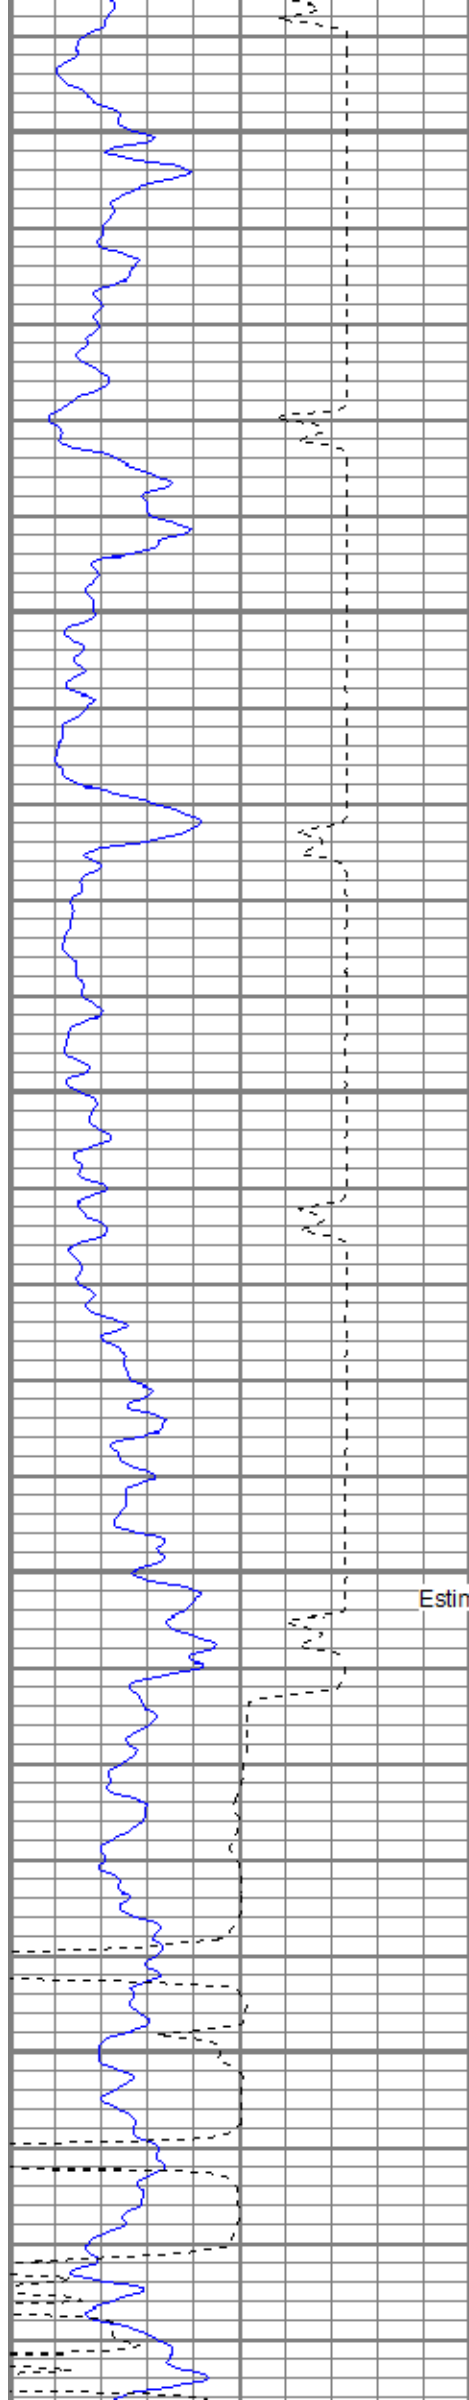

1250



1300


1350

1400

Estimated Top of Cement

1450

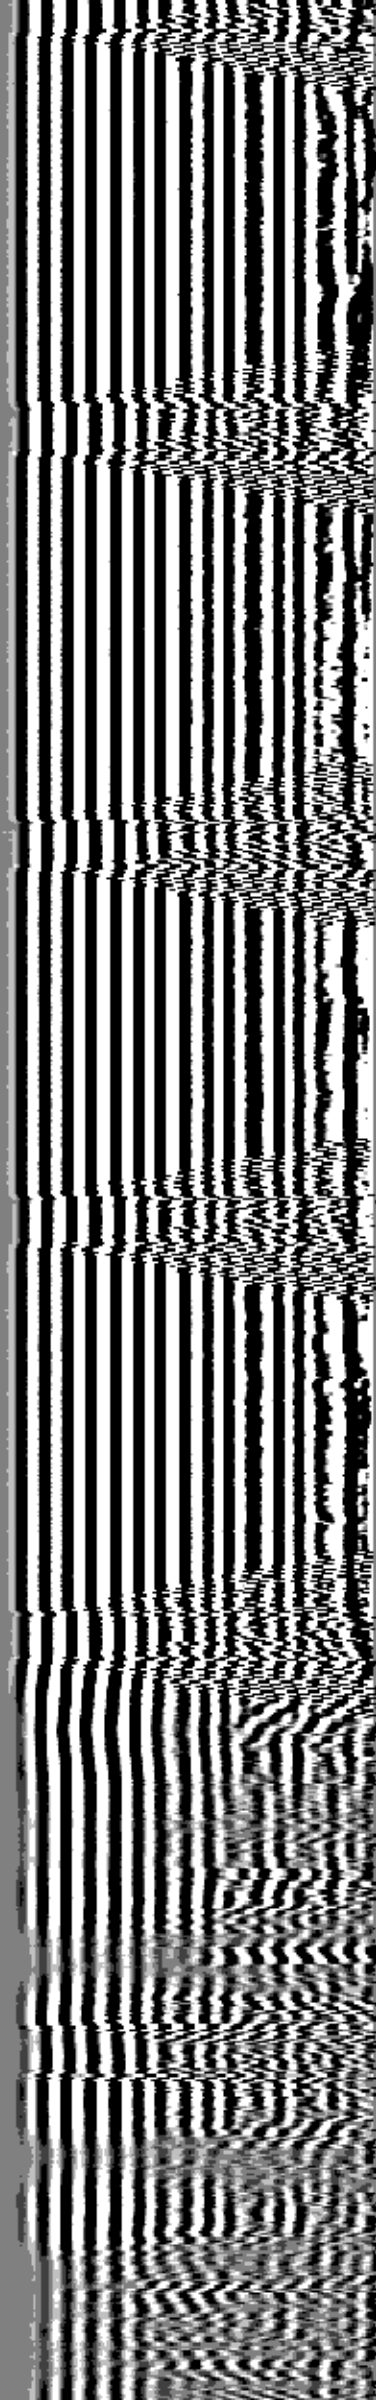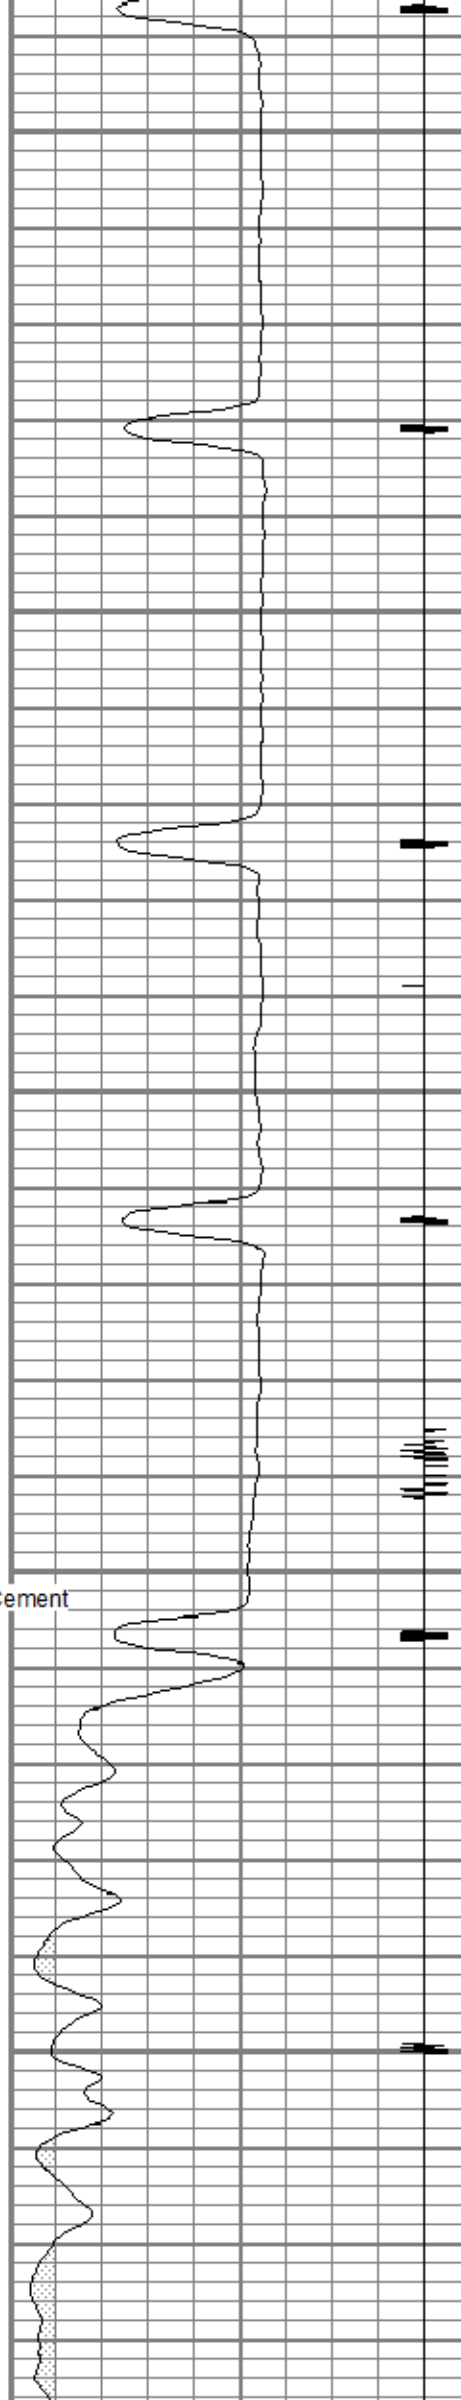

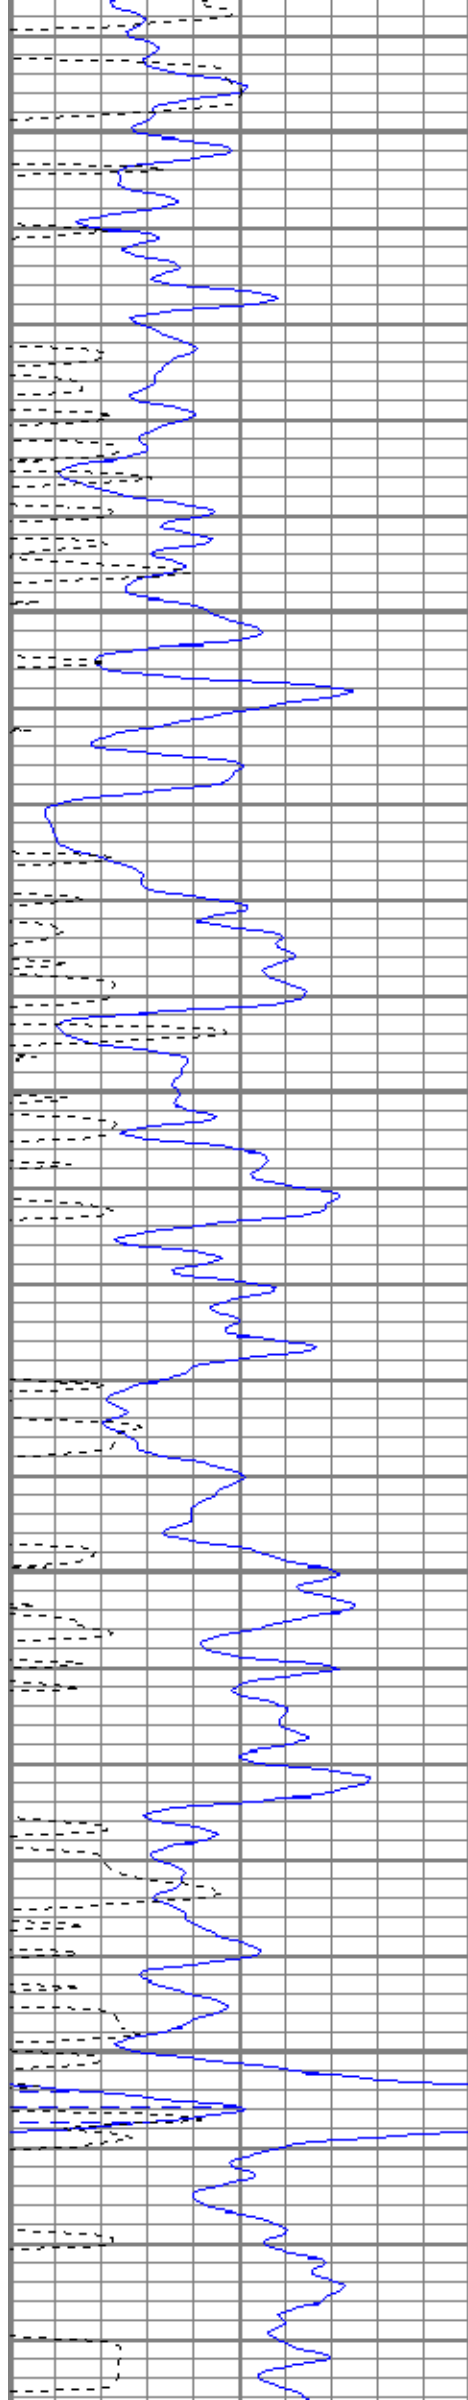



1500


1550


1600


1650

1700

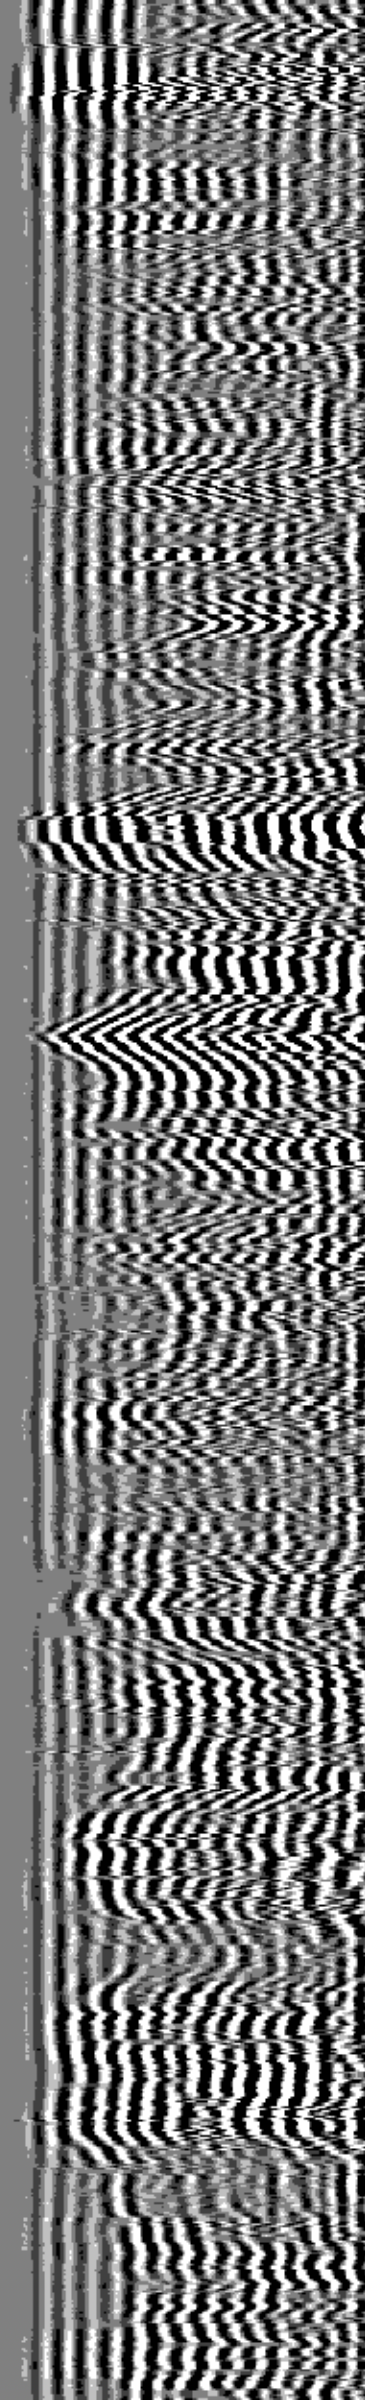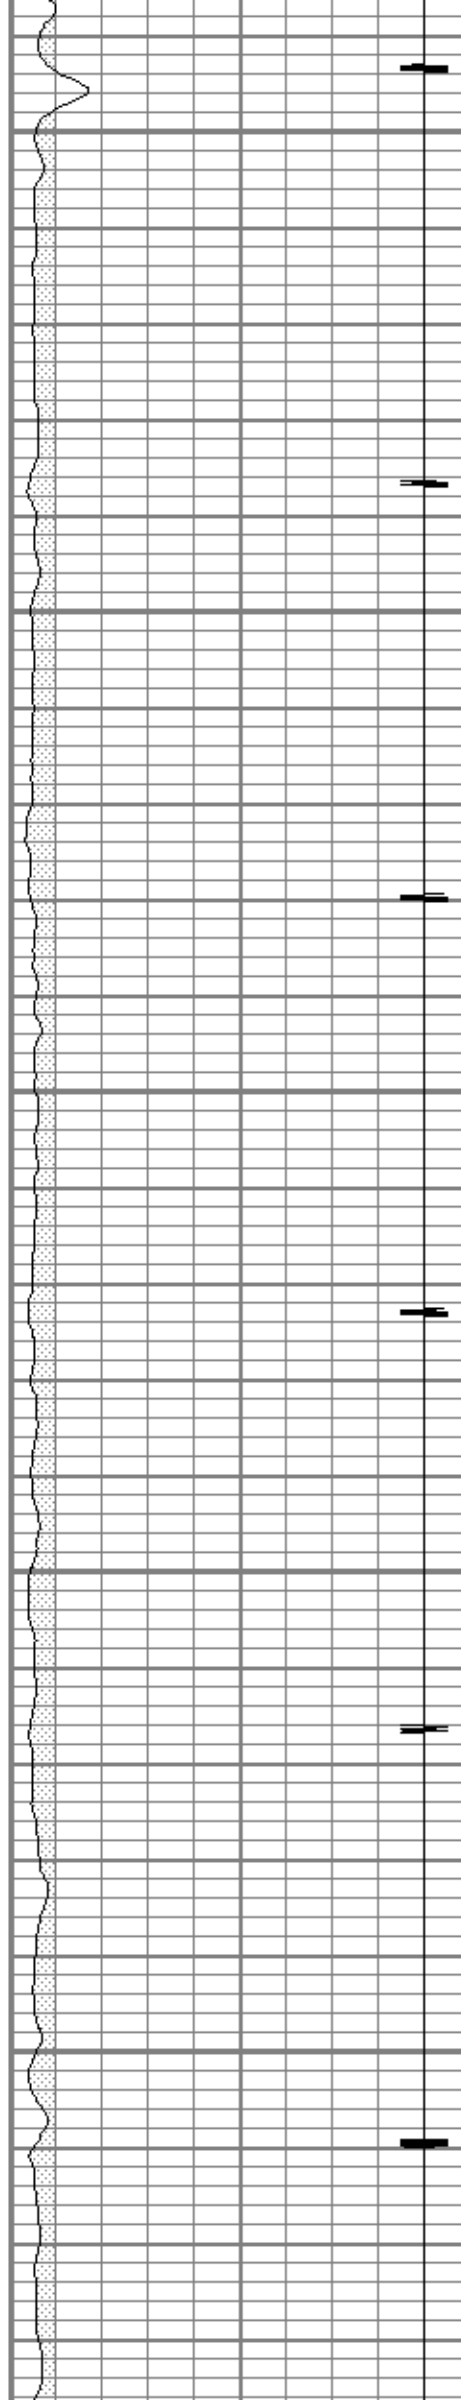

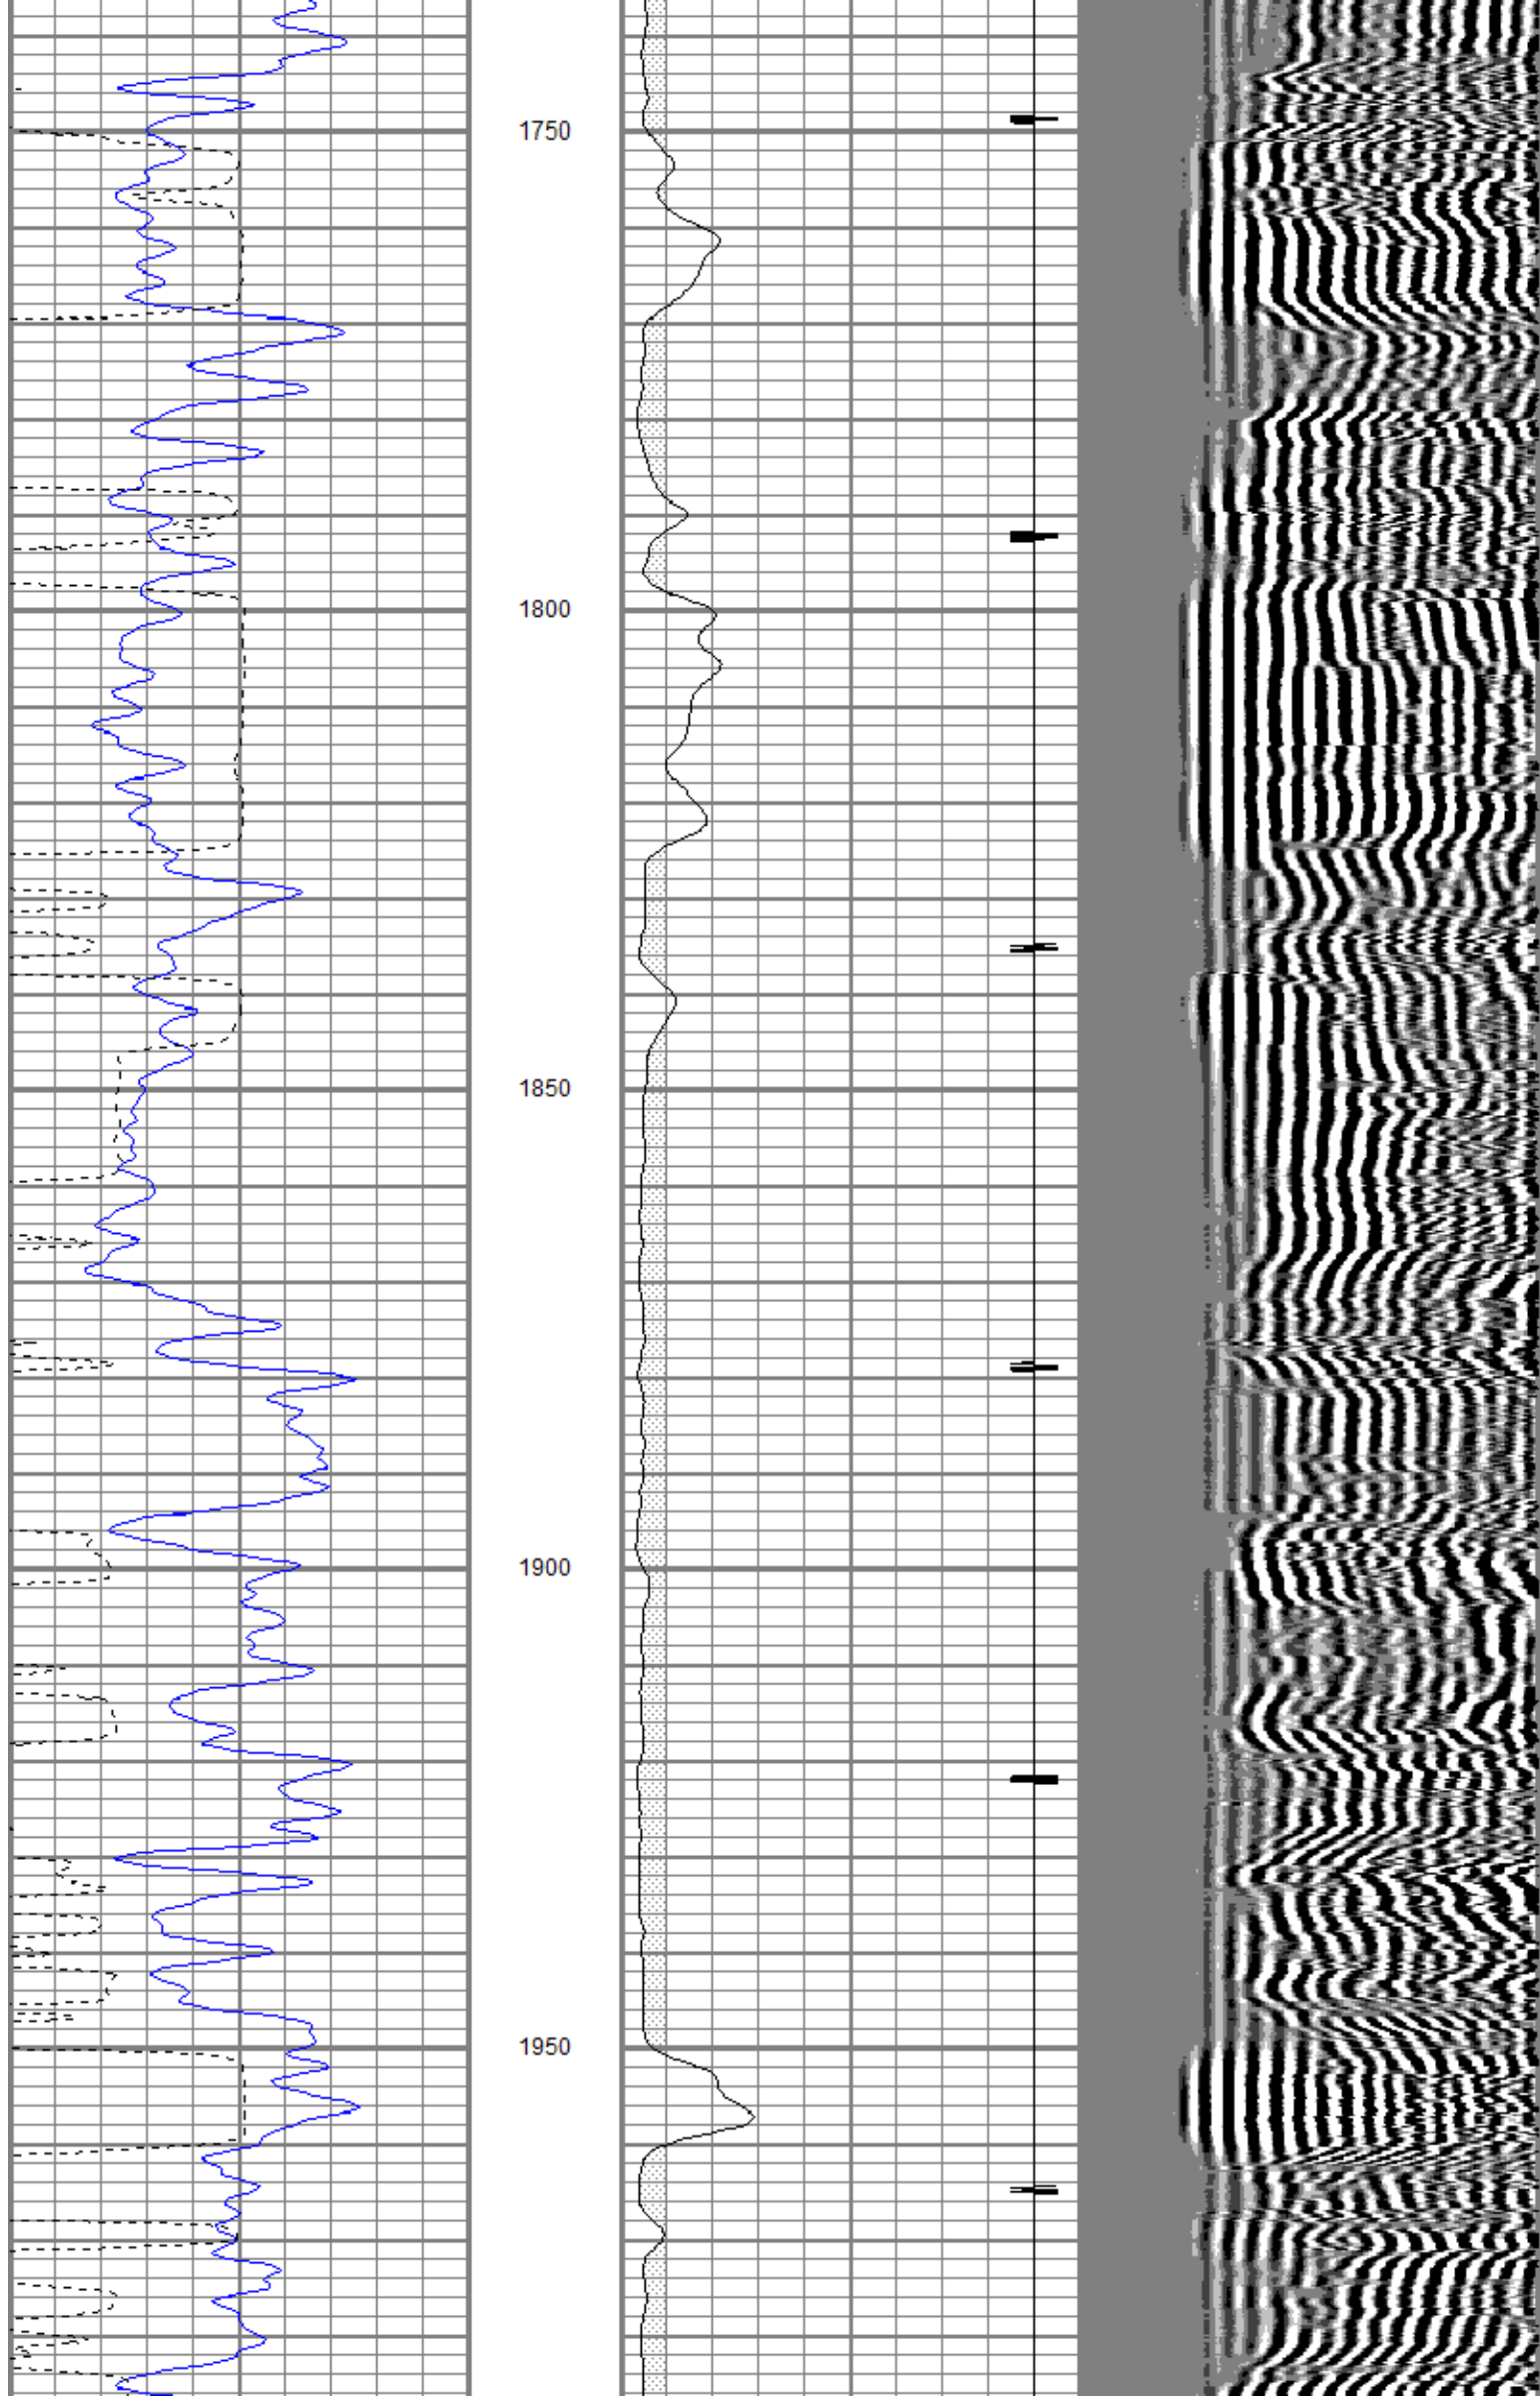

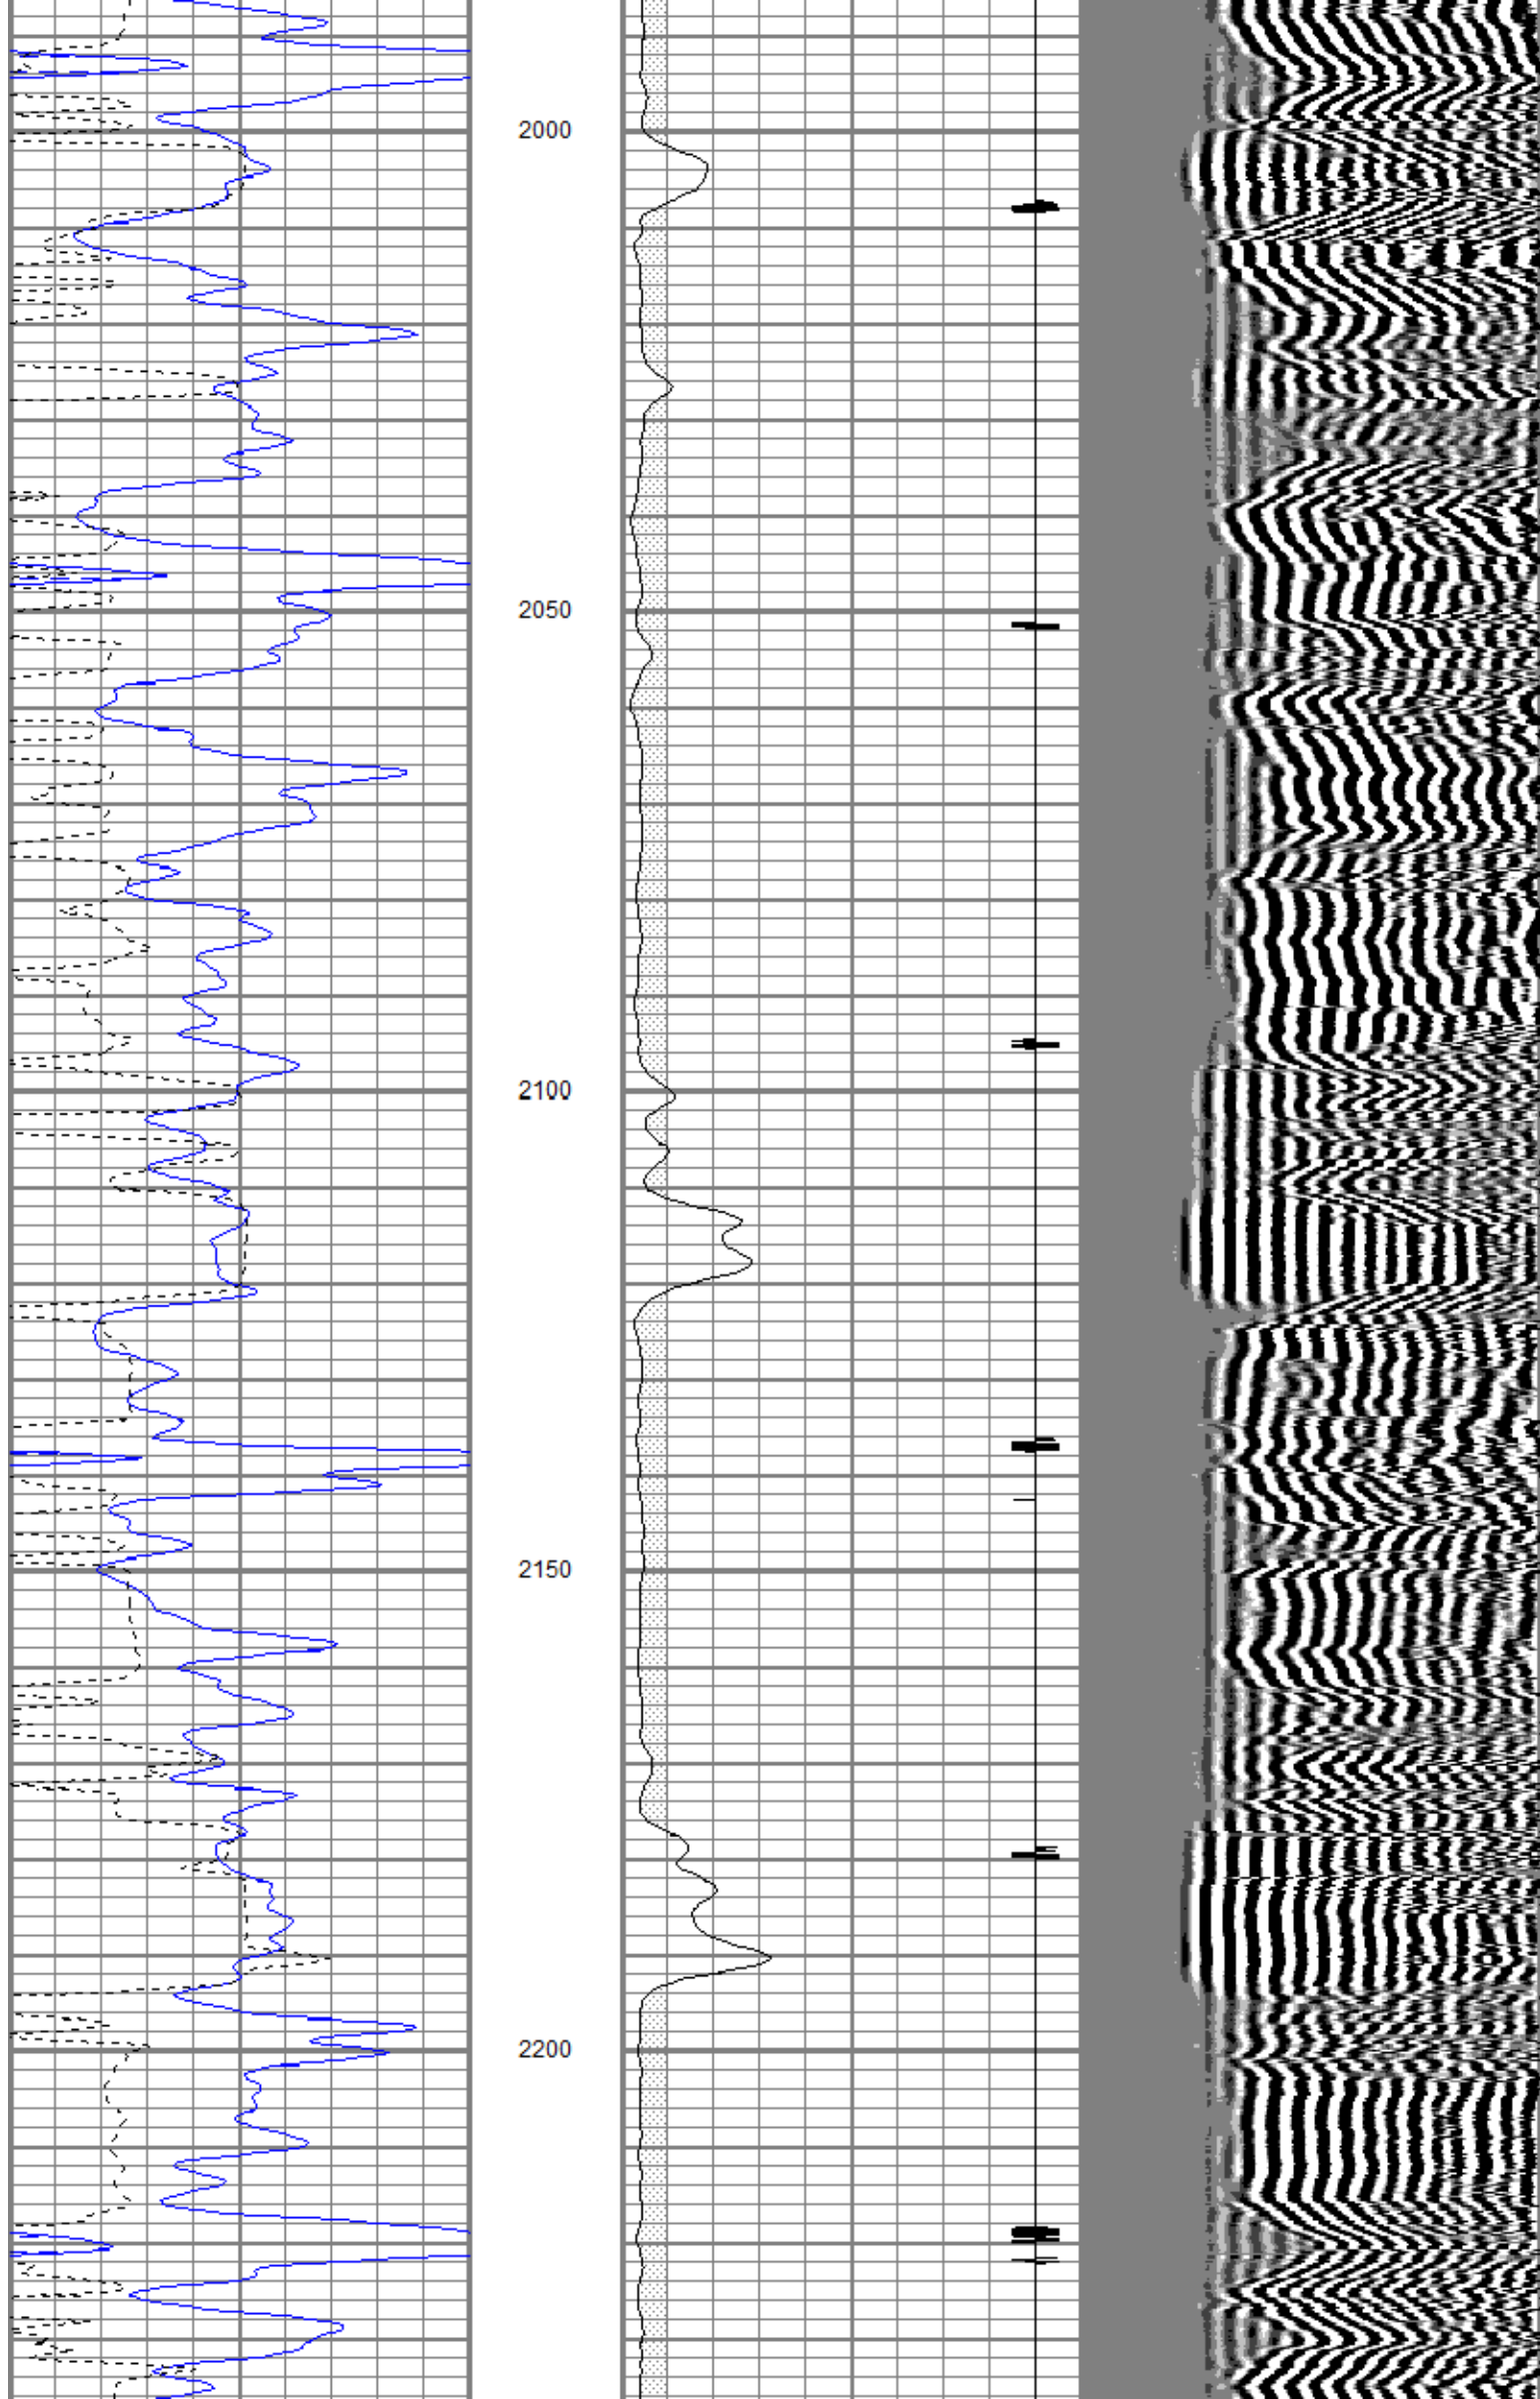

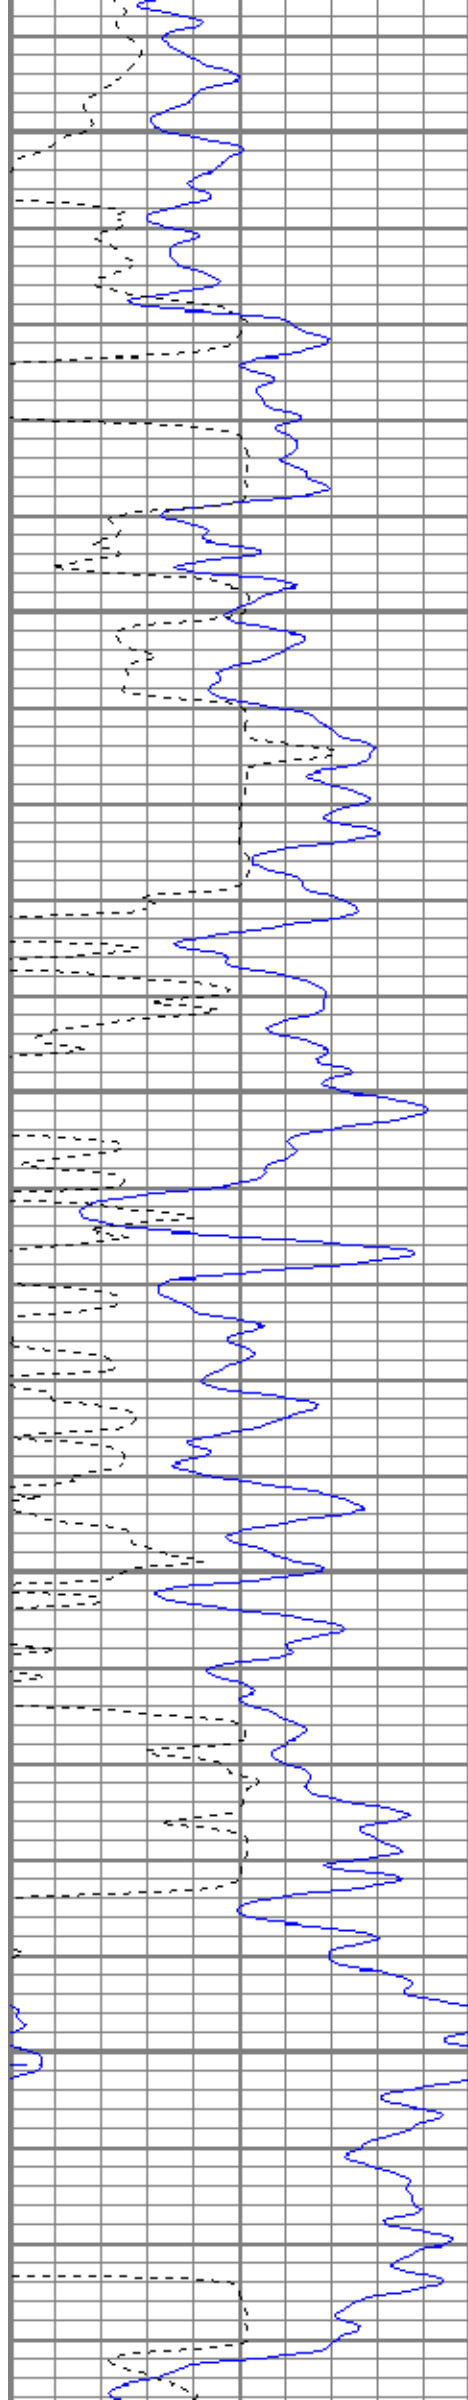


2250

2300

2350

2400

2450

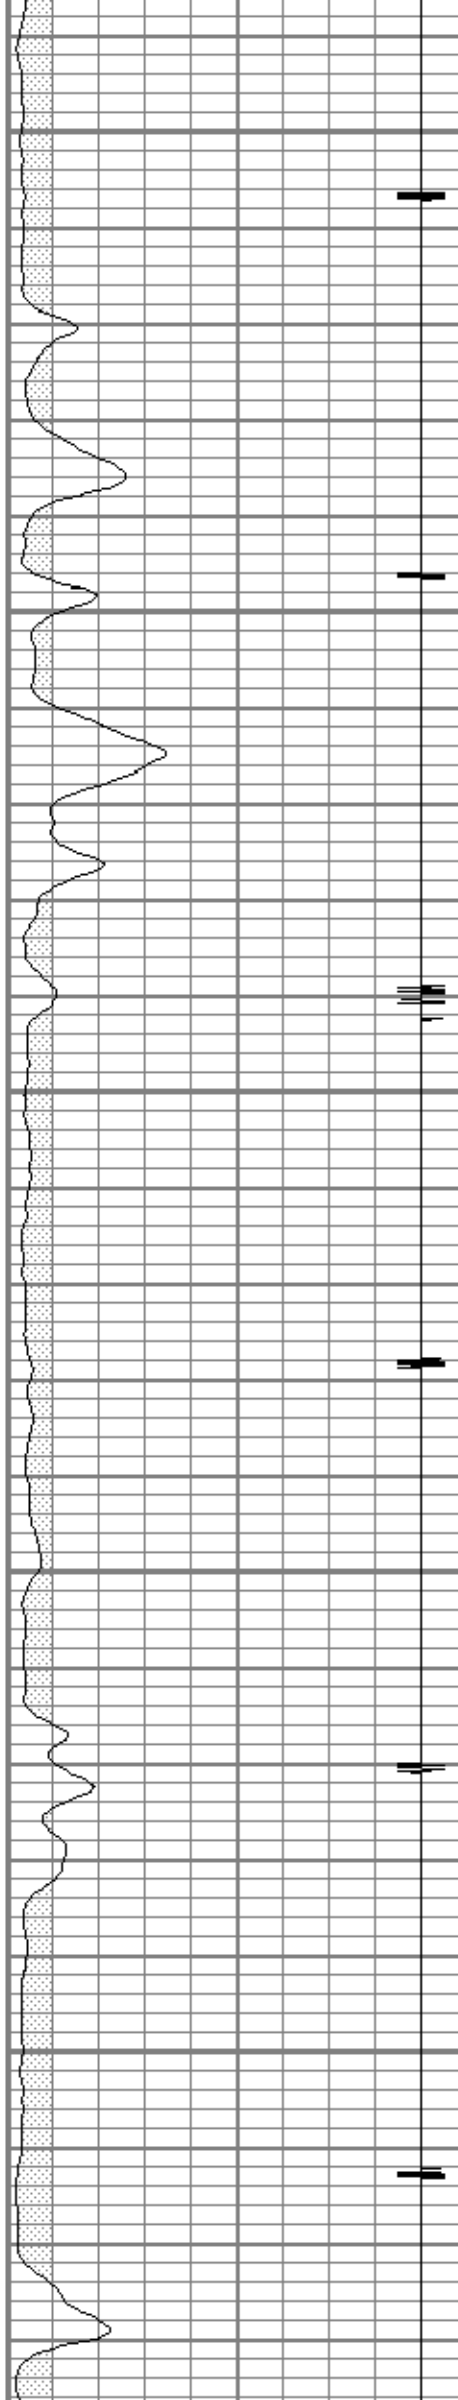

—


—


—


—


—


—

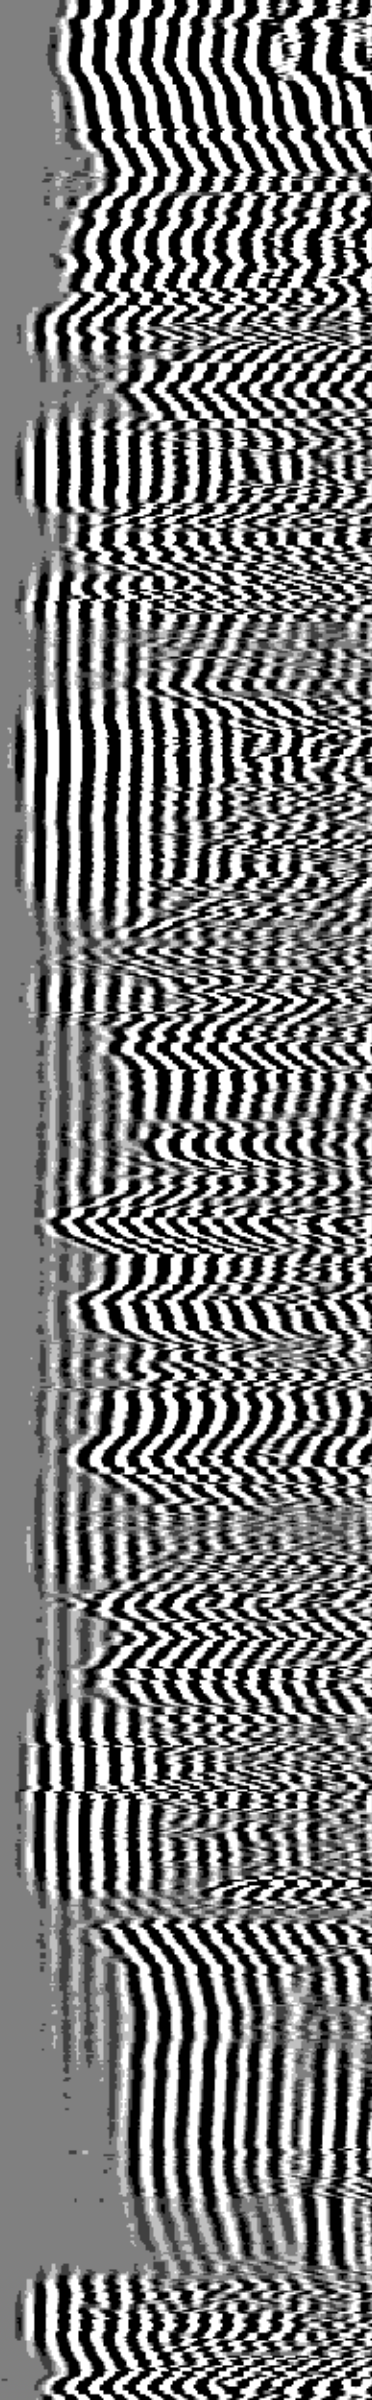


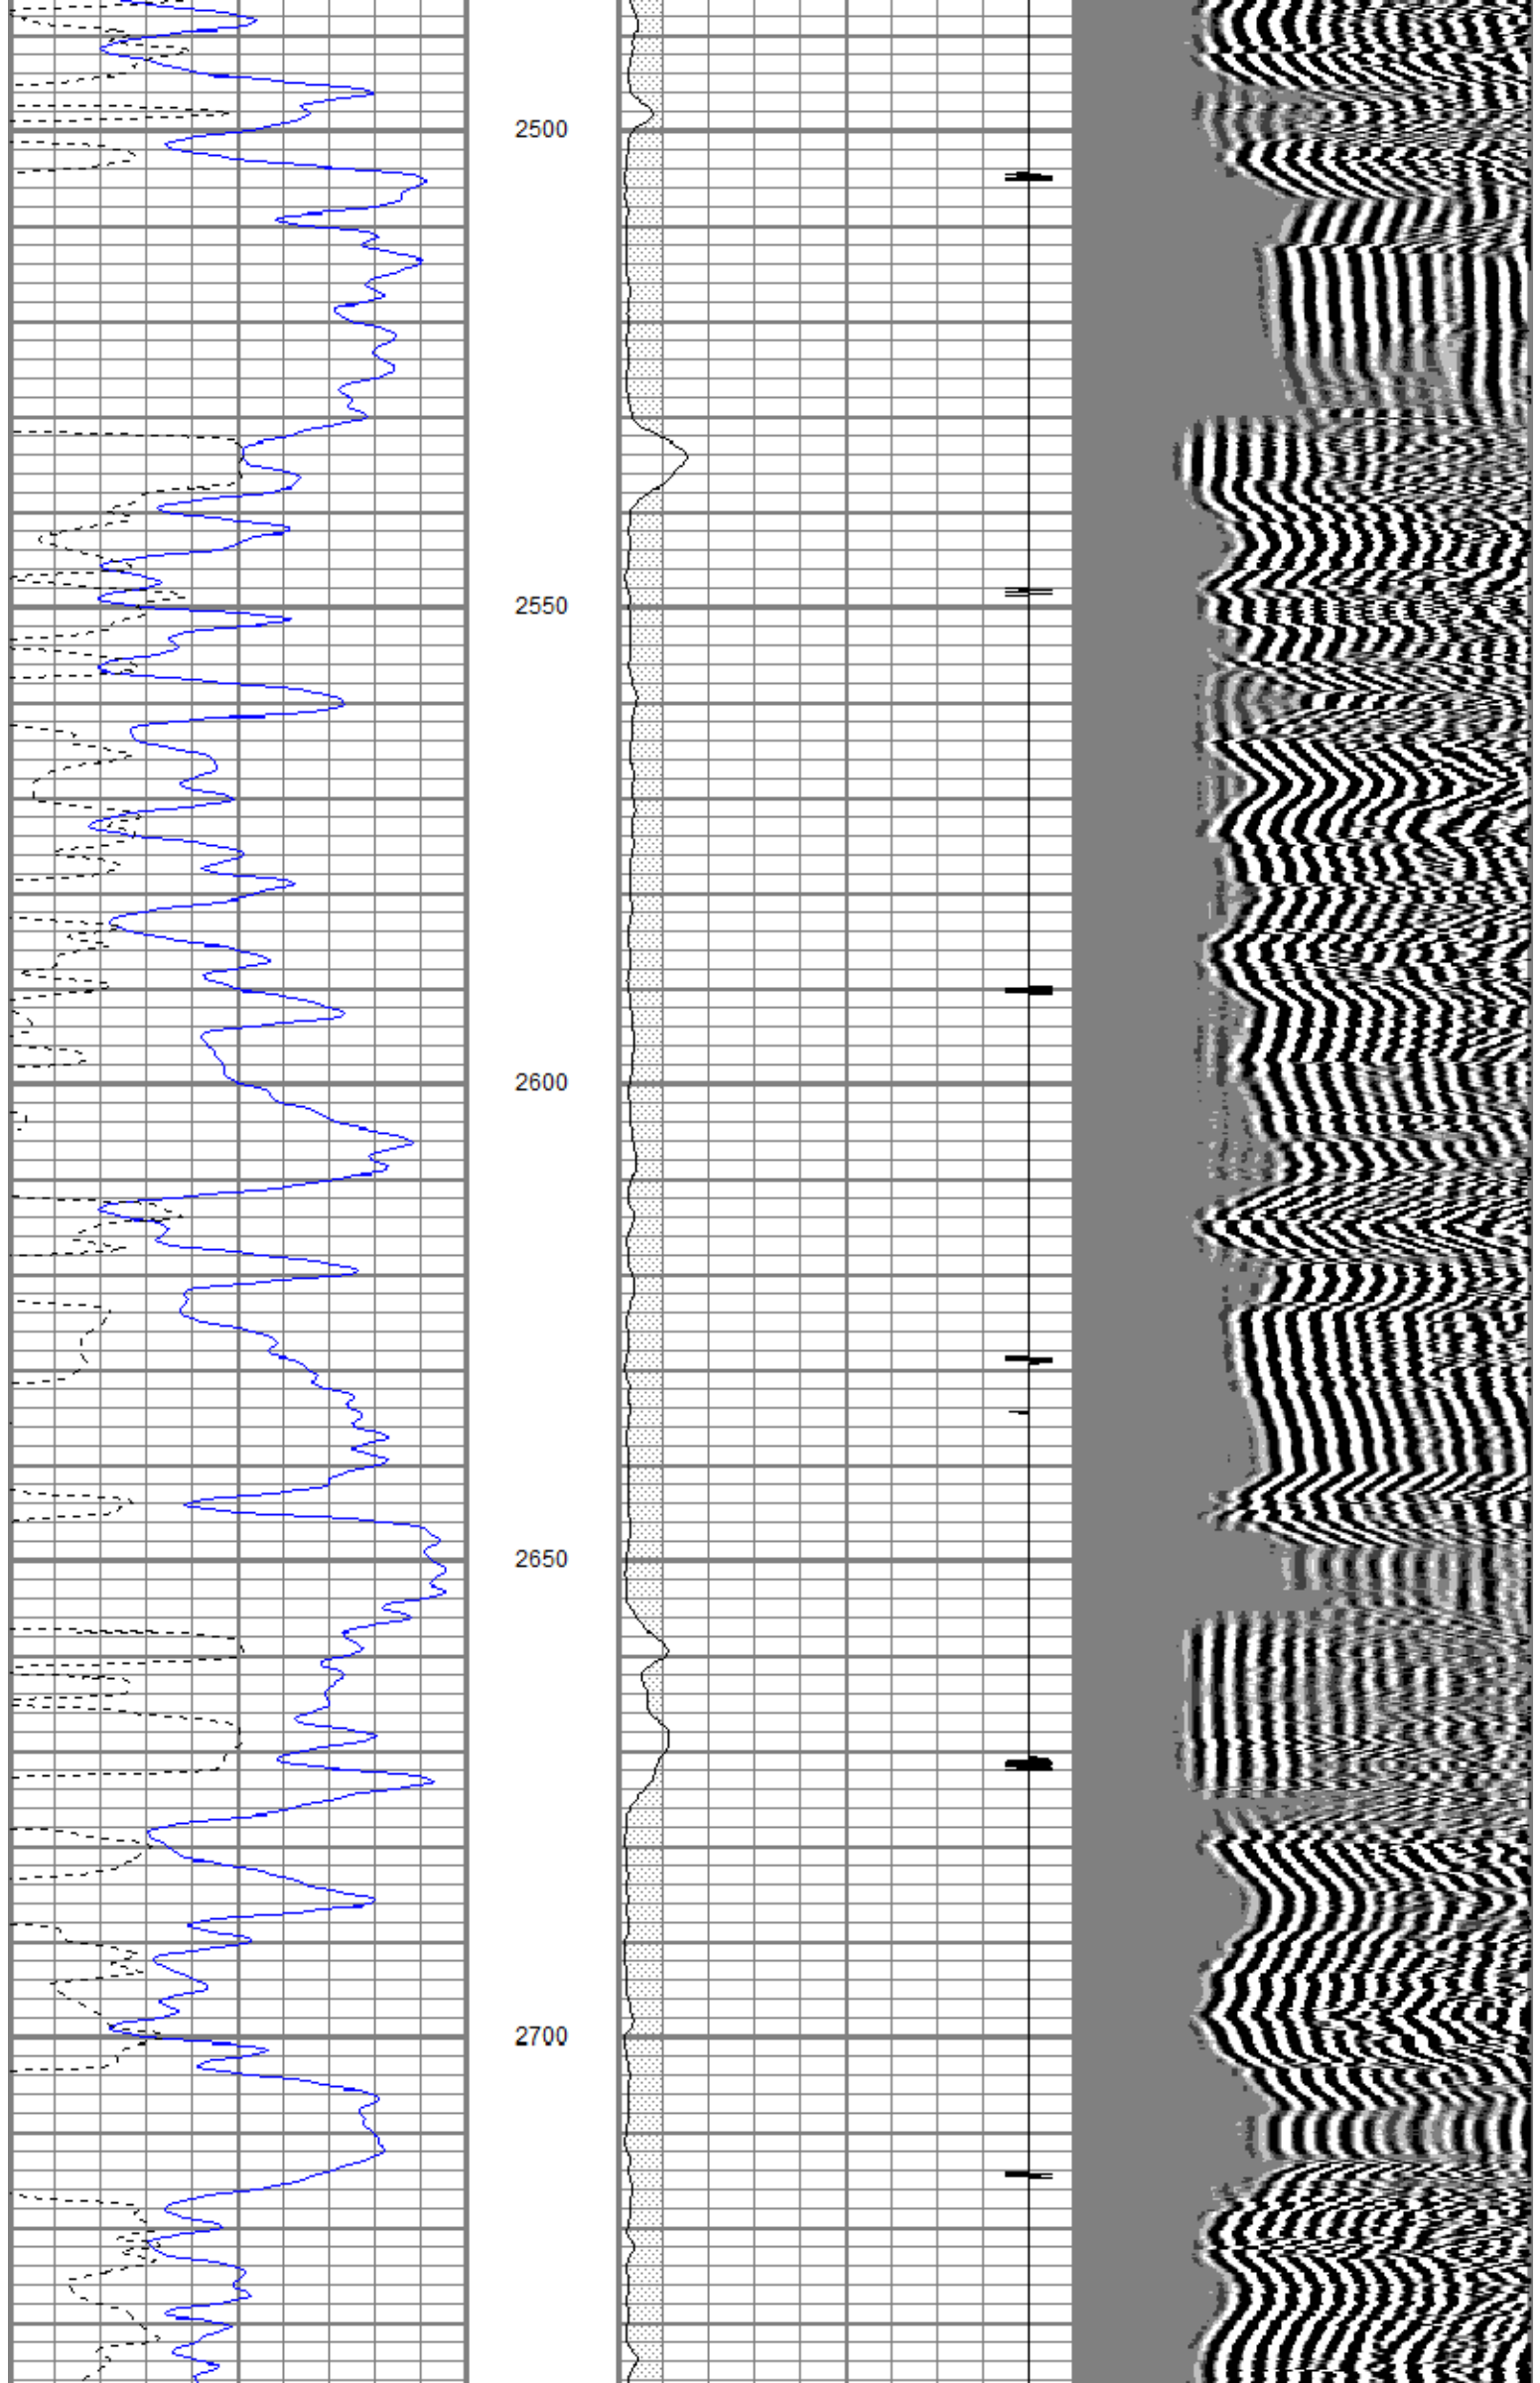

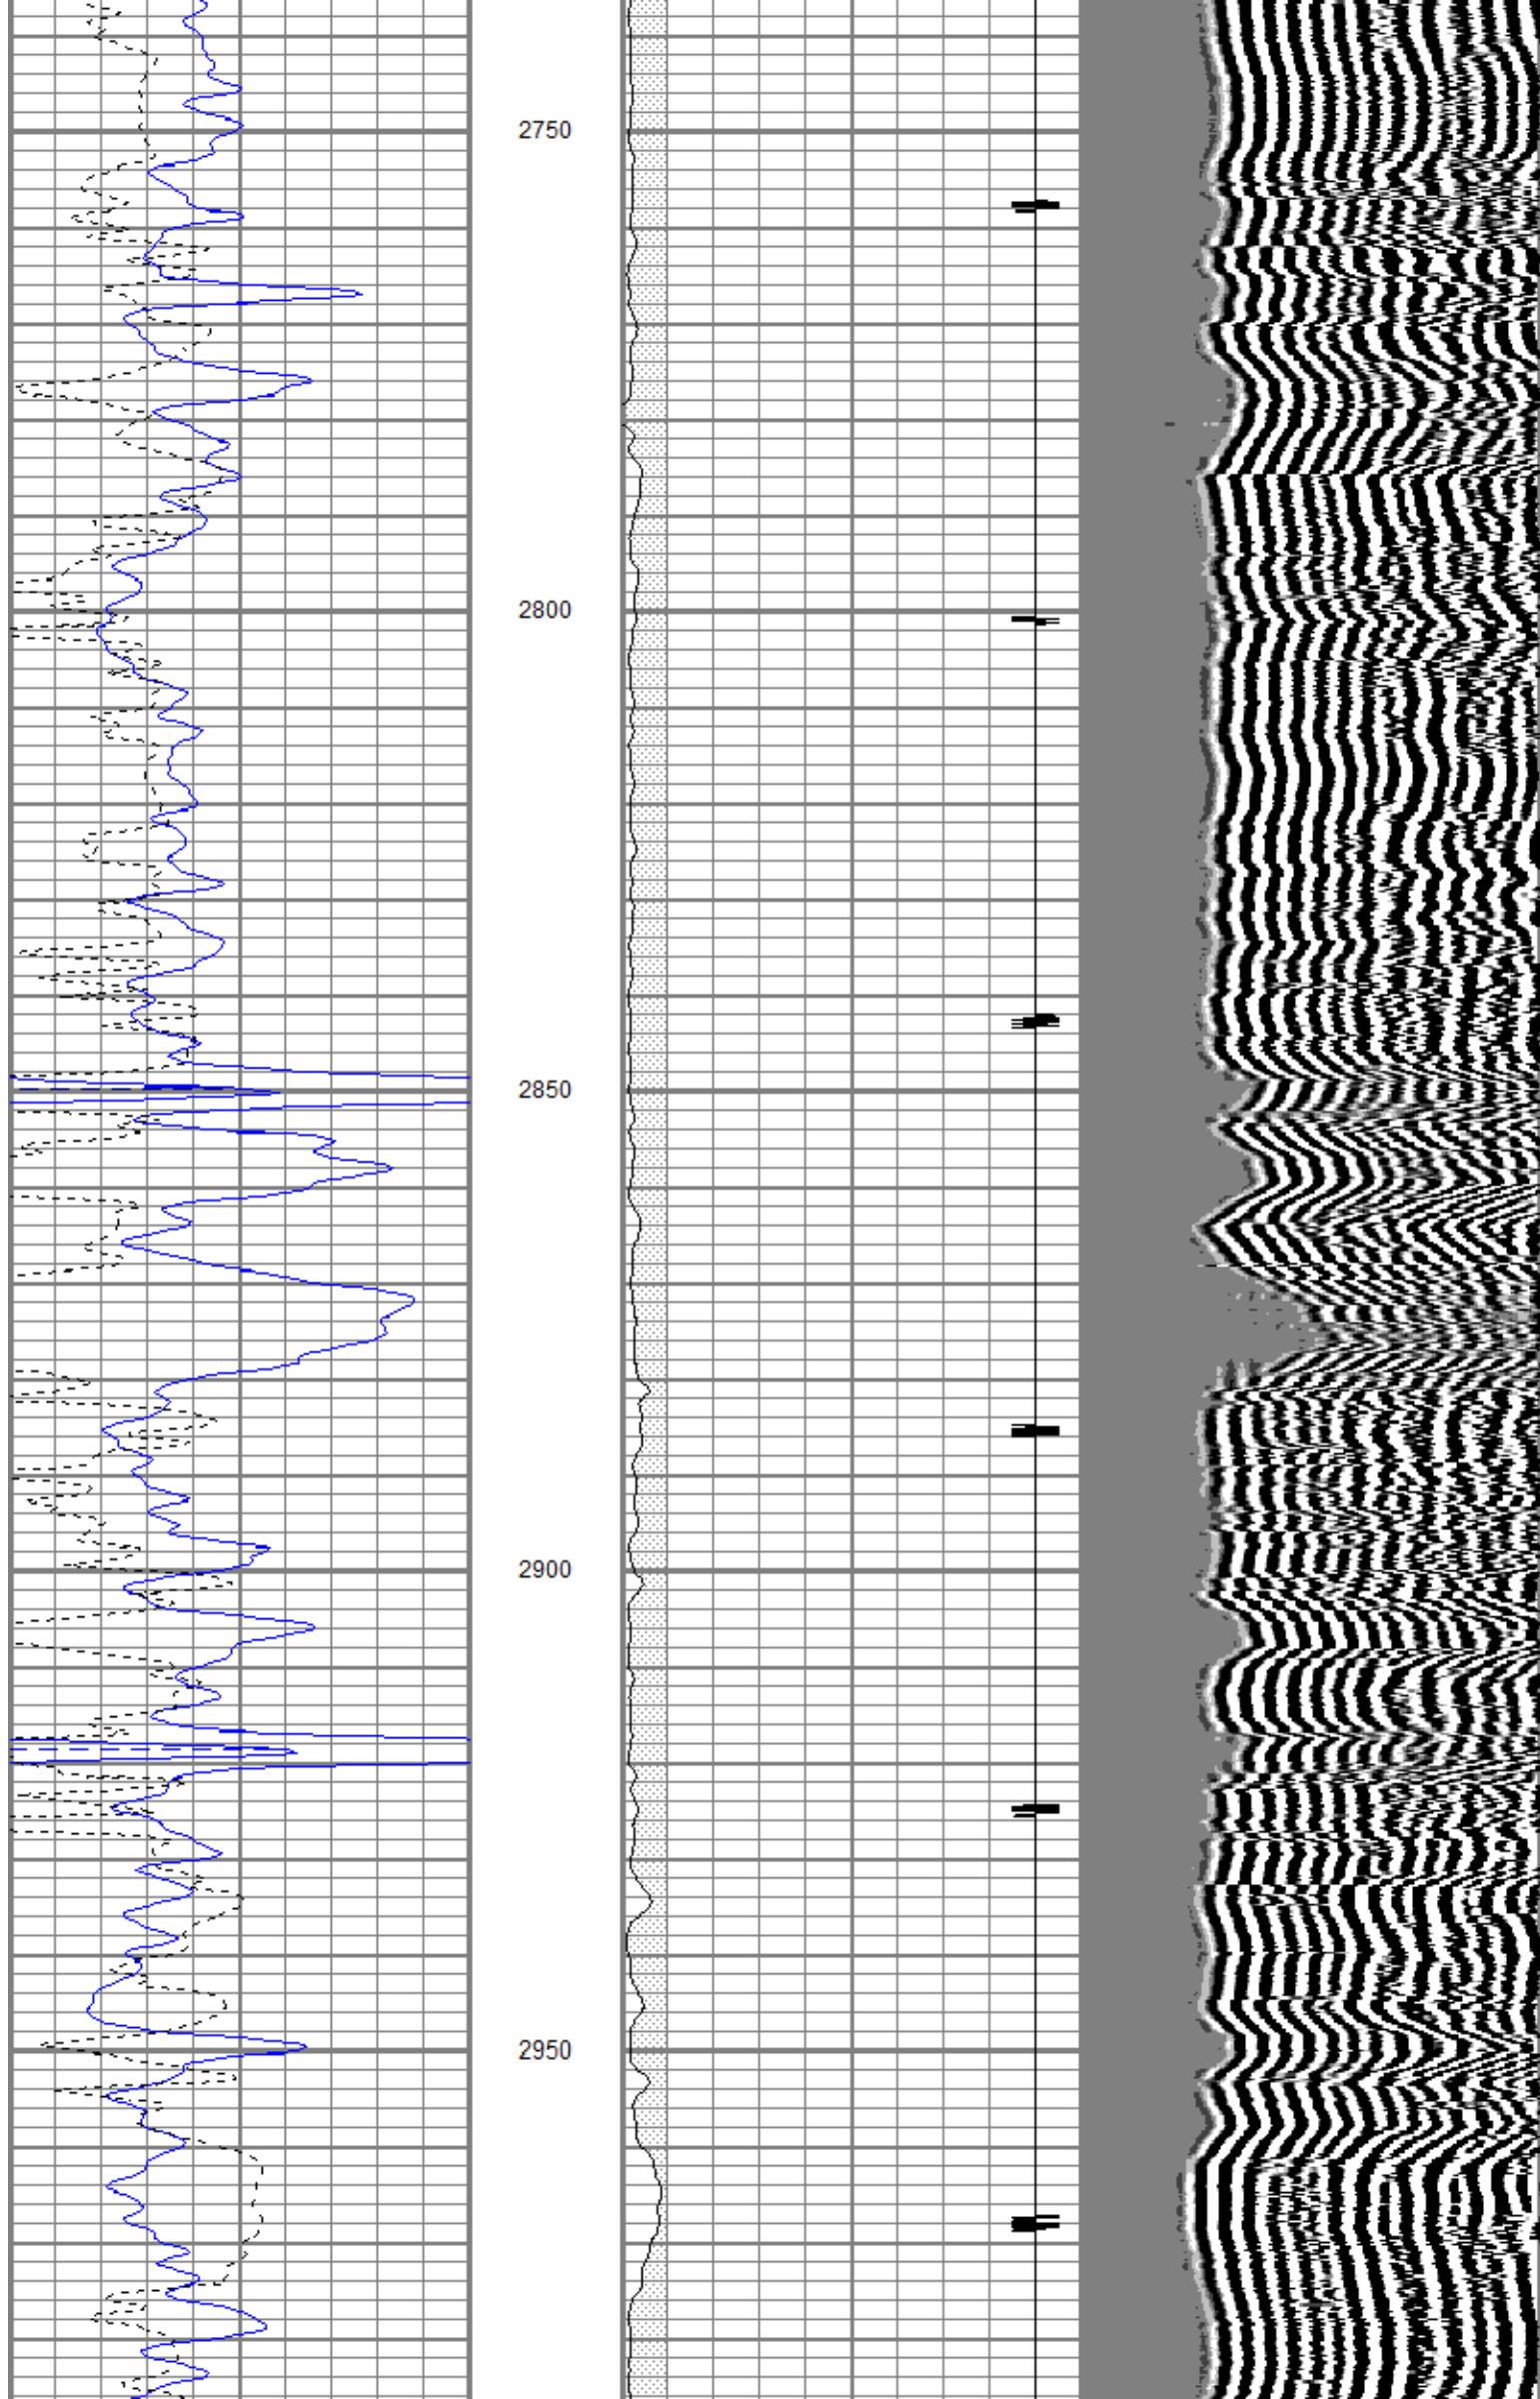


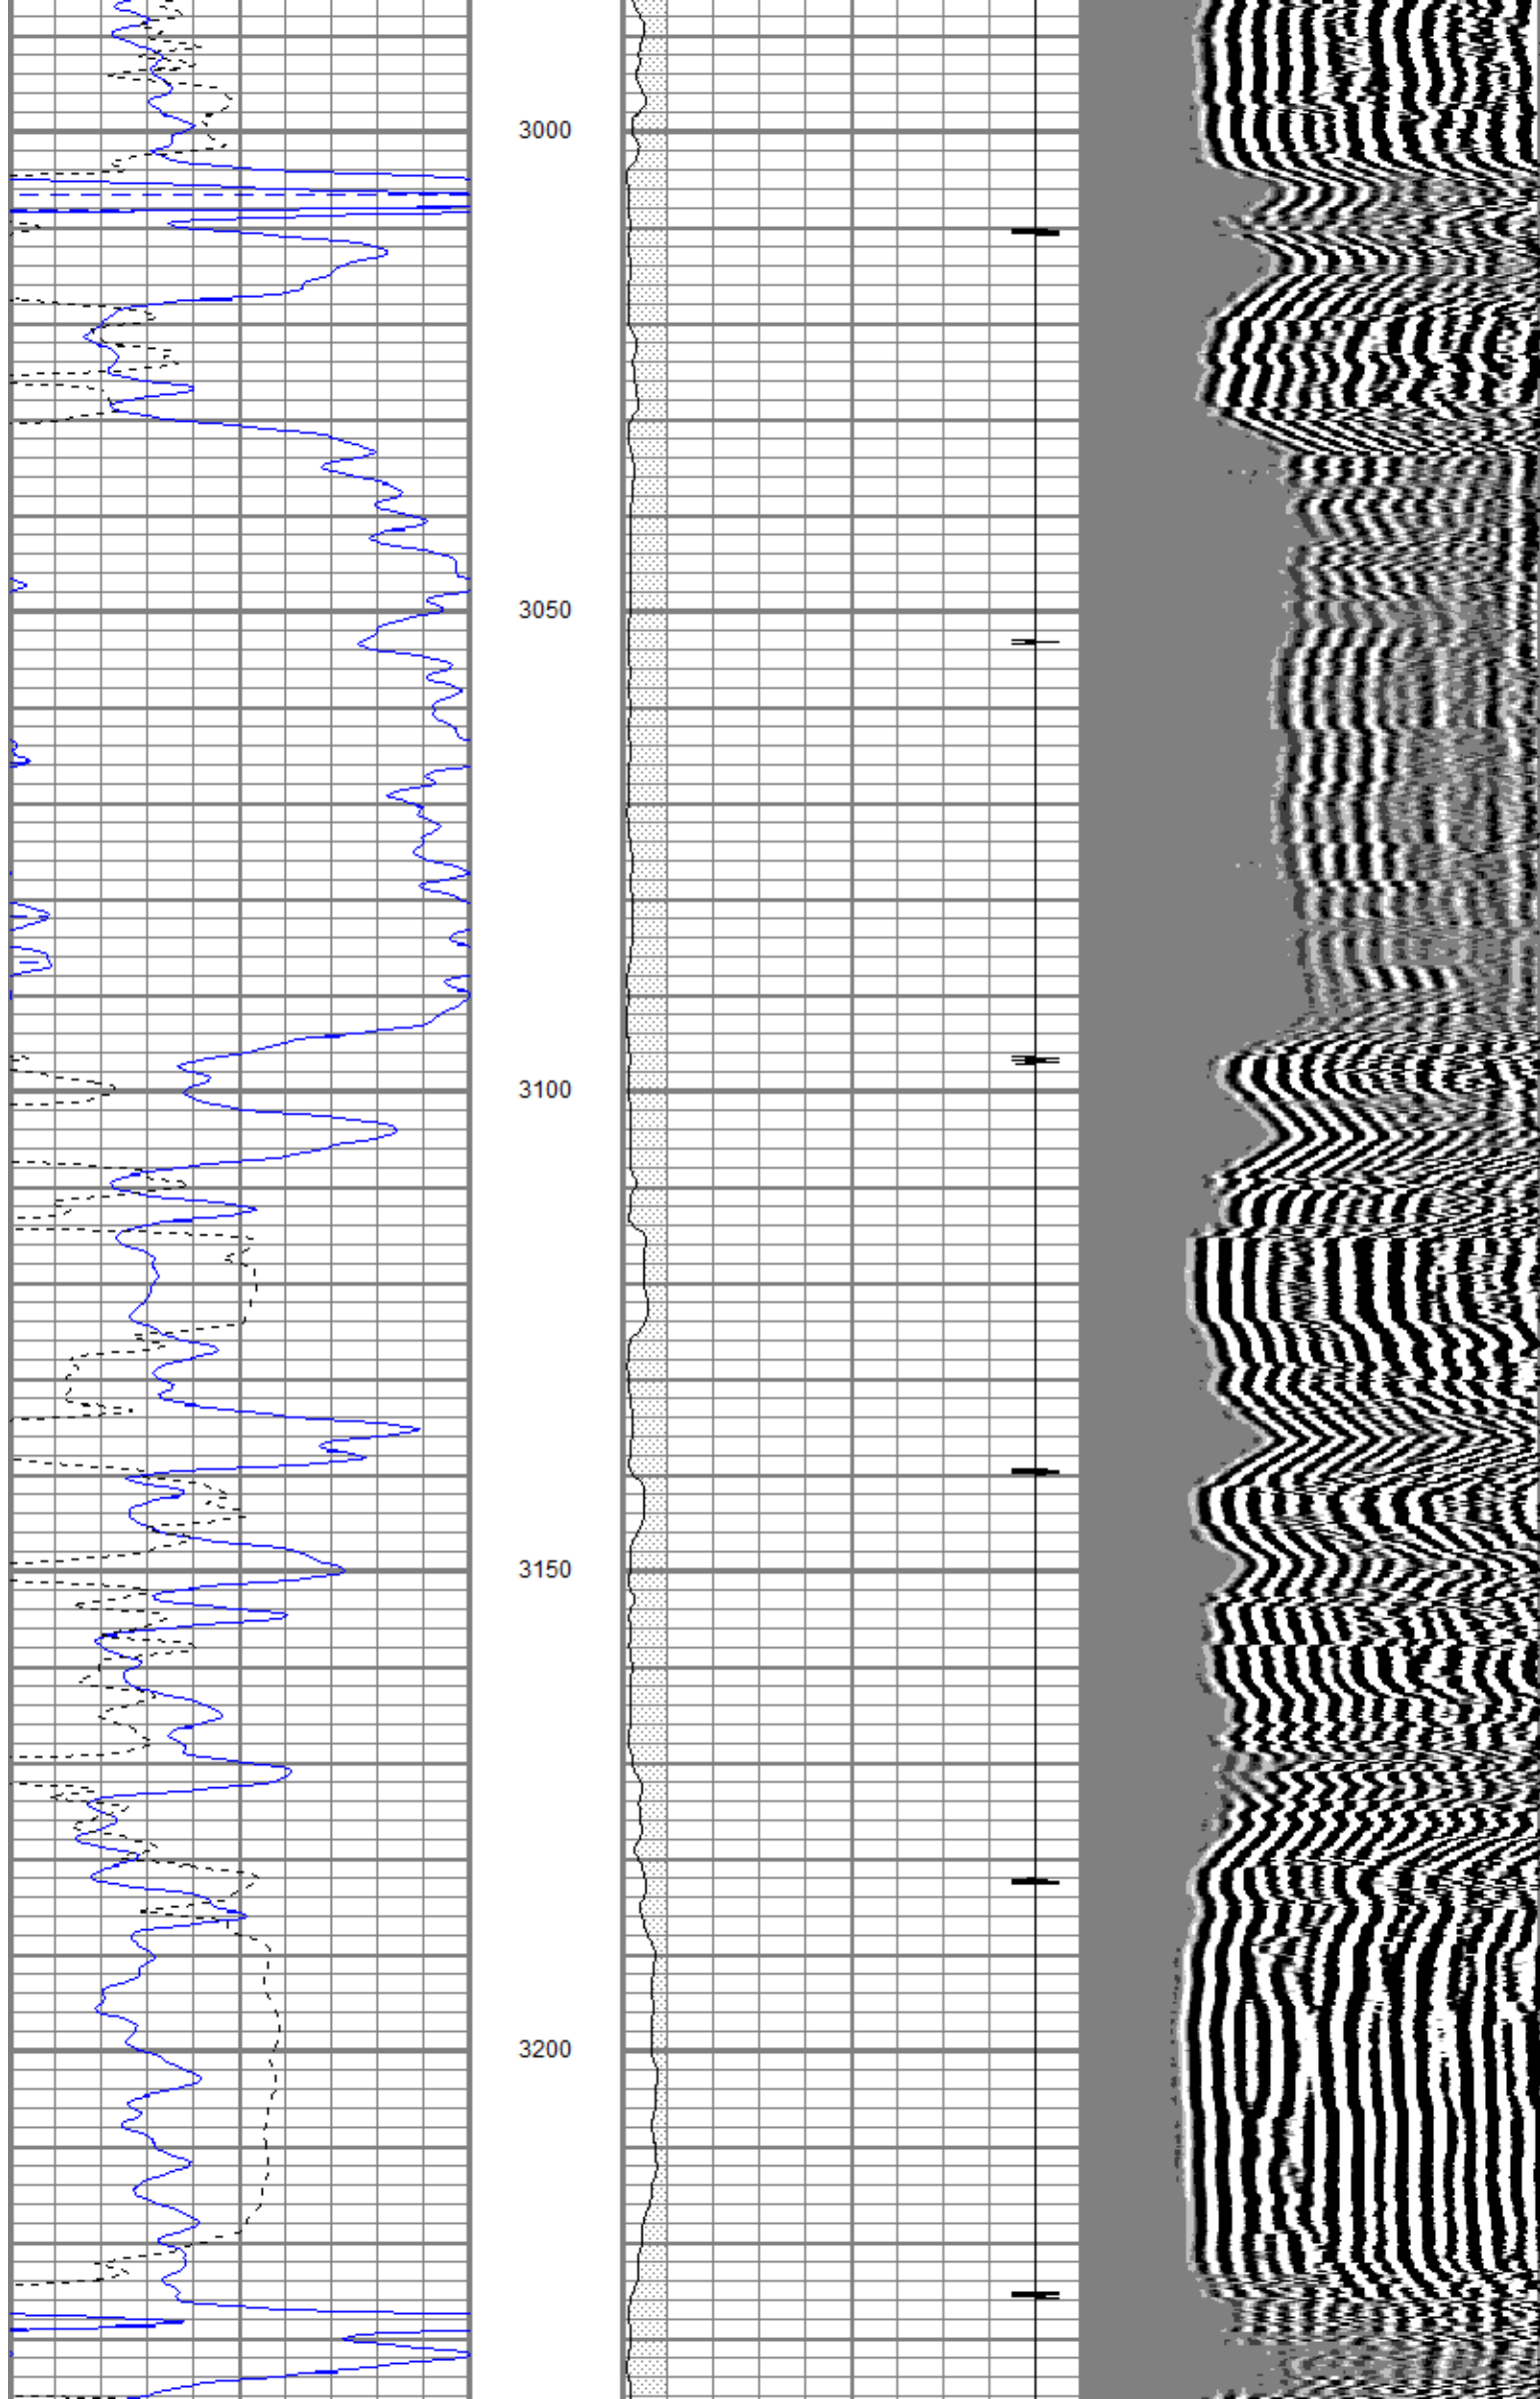


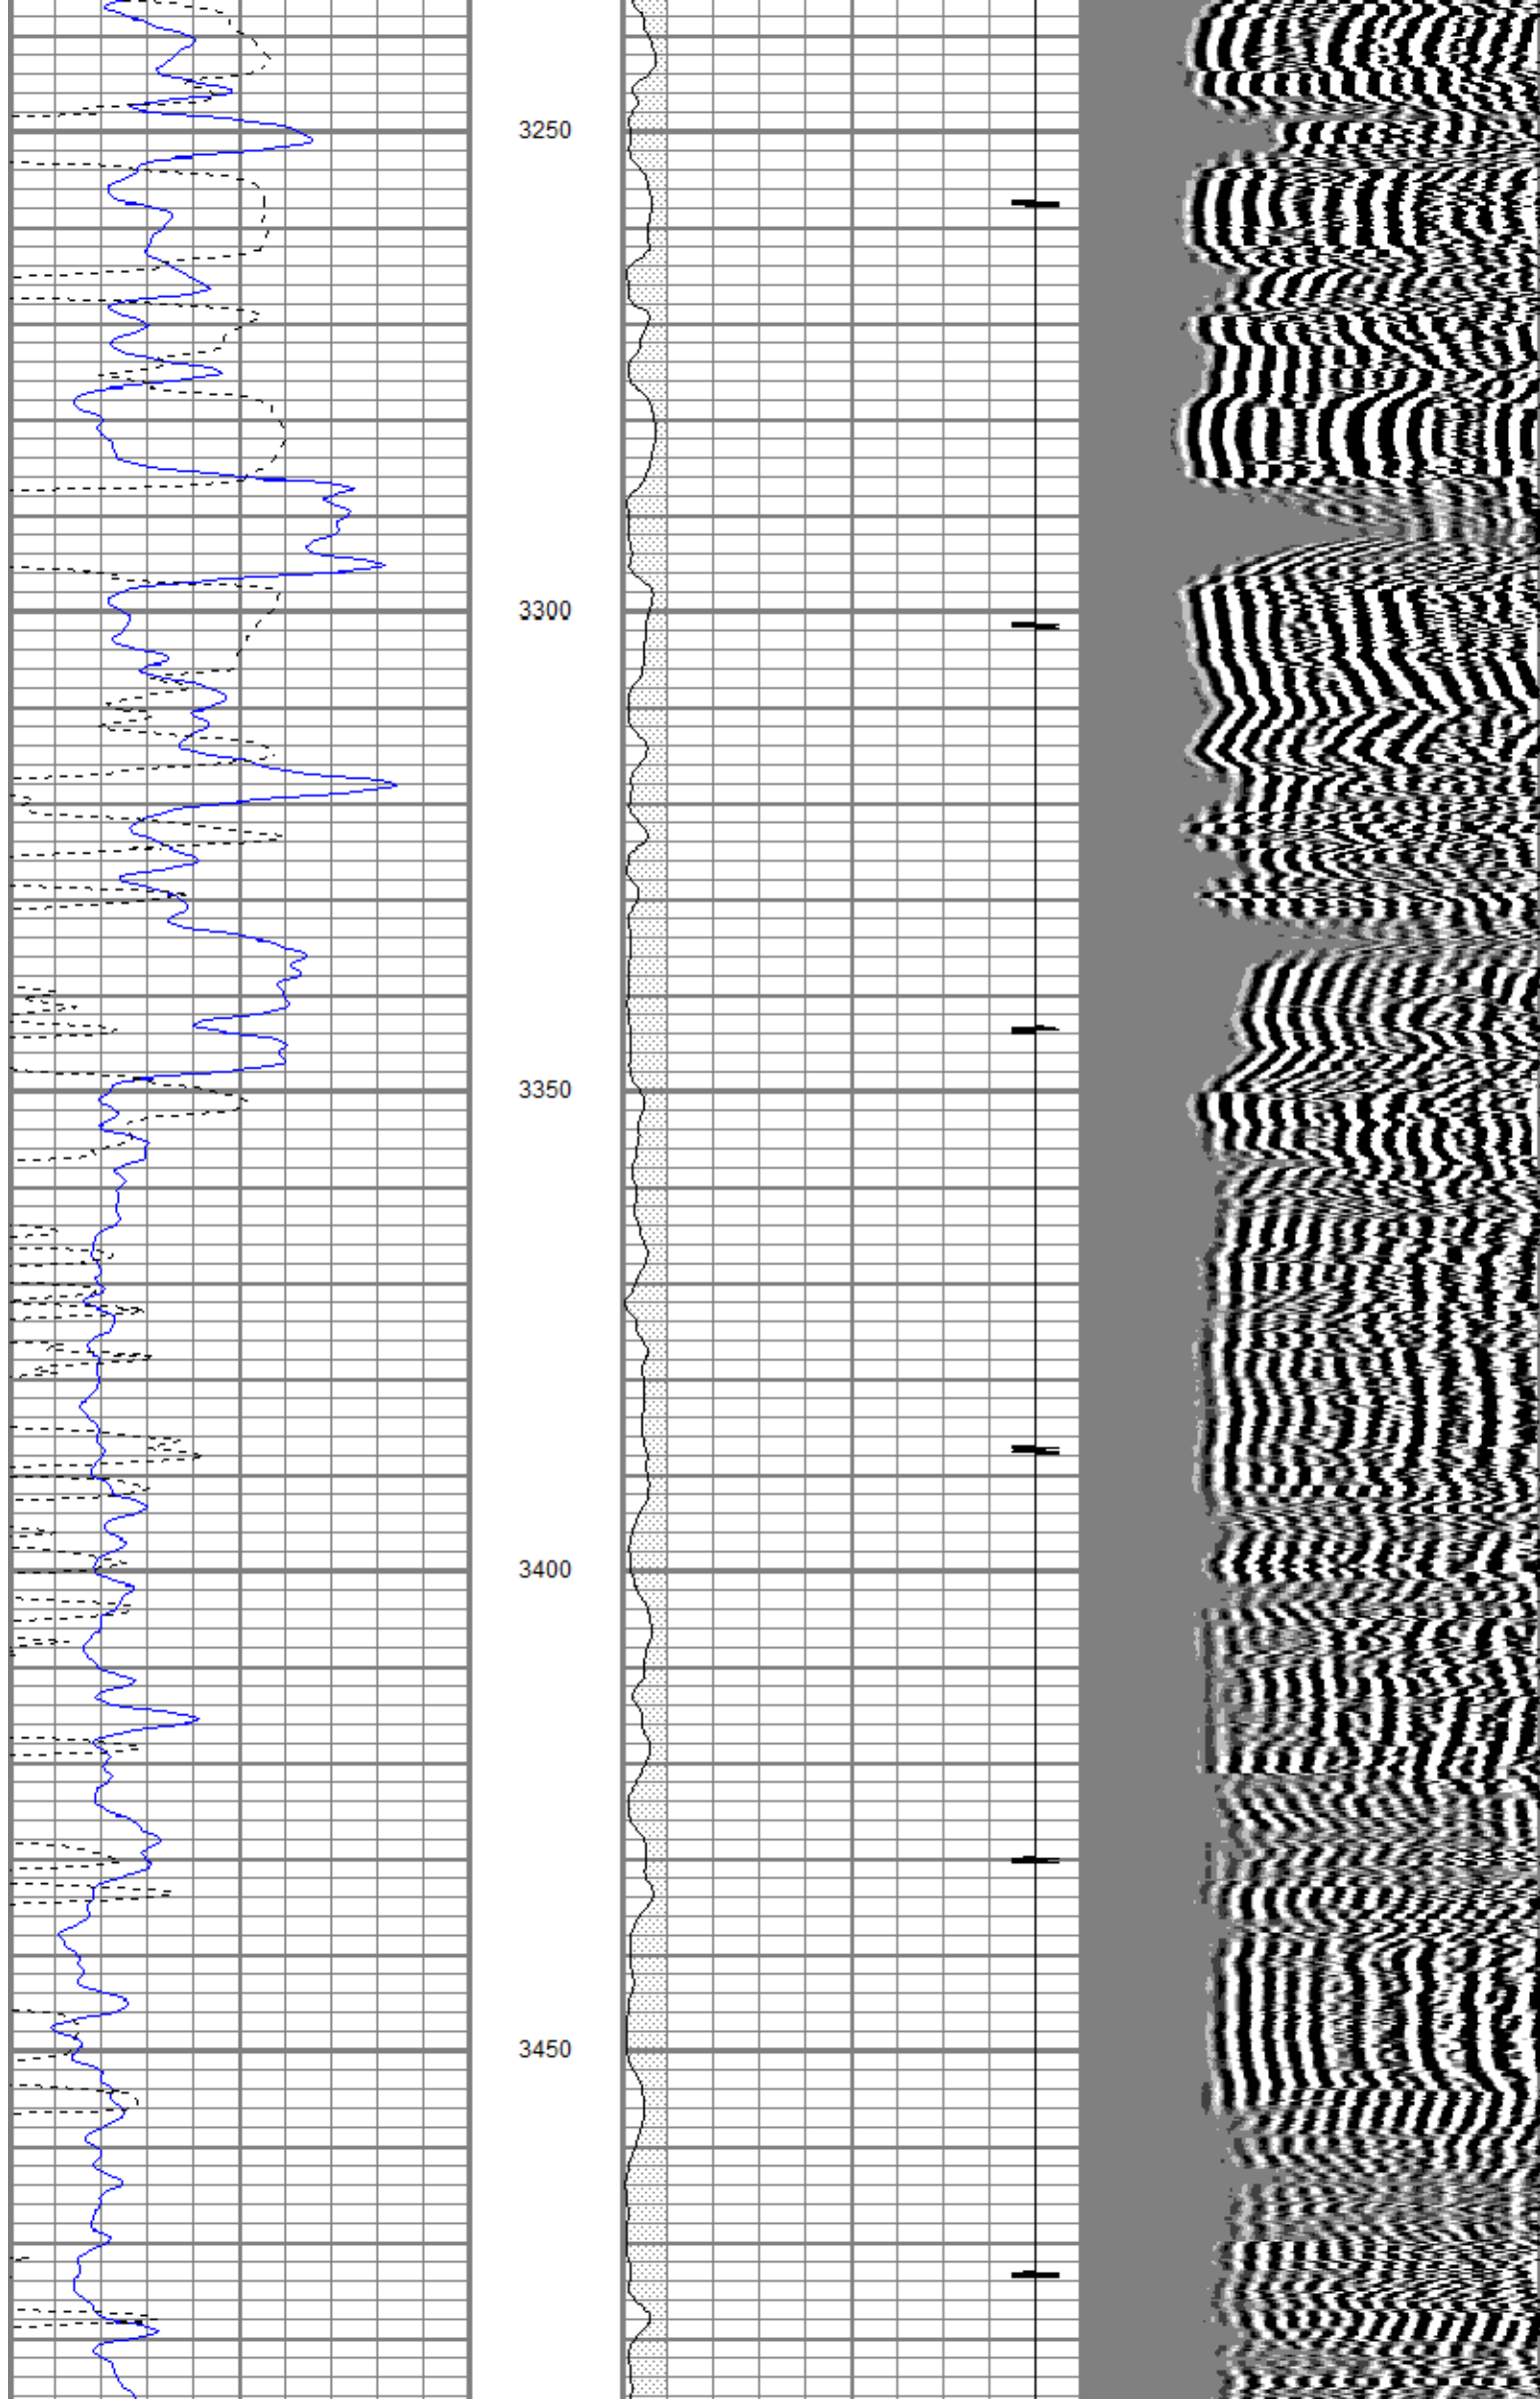


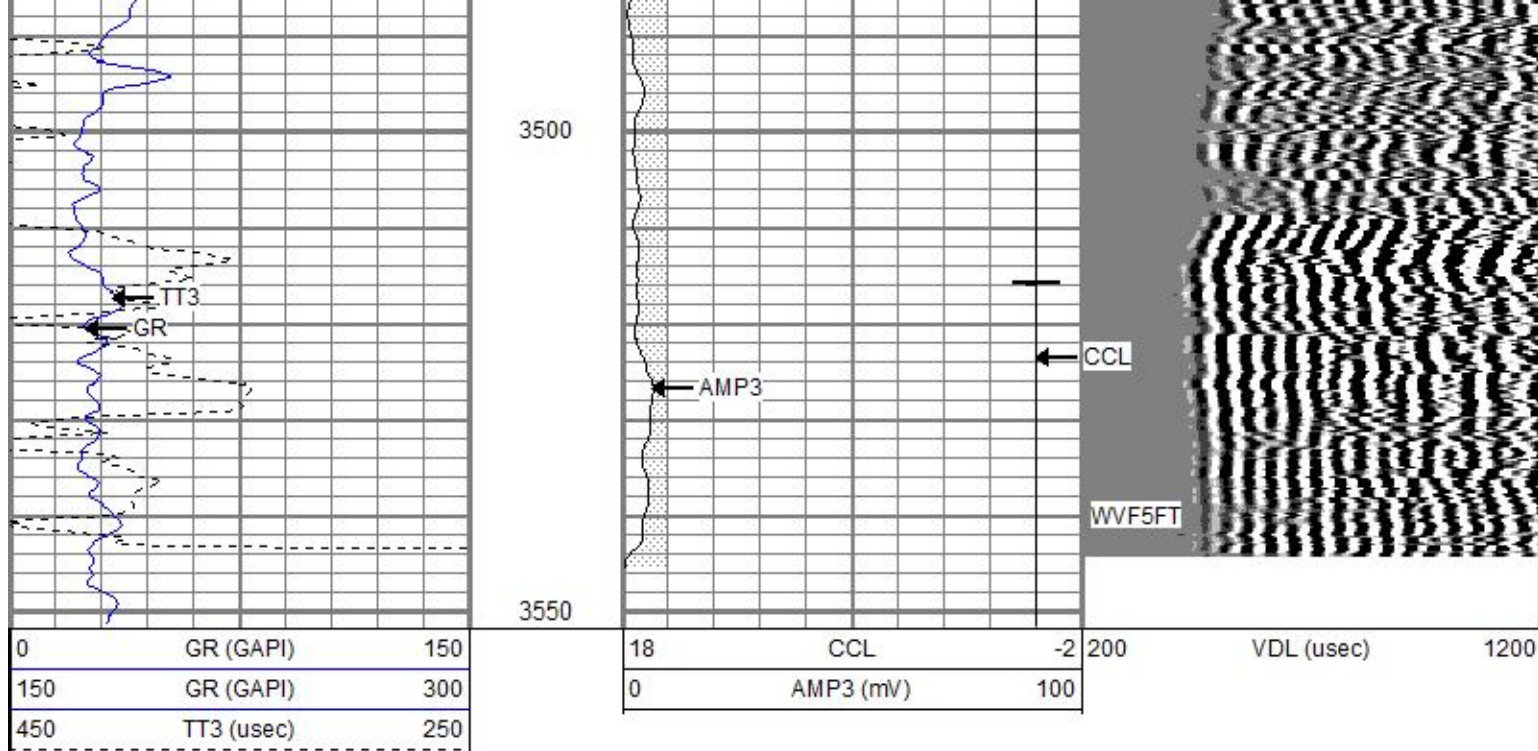

Repeat Pass

Database File h&dooonana#2cbl.db
 Dataset Pathname pass1
 Presentation Format cblsec
 Dataset Creation Mon Jul 09 13:37:21 2018
 Charted by Depth in Feet scaled 1:240

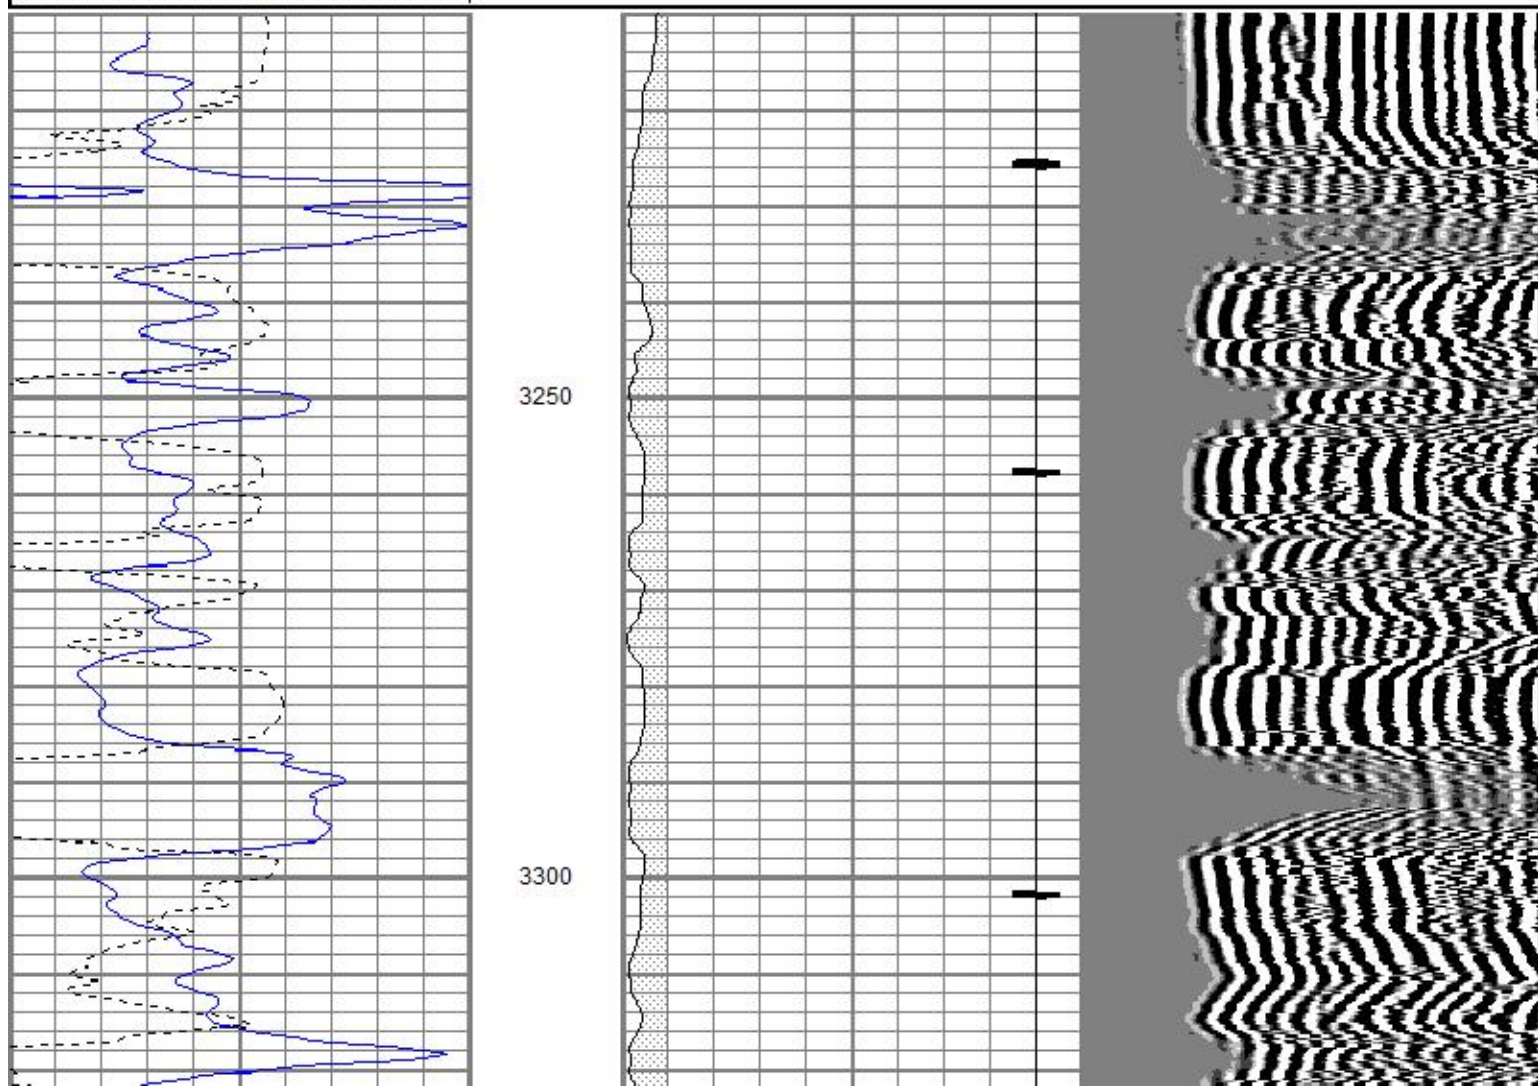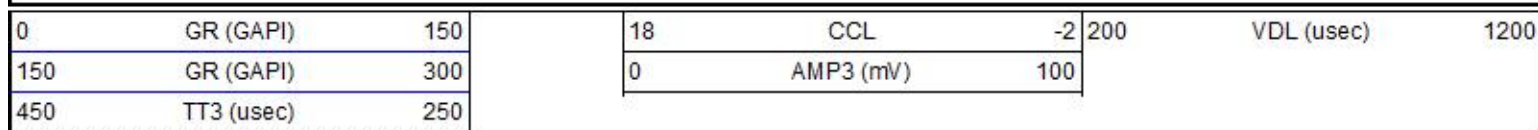

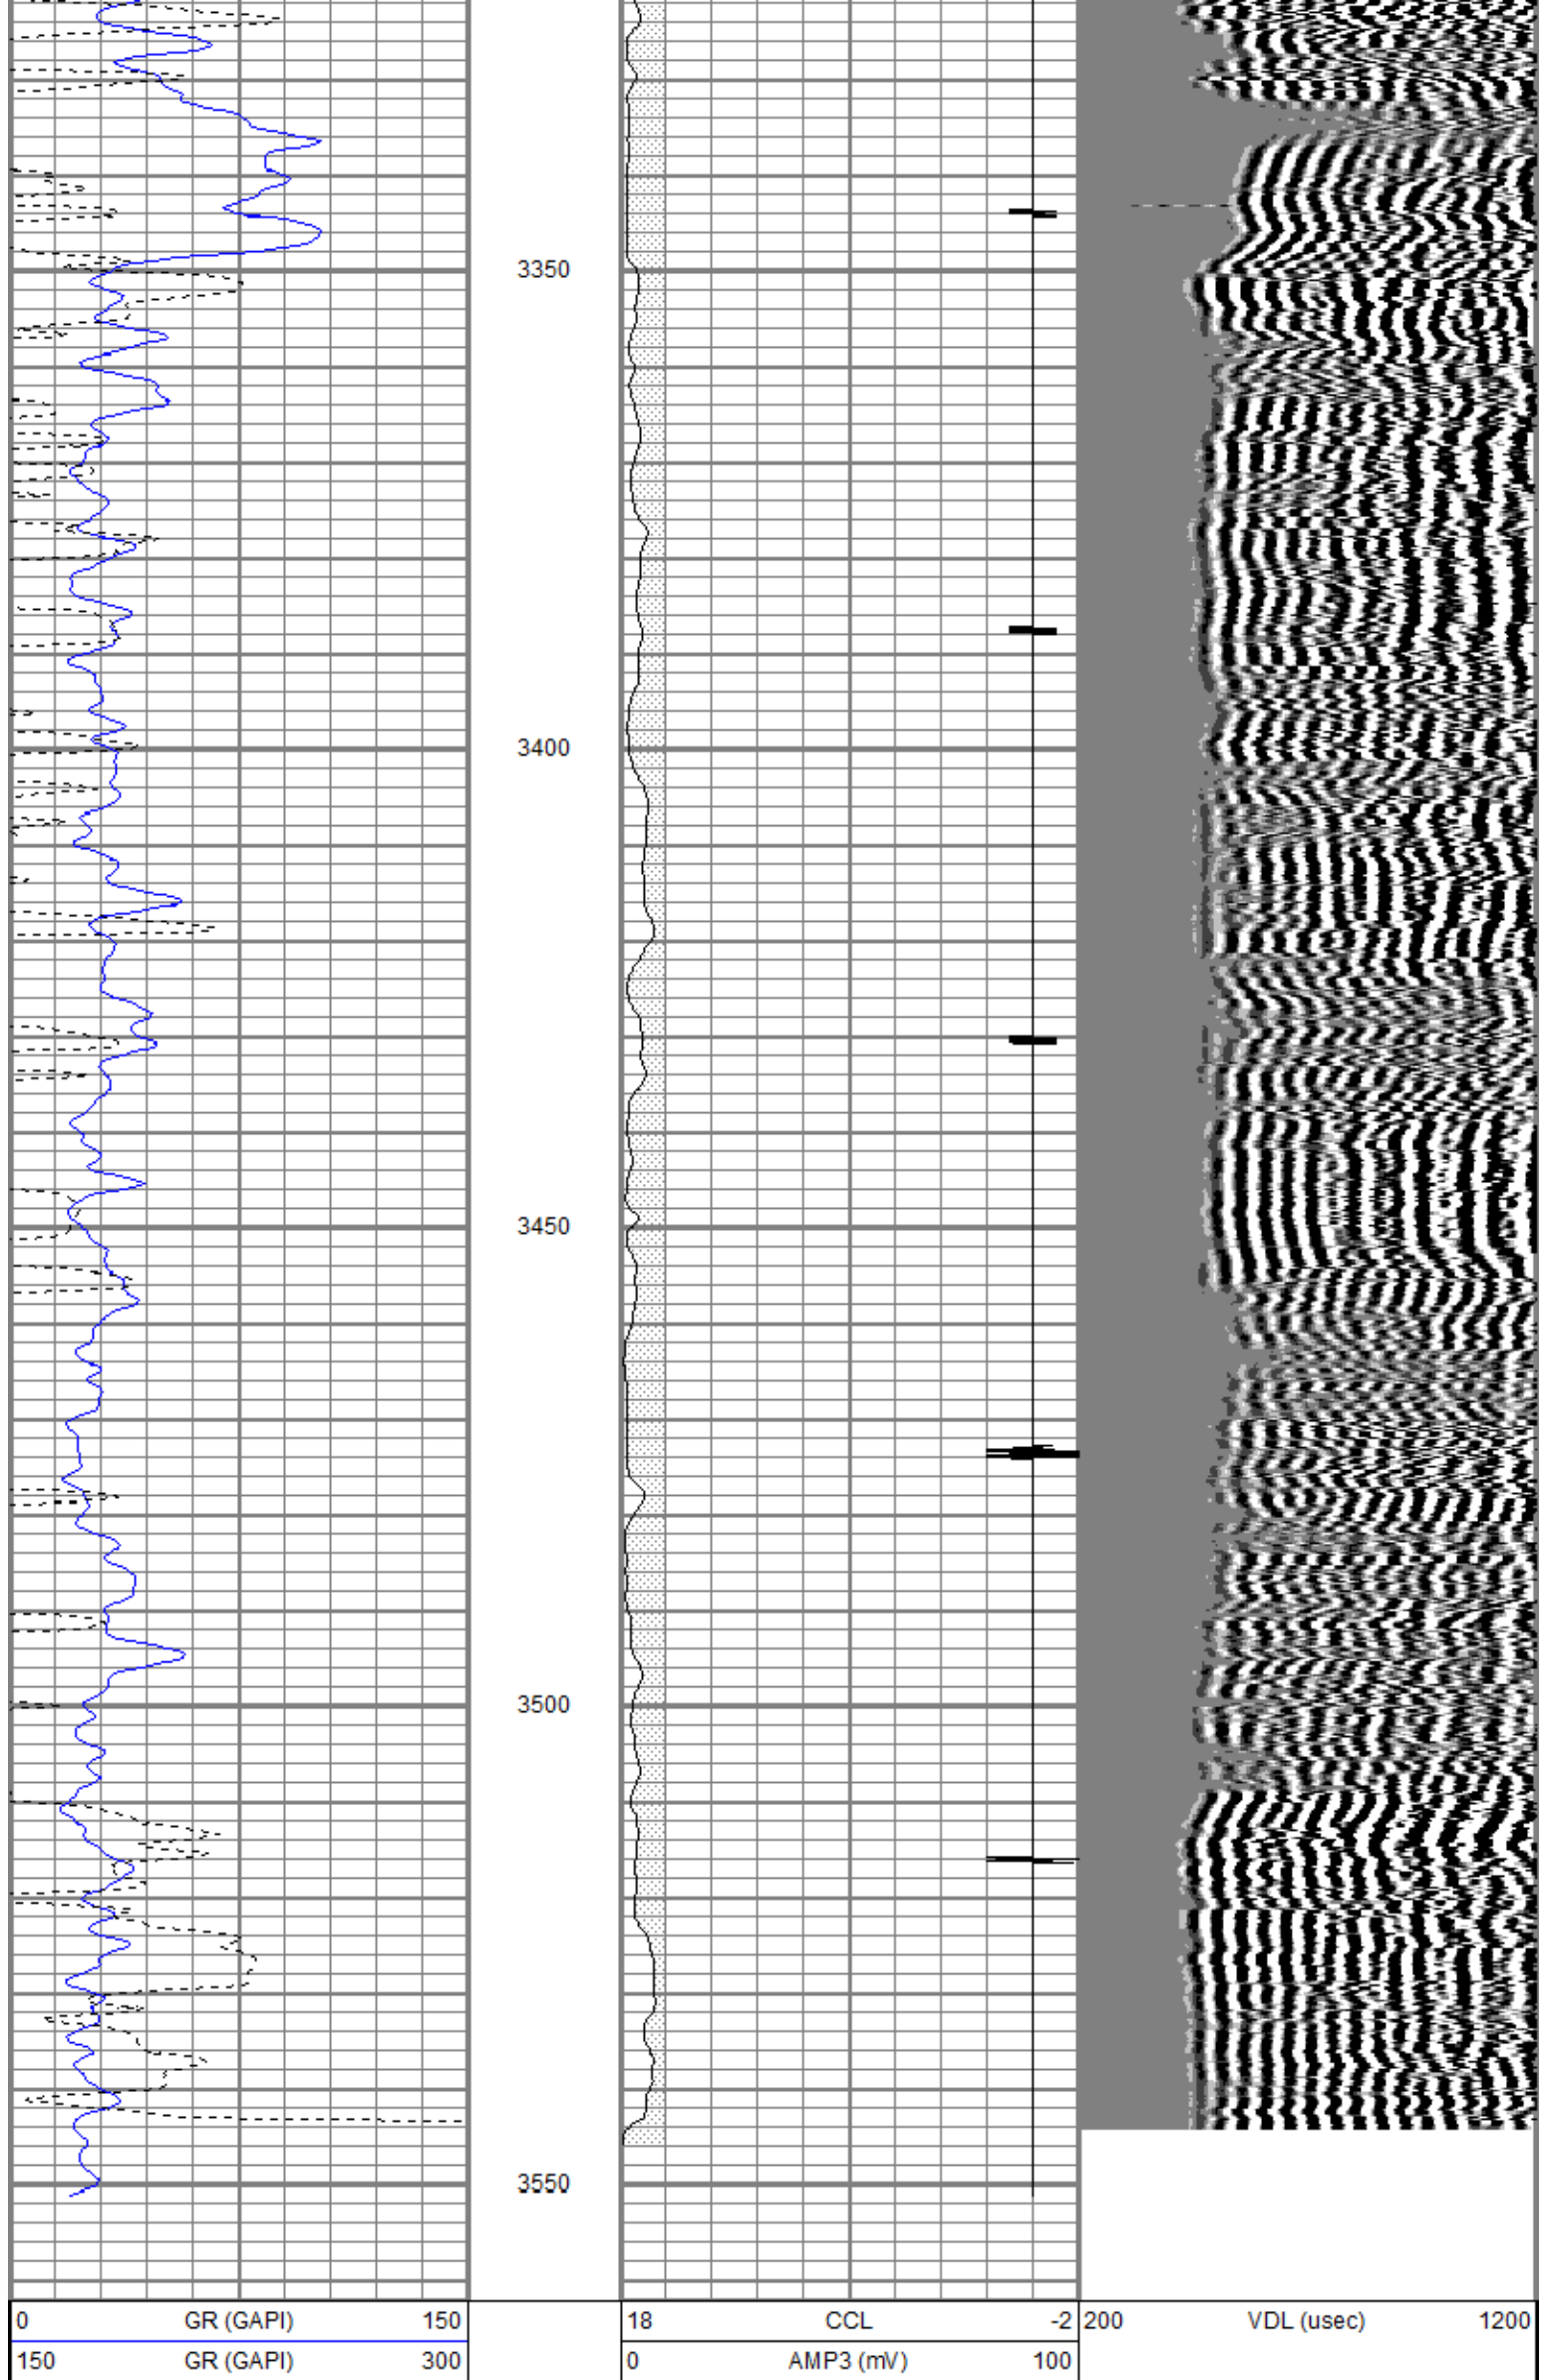



Calibration Report

Database File h&dmoonana#2cbl.db
 Dataset Pathname pass1
 Dataset Creation Mon Jul 09 13:37:21 2018

Gamma Ray Calibration Report

Serial Number: 080616
 Tool Model: 275D_INC
 Performed: Sat Apr 22 13:20:36 2017

Calibrator Value: 1.0 GAPI

Background Reading: 0.0 cps
 Calibrator Reading: 1.0 cps

Sensitivity: 1.6000 GAPI/cps

Inclinometer Calibration Report

Performed: Mon Feb 22 09:45:37 2016

	Low Read.	High Read.	Low Ref.	High Ref.	
X Accelerometer	-3560.40	3602.00	-1.00	1.00	gee
Y Accelerometer	-3645.40	3546.20	-1.00	1.00	gee
Z Accelerometer	6.60	3581.20	0.00	1.00	gee

Segmented Cement Bond Log Calibration Report

Serial Number: 080321
 Tool Model: Probe

Calibration Casing Diameter: 5.500 in
 Calibration Depth: 1820.406 ft

Master Calibration, performed Mon Jul 09 13:28:11 2018:

	Raw (v)		Calibrated (mv)		Results	
	Zero	Cal	Zero	Cal	Gain	Offset
3'	0.007	1.533	1.000	71.921	46.466	0.680
CAL	0.007	1.570				
5'	0.007	1.421	1.000	71.921	50.149	0.651
SUM						
S1	0.007	1.543	0.000	72.000	46.866	-0.332
S2	0.007	1.537	0.000	72.000	47.050	-0.323
S3	0.007	1.545	0.000	72.000	46.810	-0.323
S4	0.007	1.531	0.000	72.000	47.247	-0.335
S5	0.007	1.539	0.000	72.000	46.987	-0.319
S6	0.007	1.550	0.000	72.000	46.671	-0.324
S7	0.007	1.545	0.000	72.000	46.808	-0.329
S8	0.007	1.541	0.000	72.000	46.937	-0.331

Internal Reference Calibration, performed Thu Dec 04 16:30:55 2008:

	Raw (v)		Calibrated (v)		Results	
	Zero	Cal	Zero	Cal	Gain	Offset
CAL	0.000	0.000	0.007	1.570	1.000	0.000

Air Zero Calibration, performed Mon Jan 11 14:07:53 2016:

