

MICRO LOG

Company	DIXON OPERATING, COMPANY, LLC.		
Well	SISLER #1-34		
Field	MIKES METEOR		
County	STAFFORD	State	KANSAS
Location:	API #: 15-185-24009-0000		Other Services CDL/CNL/PE DIL
4680' FSL & 750' FEL			
SEC 34 TWP 22S RGE 12W			
Permanent Datum	GROUND LEVEL	Elevation	1832
Log Measured From	KELLY BUSHING 11' A.G.L	D.F.	1841
Drilling Measured From	KELLY BUSHING	G.L.	1832


Date	3/2/18	
Run Number	TWO	
Depth Driller	3800	
Depth Logger	3800	
Bottom Logged Interval	3798	
Top Log Interval	2800	
Casing Driller	8 5/8" @ 308	
Casing Logger	306	
Bit Size	7 7/8	
Type Fluid in Hole	CHEMICAL MUD	CHLORIDES 8500 PPM
Density / Viscosity	9.4/69	
pH / Fluid Loss	10.5/9.6	
Source of Sample	FLOWLINE	
Rm @ Meas. Temp	.65 @ 75F	
Rmf @ Meas. Temp	.48 @ 75F	
Rmc @ Meas. Temp	.78 @ 75F	
Source of Rmf / Rmc	MEASUREMENT	
Rm @ BHT	.42 @ 114F	
Time Circulation Stopped	2 HOURS	
Time Logger on Bottom		
Maximum Recorded Temperature	114F	
Equipment Number	3802	
Location	HAYS, KANSAS	
Recorded By	JASON CAPPELLUCCI	
Witnessed By	CHUCK SCHMALTZ	

>>> Fold Here >>>

All interpretations are opinions based on inferences from electrical or other measurements and we cannot and do not guarantee the accuracy or correctness of any interpretation, and we shall not, except in the case of gross or willful negligence on our part, be liable or responsible for any loss, costs, damages, or expenses incurred or sustained by anyone resulting from any interpretation made by any of our officers, agents or employees. These interpretations are also subject to our general terms and conditions set out in our current Price Schedule.

Comments


THANK YOU FOR USING ELI WIRELINE SERVICES, HAYS, KS. (785) 628-6395
DIRECTIONS
HUDSON, KS. - 2 EAST - 1/8 MILE SOUTH - WEST INTO


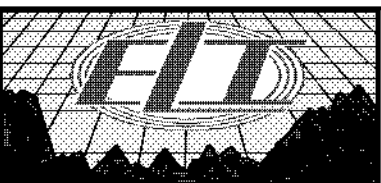



MAIN SECTION



Database File	2367pe8.db
Dataset Pathname	pass6
Presentation Format	_micro
Dataset Creation	Fri Mar 02 16:49:10 2018
Charted by	Depth in Feet scaled 1:240


0	GAMMA RAY (GAPI)	150	ABHV	0	MEL1.5 (Ohm-m)	40
6	CALIPER (in)	16	(ft3)	0	MEL2.0 (Ohm-m)	40
			10	0		
			TBHV			
			(ft3)			
			0	10		

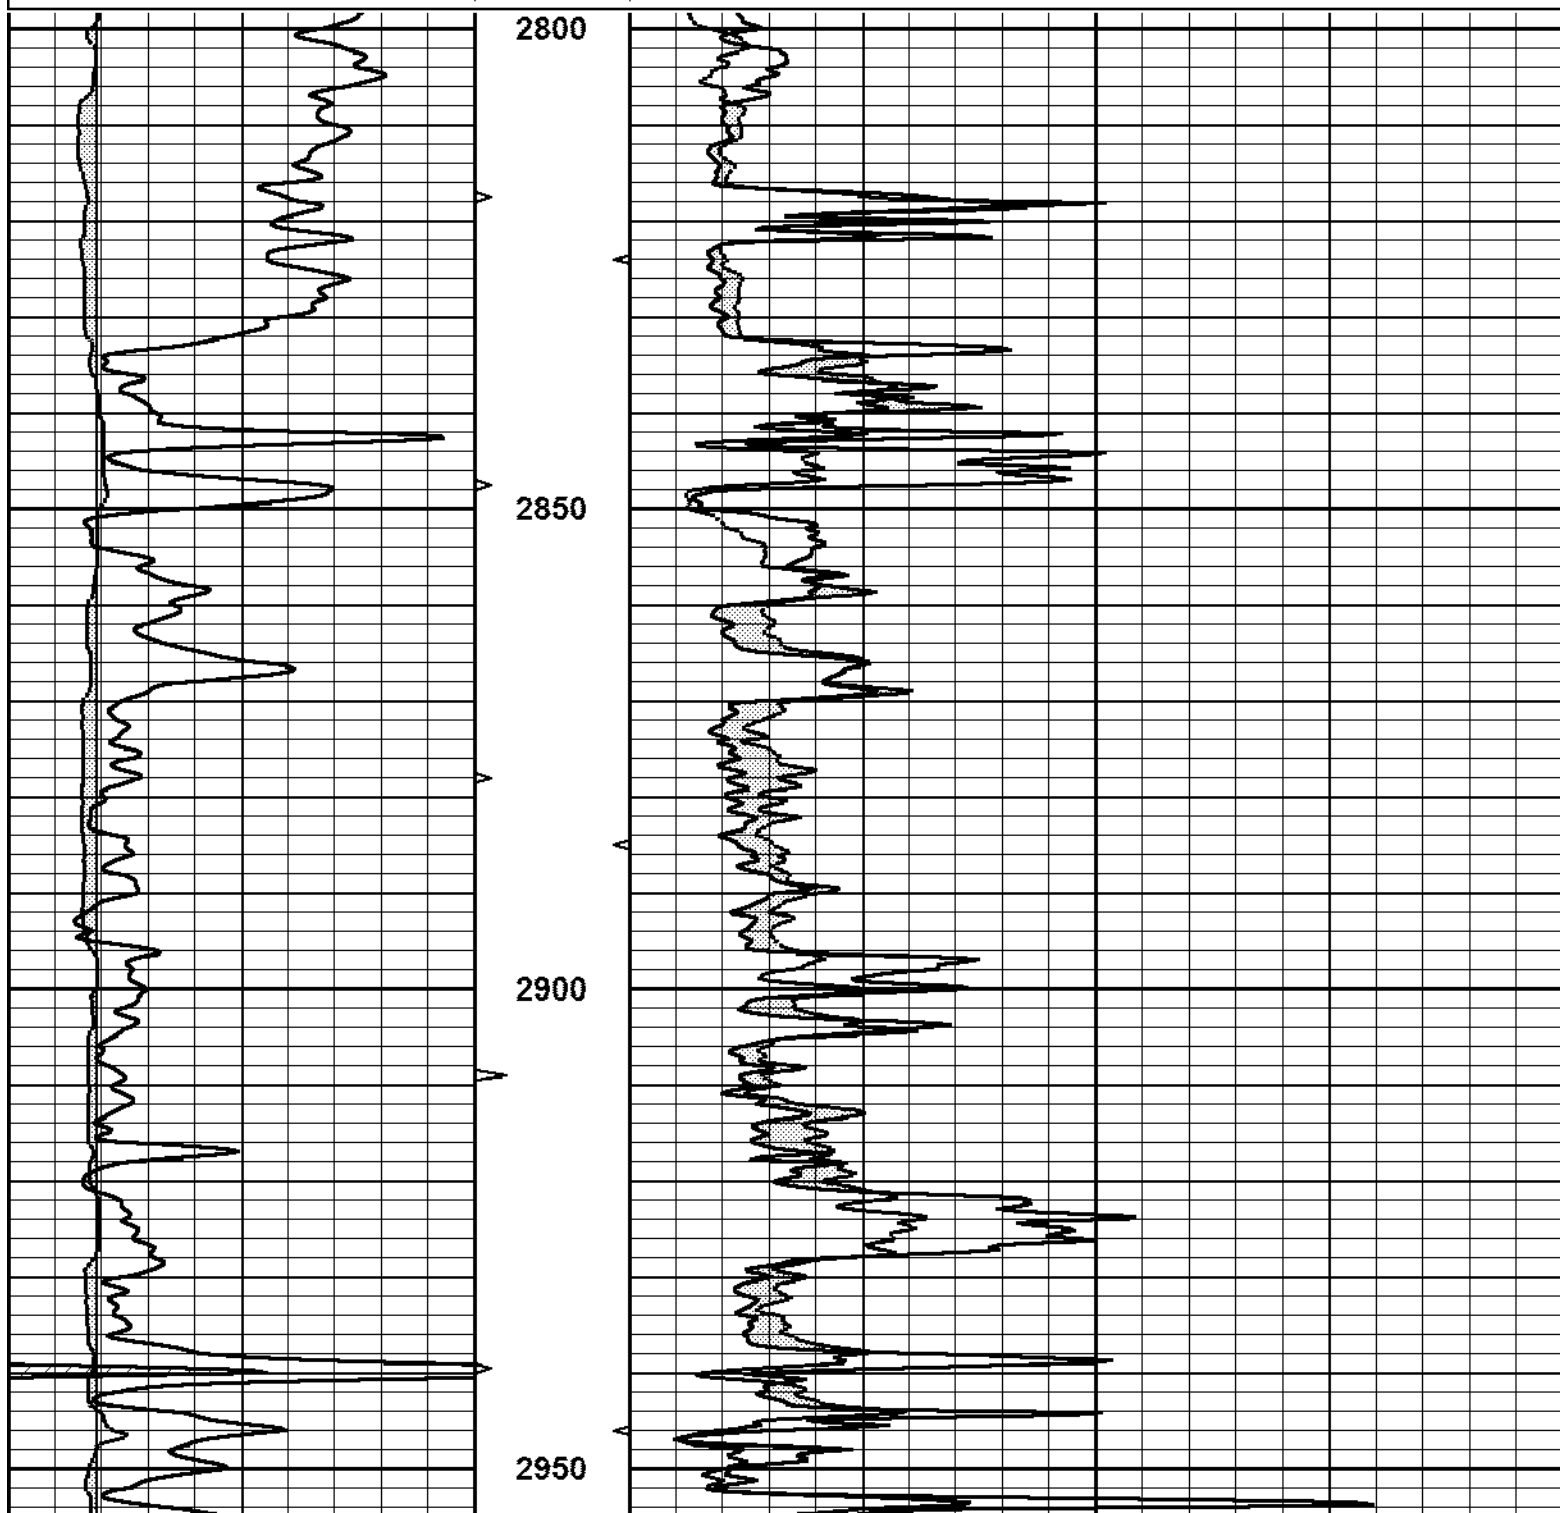

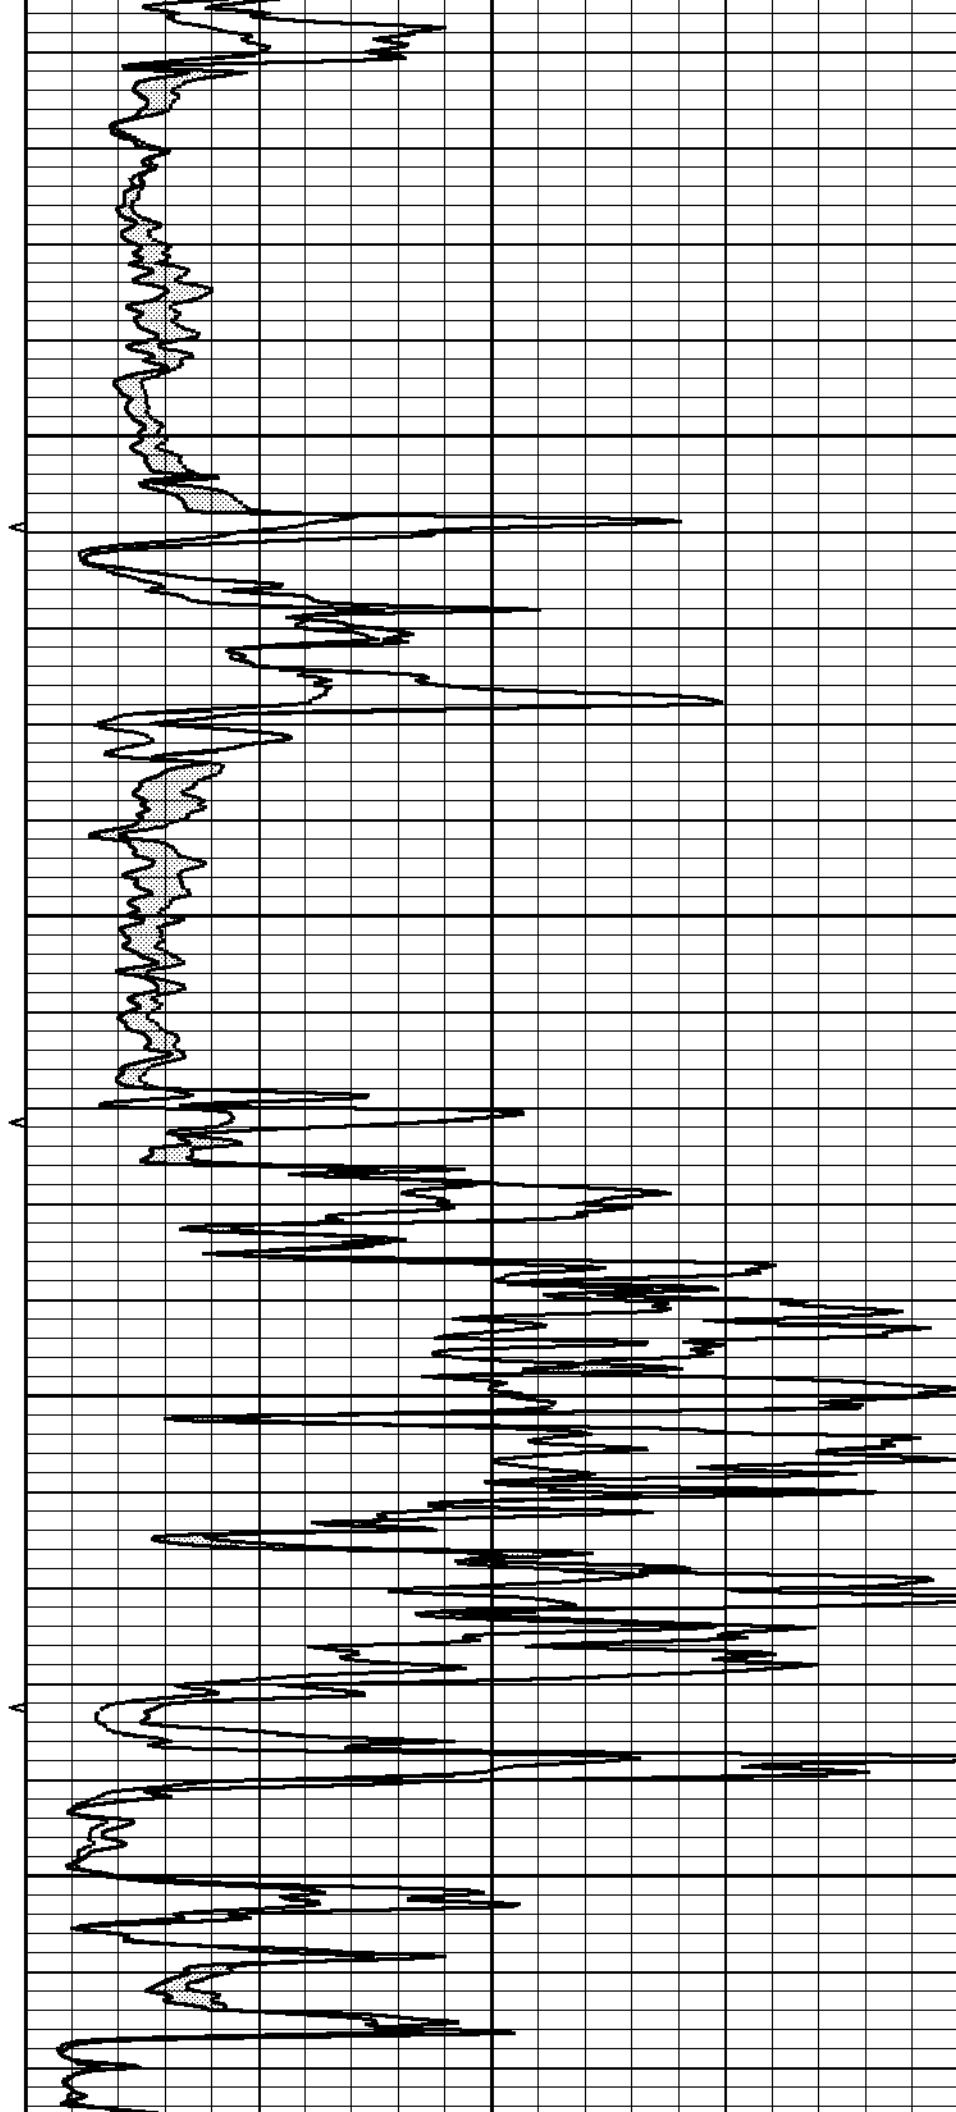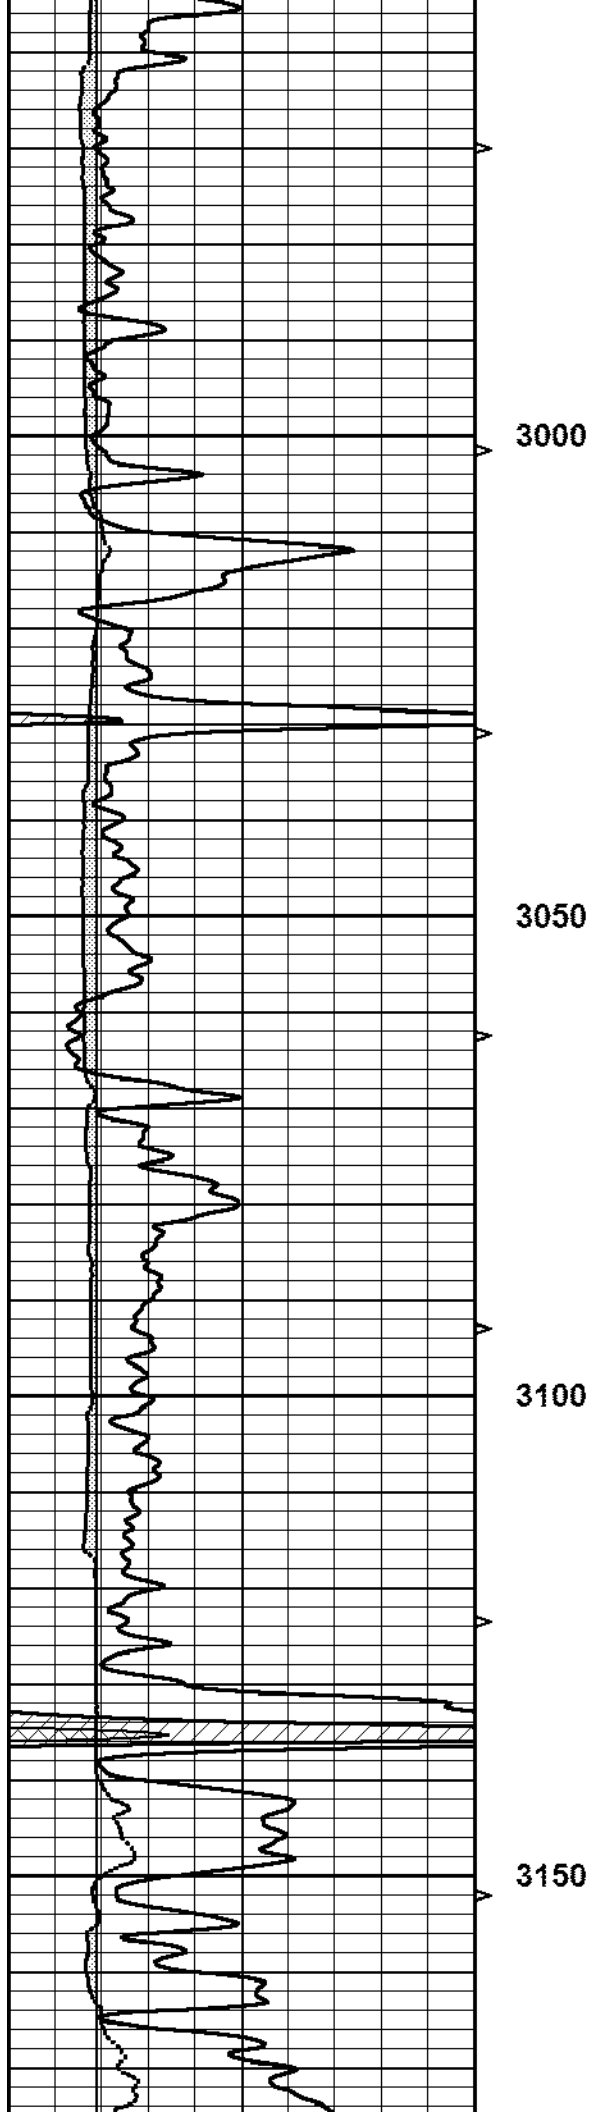


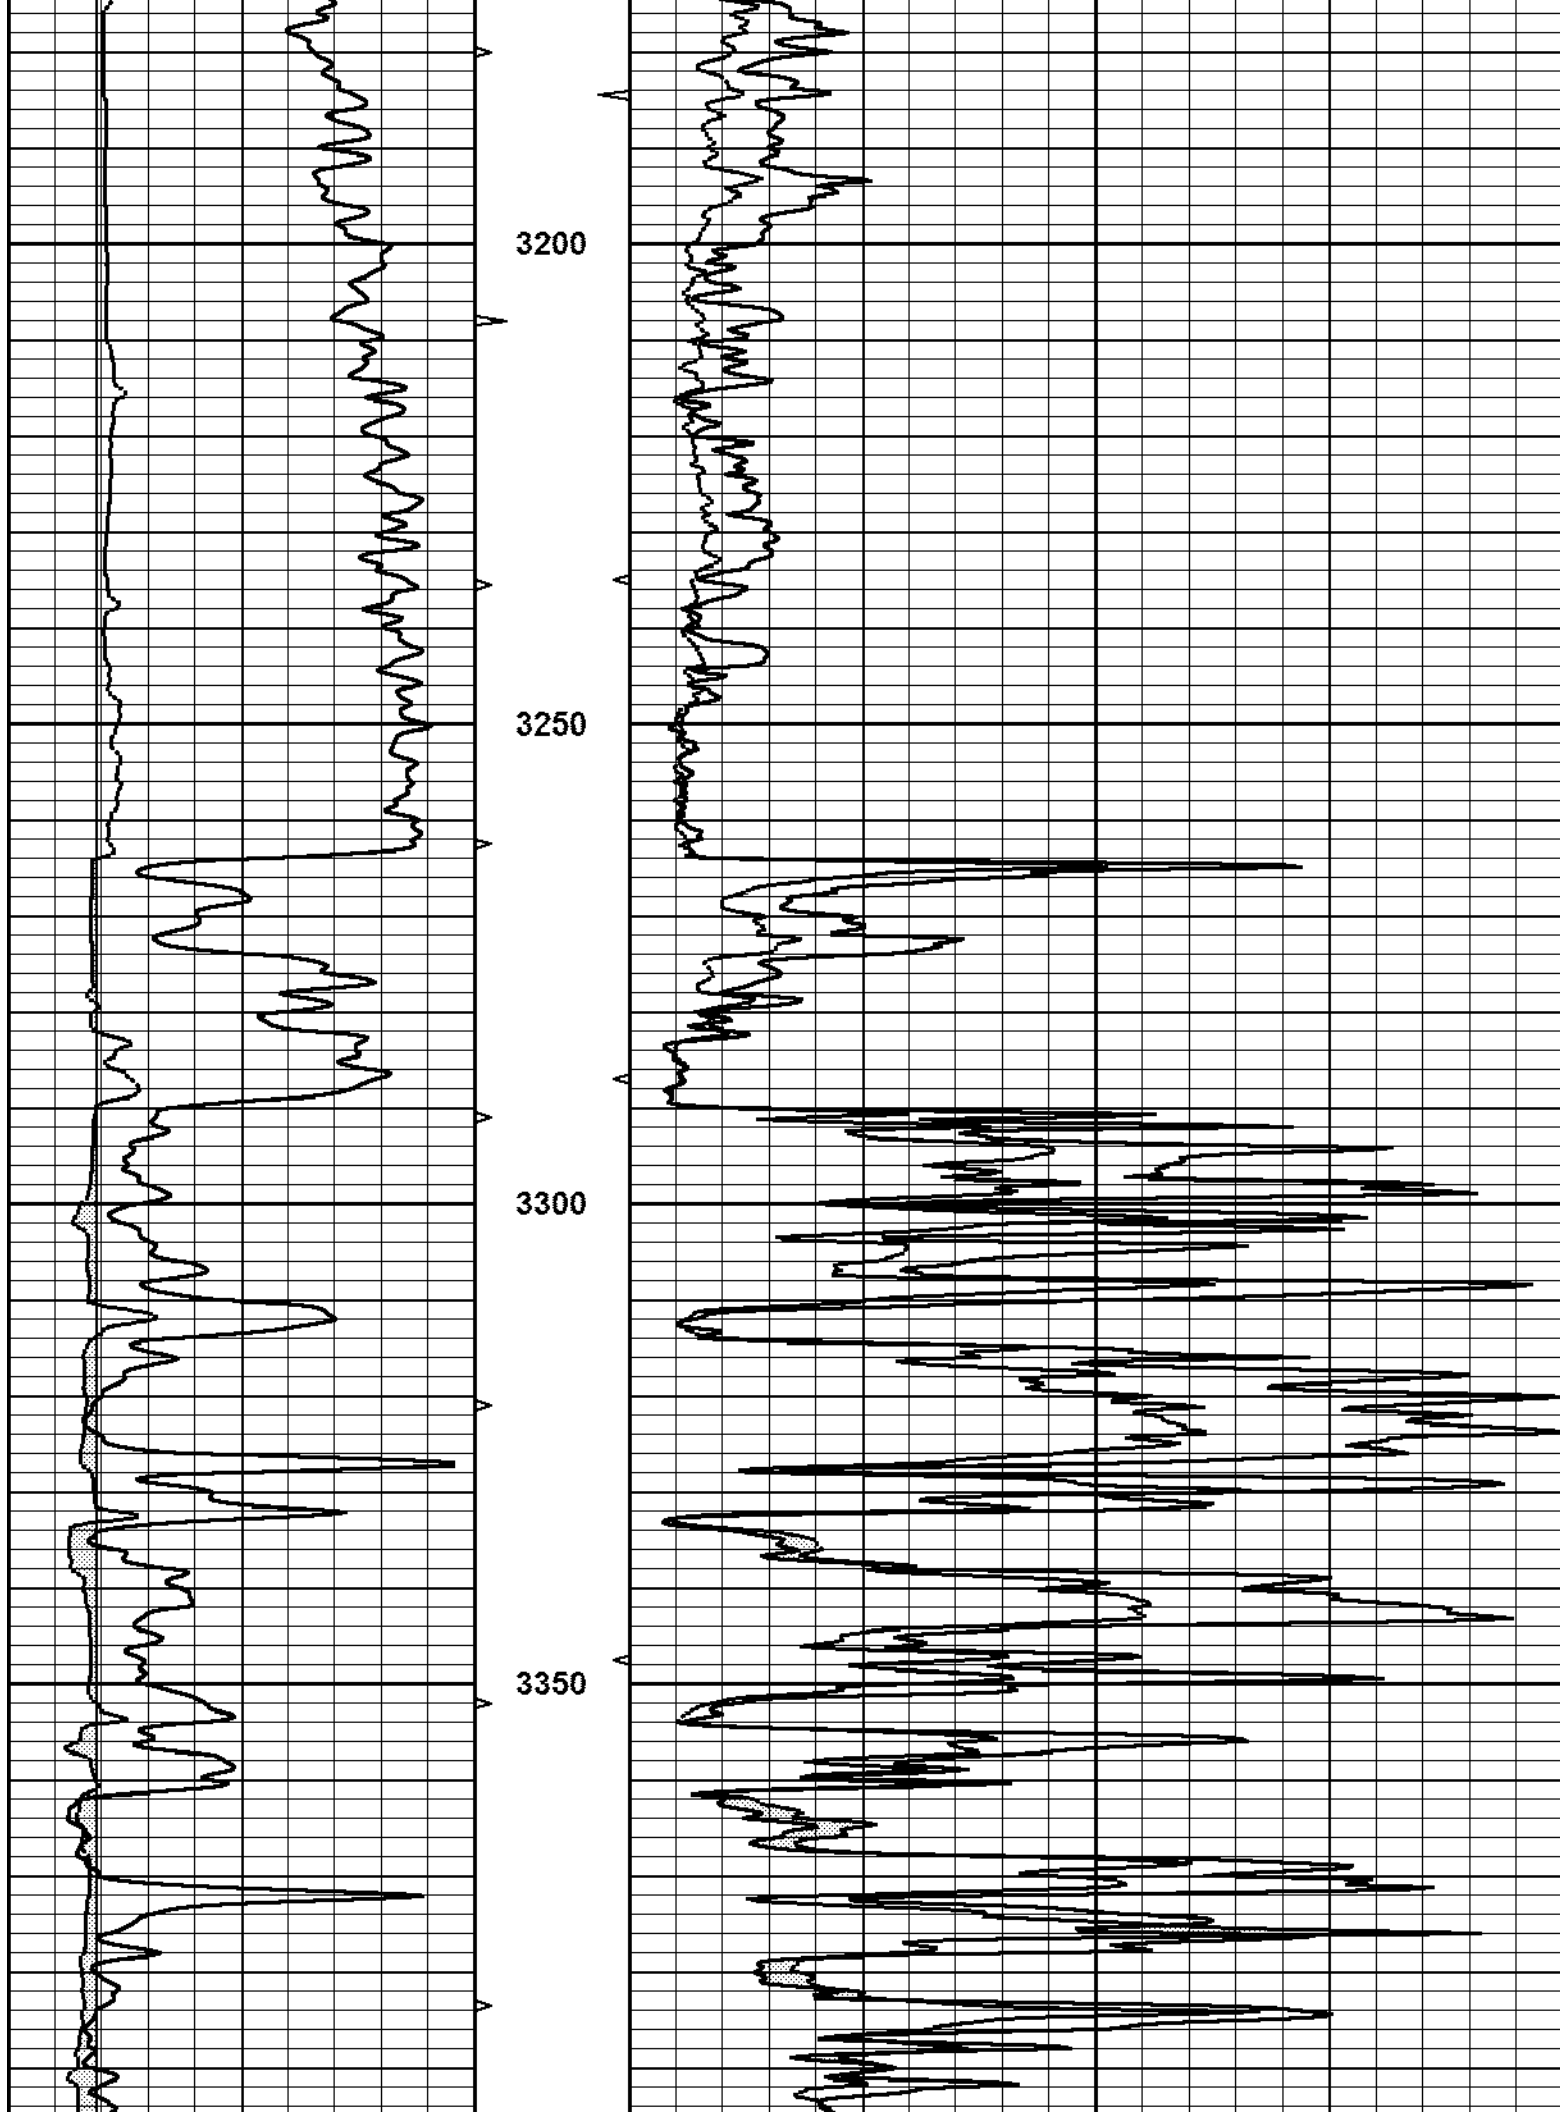

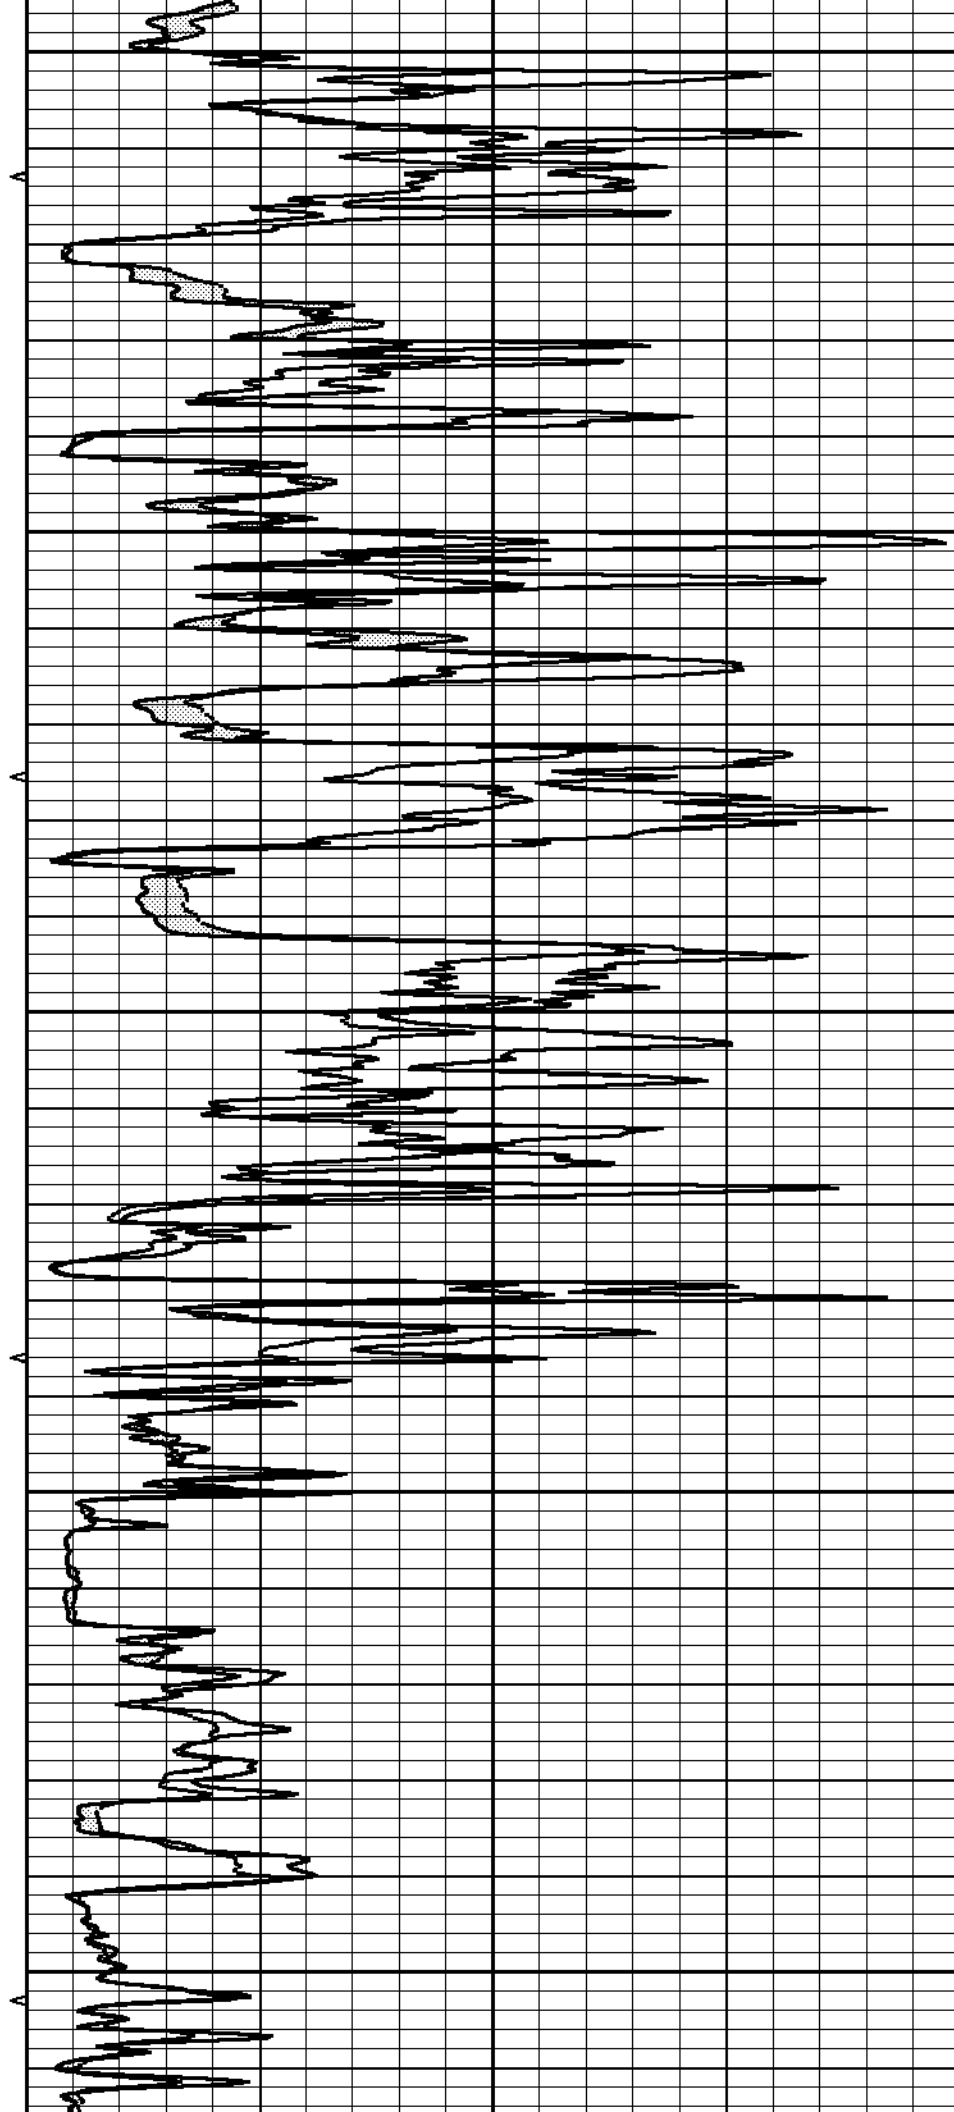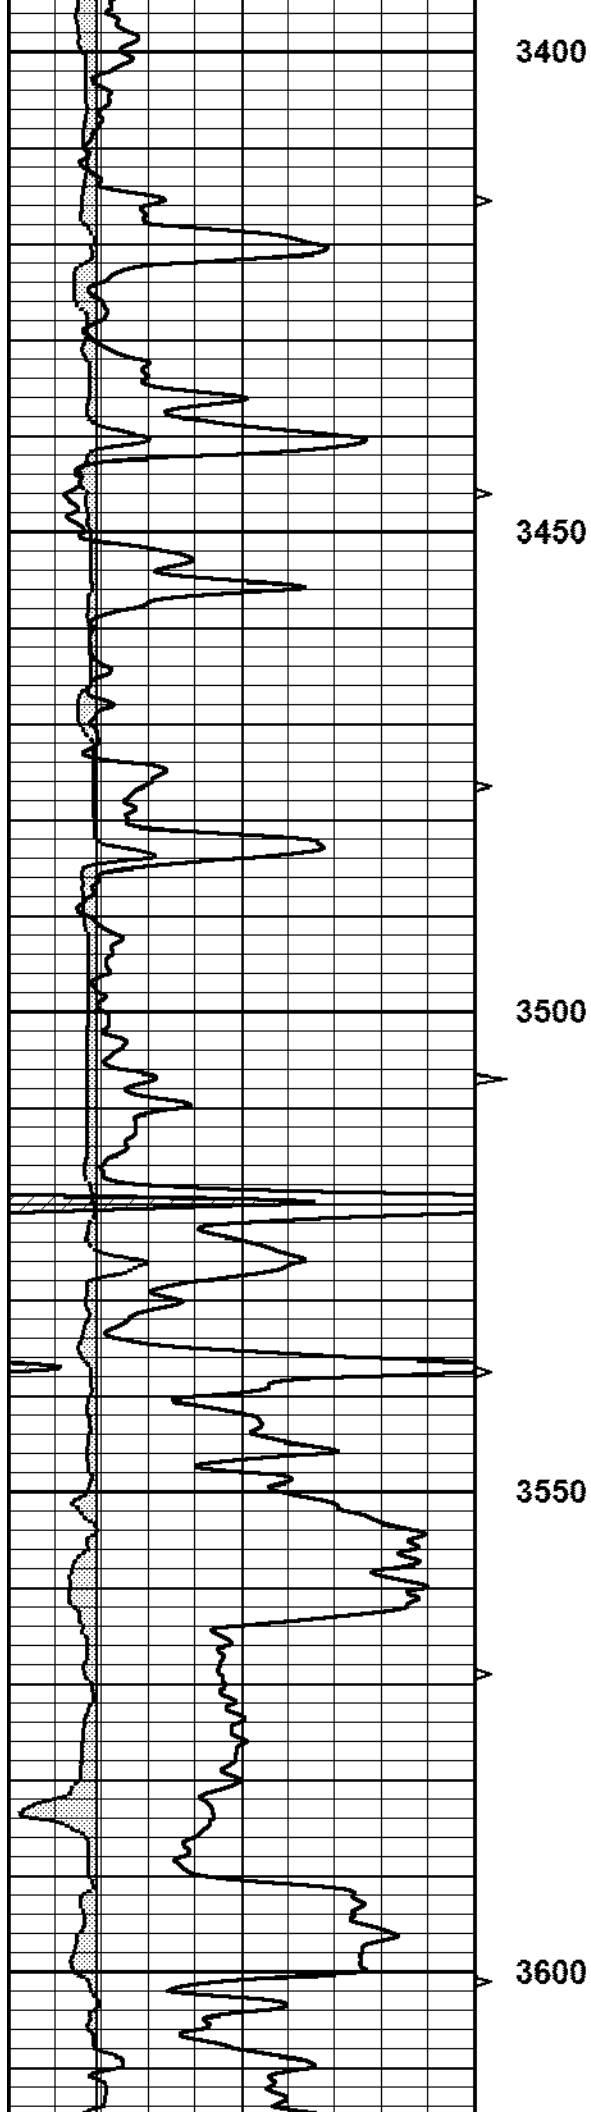

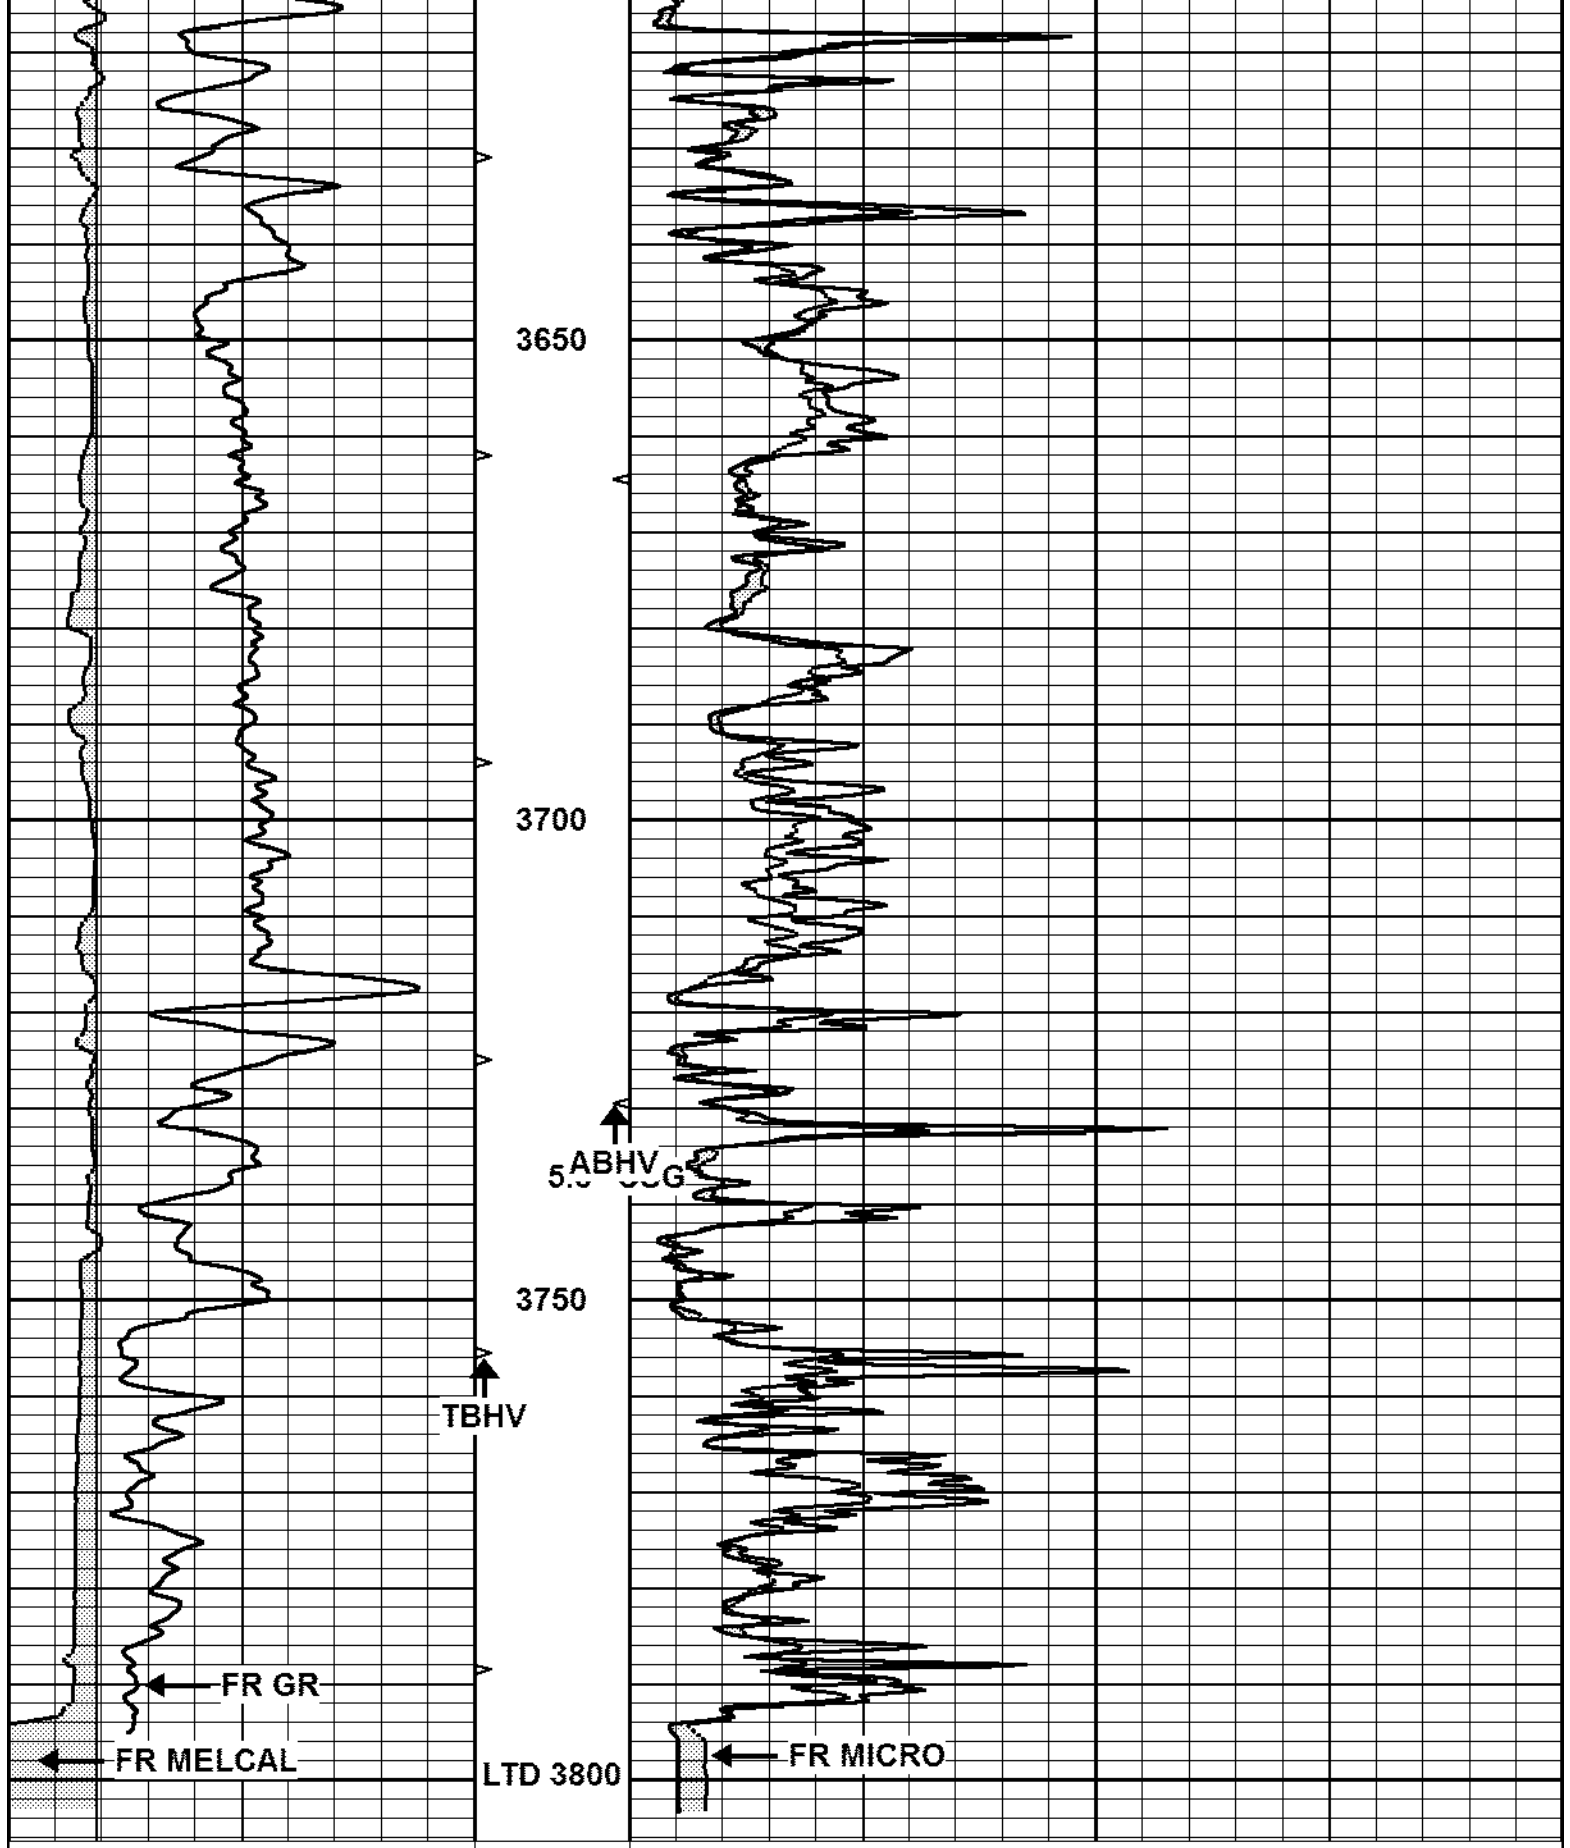


0	GAMMA RAY (GAPI)	150	ABHV	0	MEL1.5 (Ohm-m)	40
6	CALIPER (in)	16	(ft3)	0	MEL2.0 (Ohm-m)	40
			10	0		
			TBHV			
			(ft3)			

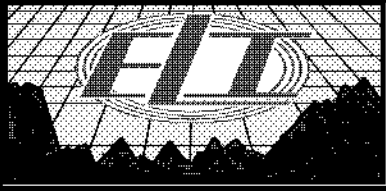


REPEAT SECTION

Database File 2367pe8.db
 Dataset Pathname pass5
 Presentation Format _micro
 Dataset Creation Fri Mar 02 16:40:00 2018
 Charted by Depth in Feet scaled 1:240

0	GAMMA RAY (GAPI)	150	ABHV	0	MEL1.5 (Ohm-m)	40
6	CALIPER (in)	16	(ft3)	0	MEL2.0 (Ohm-m)	40
			10 0			
			TBHV			
			(ft3)			
			0 10			

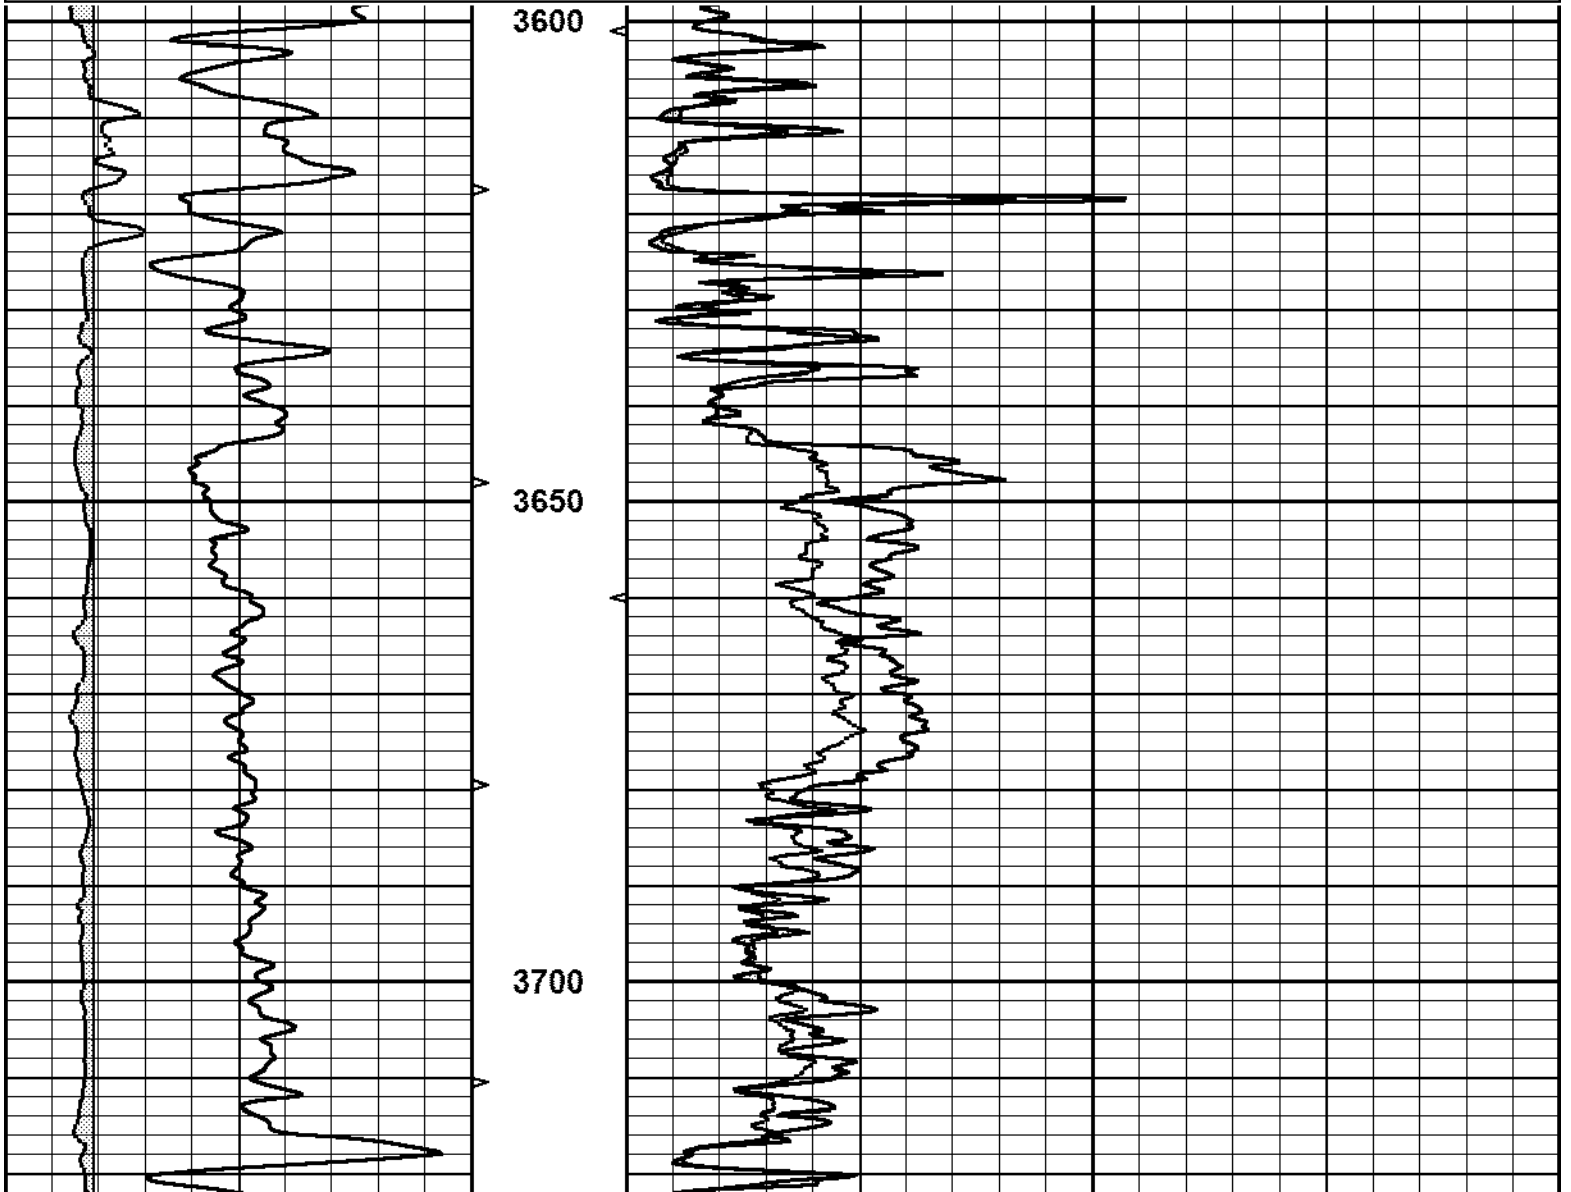

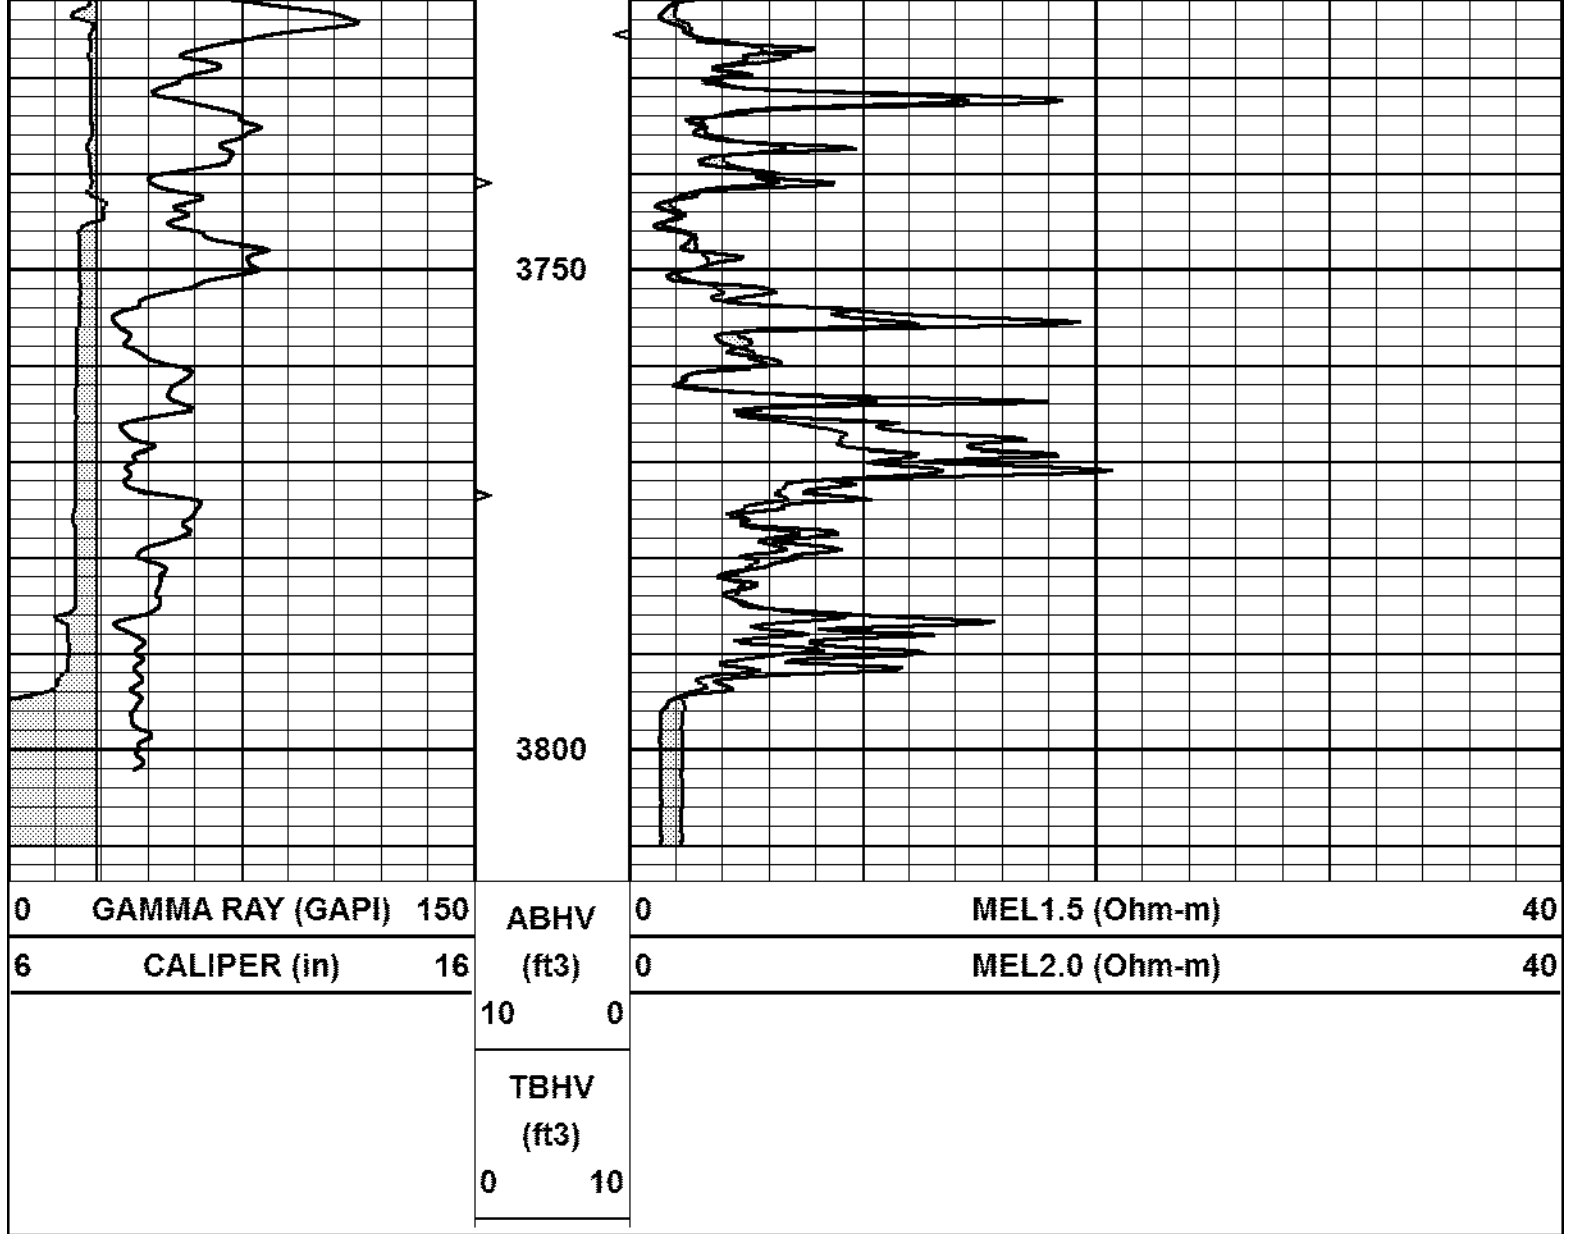

Calibration Report			
Database File	2367pe8.db		
Dataset Pathname	pass4		
Dataset Creation	Fri Mar 02 16:24:01 2018		
MICRO_USR Calibration Report			
Serial Number:	070910		
Tool Model:	ProbeL		
Performed:	Sat Feb 17 01:51:36 2018		
Caliper Calibration:	Gain=7.336	Offset=2.817	
References	Low Cal	High Cal	
Readings	8.000	14.000	
	0.652	1.470	
1.5" Calibration:	Gain=25.000	Offset=-0.067	
References	Low Cal	High Cal	
Readings	0.000	20.000	
	0.004	1.335	
2" Calibration:	Gain=35.000	Offset=-0.079	

References	Low Cal	High Cal
Readings	0.000	20.000
	0.004	1.029

Microlog Calibration Report								
Serial-Model: Performed:			070910-ProbeL (Not Performed)					
Readings			References				Results	
	Zero	Cal		Zero	Cal		m	b
Normal	0.0000	1.0000	V	0.0000	1.0000	Ohm-m	1.0000	0.0000
Inverse	0.0000	1.0000	V	0.0000	1.0000	Ohm-m	1.0000	0.0000
Caliper	0.0000	1.0000	V	0.0000	1.0000	in	1.0000	0.0000

Gamma Ray Calibration Report								
Serial Number:	7							
Tool Model:	Probe1							
Performed:	Wed Jun 29 11:10:58 2016							
Calibrator Value:	1.0		GAPI					
Background Reading:	0.0		cps					
Calibrator Reading:	1.0		cps					
Sensitivity:	0.2700		GAPI/cps					