



MIDWEST SURVEYS
LOGGING - PERFORATING - CONSULTING SERVICES
P.O. Box 68, Oswatimie, KS 66064
913 / 755 - 2128

GAMMA RAY / NEUTRON / CCL

File No.

Company Bobcat Oilfield Services, Inc.
Well Stainbrook No. 10W-14
Field LaCygne - Cadmus
County Linn State Kansas

Location

3646 FSL & 4646' FEL
NE-SW-SW-NW

Sec. 9 Twp. 20s Rge. 23e

Permanent Datum GL Elevation NA
Log Measured From GL
Drilling Measured From GL

Other Services
Perforate

Elevation
K.B. NA
D.F. NA
G.L. NA

API # 15-107-25,018

Date

05-20-2014

Run Number

One

Depth Driller

350.0

Depth Logger

346.0

Bottom Logged Interval

345.0

Top Log Interval

20.0

Fluid Level

Full

Type Fluid

Water

Density / Viscosity

NA

Salinity - PPM Cl

NA

Max Recorded Temp

NA

Estimated Cement Top

0.0

Equipment No.

102

Recorded By

Gary Windisch

Witnessed By

Bob Eberhart

BORE-HOLE RECORD

CASING RECORD

Run

No.

BIT

FROM

TO

One

8.75"

0.0

SIZE

6.00"

WG.T.

15.0 #

FROM

0.0

TO

20.0

Two

5.625"

20.0

350.0

2.875"

6.5 #

0.0

347.0

<<< Fold Here >>>

All interpretations are opinions based on inferences from electrical or other measurements and we cannot and do not guarantee the accuracy or correctness of any interpretation, and we shall not, except in the case of gross or willful negligence on our part, be liable or responsible for any loss, costs, damages, or expenses incurred or sustained by anyone resulting from any interpretation made by any of our officers, agents or employees. These interpretations are also subject to our general terms and conditions set out in our current Price Schedule.

Comments

Drilling Contractor :
Dale Jackson Production Company

Database File: stainbrook10w14.db
Dataset Pathname: pass1
Presentation Format: gr-n-ccl
Dataset Creation: Tue May 20 14:58:48 2014 by Log SCH 111116
Charted by: Depth in Feet scaled 1:240


0 Gamma Ray (cps) 150
150 Gamma Ray (cps) 300

-1 CCL 1

100

Neutron (cps)

1900

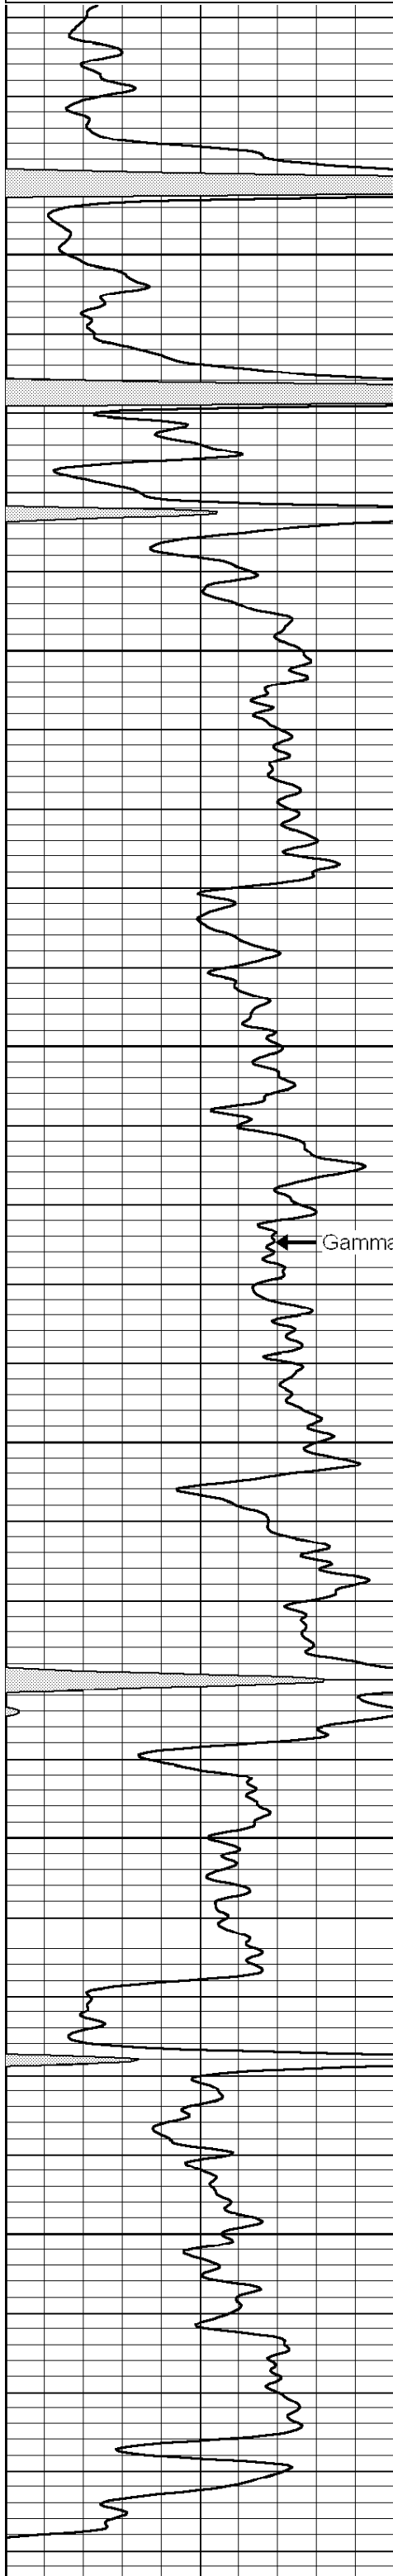

Gamma Ray

CCL